
Optima Series

COMMAND REFERENCE

Manual Rev. 1.0j

By Galil Motion Control, Inc.

*Galil Motion Control, Inc.
3750 Atherton Road
Rocklin, California 95765
Phone: (916) 626-0101
Fax: (916) 626-0102
Internet Address: support@galilmc.com
URL: www.galilmc.com*

Rev 10-00

Overview

Controller Notation

This command reference is a supplement to the Galil User Manual. For proper controller operation, consult the Users Manual. This command reference describes commands for Galil Optima Series Motion Controllers: DMC-1200, DMC-1600, DMC-1700, DMC-1800, DMC-2x00 and DMC-2100. Commands are listed in alphabetical order.

Please note that all commands may not be valid for every controller. To identify the controllers for which the command is applicable, please review the Usage Section of the command description and whether the following icon: appears.

Servo and Stepper Motor Notation:

Your motion controller has been designed to work with both servo and stepper type motors. Installation and system setup will vary depending upon whether the controller will be used with stepper motors, or servo motors. To make finding the appropriate instructions faster and easier, icons will be next to any information that applies exclusively to one type of system. Otherwise, assume that the instructions apply to all types of systems. The icon legend is shown below.



Attention!: Pertains to servo motor use.



Attention!: Pertains to stepper motor use.

Command Descriptions

Each executable instruction is listed in the following section in alphabetical order. Below is a description of the information which is provided for each command.

The two-letter Opcode for each instruction is placed in the upper right corner. Some commands have a binary equivalent and the binary value is listed next to the ASCII command in parenthesis. For binary command mode, see discussion below. Below the opcode is a description of the command and required arguments.

Axes Arguments

Some commands require the user to identify the specific axes to be affected. These commands are followed by uppercase X,Y,Z, W or A,B,C,D,E,F,G and H. No commas are needed and the order of axes is not important. Do not insert any spaces prior to any command. For example, STX; AMX is invalid because there is a space after the semicolon. The proper syntax for commands requires that the command argument be separated from the command by a single space. When an argument is not required and is not given, the command is executed for all axes.

Valid syntax

SH X	Servo Here, X only
SH XYW	Servo Here, X,Y and W axes
SH XZW	Servo Here, X,Z and W axes
SH XYZW	Servo Here, X,Y,Z and W axes
SH BCAD	Servo Here, A,B,C and D axes (Note: ABCD IS the same as XYZW)
SH ADEG	Servo Here, A,D,E and G axes (Note: AD is the same as XW)
SH H	Servo Here, H axis only
SH	Servo Here, all axes

Parameter Arguments

Some commands require numerical arguments to be specified following the instruction. In the argument description, these commands are followed by lower case n,n,n,n,n,n,n,n, where the letter, n, represents the value. Values may be specified for any axis separately or any combination of axes. The argument for each axis is separated by commas. Examples of valid syntax are listed below.

Valid syntax

AC n	Specify argument for x axis only
AC n,n	Specify argument for x and y only
AC n,,n	Specify argument for x and z only
AC n,n,n,n	Specify arguments for x,y,z,w axes
AC n,n,n,n	Specify arguments for a,b,c,d (Note: a,b,c,d are the same as x,y,z,w)
AC ,n,,n	Specify arguments for b and e axis only (Note: b and y axis are the same)
AC ,,n,n	Specify arguments for e and f (Note: e and z axis are the same)

Where n is replaced by actual values.

Direct Command Arguments

An alternative method for specifying data is to set data for individual axes using an axis designator followed by an equals sign. The * symbol can be used in place of the axis designator. The * defines data for all axes to be the same. For example:

PRY=1000	Sets Y axis data at 1000
PR*=1000	Sets all axes to 1000

Interrogation

Most commands accept a question mark (?) as an argument. This argument causes the controller to return parameter information listed in the command description. Type the command followed by a ? for each axis requested. The syntax format is the same as the parameter arguments described above except '?' replaces the values.

PR ?	The controller will return the PR value for the X axis
------	--

PR ,,,?	The controller will return the PR value for the W axis
PR ?,?,?/?	The controller will return the PR value for the A,B,C and D axes
PR ,,,,,,?	The controller will return the PR value for the H axis

Operand Usage

Most commands have a corresponding operand that can be used for interrogation. The Operand Usage description provides proper syntax and the value returned by the operand. Operands must be used inside of valid DMC expressions. For example, to display the value of an operand, the user could use the command:

MG 'operand'

All of the command operands begin with the underscore character (_). For example, the value of the current position on the X axis can be assigned to the variable 'V' with the command:

V=_TPX

Usage Description

The Usage description specifies the restrictions on proper command usage. The following provides an explanation of the command information provided:

"While Moving":

Describes whether the command is valid while the controller is performing a motion.

"In a program":

Describes whether the command may be used as part of a user-defined program.

"Command Line":

Describes whether the command may be used as a direct command.

"Controller Usage":

Identifies the controller models that can accept the command.

Default Description

In the command description, the DEFAULT section provides the default values for controller setup parameters. These parameters can be changed and the new values can be saved in the controller's non-volatile memory by using the command, BN. If the setup parameters are not saved in non-volatile memory, the default values will automatically reset when the system is reset. A reset occurs when the power is turned off and on, when the reset button is pushed, or the command, RS, is given.

Resetting the Controller to Factory Default

When a master reset occurs, the controller will always reset all setup parameters to their default values and the non-volatile memory is cleared to the factory state. A master reset is executed by the command, <ctrl R> <ctrl S> <Return> OR by powering up or resetting the controller with the MRST jumper or dip switch on.

For example, the command KD is used to set the Derivative Constant for each axis. The default value for the derivative constant is 64. If this parameter is not set by using the command, KD, the controller will automatically set this value to 64 for each axis. If the Derivative Constant is changed but not saved in non-volatile memory, the default value of 64 will be used if the controller is reset or upon power up of the controller. If this value is set and saved in non-volatile memory, it will be restored upon reset until a master reset is given to the controller.

The default format describes the format for numerical values which are returned when the command is interrogated. The format value represents the number of digits before and after the decimal point.

Binary Commands

Some commands have an equivalent binary value for the controllers. These values are listed next to the command in parentheses in hexadecimal format *. Binary communication mode can be executed much faster than ASCII commands. Binary format can only be used when commands are sent from the PC and cannot be embedded in an application program.

* hexadecimal format represents a byte as two 4 bit values. Each 4 bit value is represented as a single character with a decimal equivalent between 0 and 15. The characters used for representing 10-15 is A,B,C,D,E and F. For example, the hexadecimal value **6D** represent the binary value 01101101. Negative values are represented in 2's complement.

Binary Command Format

All binary commands have a 4 byte header followed by data fields. The 4 bytes are specified in hexadecimal format.

Header Format:

Byte 1 specifies the command number between 80 to FF. The complete binary command number table is listed below.

Byte 2 specifies the # of bytes in each field as 0, 1, 2, 4 or 6 as follows:

00	No datafields (i.e. SH or BG)
01	One byte per field
02	One word (2 bytes per field)
04	One long word (4 bytes) per field
06	Galil real format (4 bytes integer and 2 bytes fraction)

Byte 3 specifies whether the command applies to a coordinated move as follows:

00	No coordinated motion movement
01	Coordinated motion movement

For example, the command STS designates motion to stop on a vector motion. The third byte for the equivalent binary command would be 01.

Byte 4 specifies the axis # or data field as follows

Bit 7 = H axis or 8 th data field
Bit 6 = G axis or 7 th data field
Bit 5 = F axis or 6 th data field
Bit 4 = E axis or 5 th data field
Bit 3 = D axis or 4 th data field
Bit 2 = C axis or 3 rd data field
Bit 1 = B axis or 2 nd data field
Bit 0 = A axis or 1 st data field

Datafields Format

Datafields must be consistent with the format byte and the axes byte. For example, the command PR 1000,, -500 would be

A7 02 00 05 03 E8 FE 0C

where A7 is the command number for PR

02 specifies 2 bytes for each data field

00 S is not active for PR

05 specifies bit 0 is active for A axis and bit 2 is active for C axis ($2^0 + 2^2=5$)

03 E8 represents 1000

FE 0C represents -500

Example

The command ST XYZS would be

A1 00 01 07

where A1 is the command number for ST

00 specifies 0 data fields

01 specifies stop the coordinated axes S

07 specifies stop X (bit 0), Y (bit 1) and Z (bit 2) $2^0+2^1+2^2=7$

Binary command table

COMMAND	NO.	COMMAND	NO.	COMMAND	NO.
reserved	80	reserved	ab	reserved	d6
KP	81	reserved	ac	reserved	d7
KI	82	reserved	ad	RP	d8
KD	83	reserved	ae	TP	d9
DV	84	reserved	af	TE	da
AF	85	LM	b0	TD	db
KF	86	LI	b1	TV	dc
PL	87	VP	b2	RL	dd
ER	88	CR	a3	TT	de
IL	89	TN	b4	TS	df
TL	8a	LE, VE	b5	TI	e0
MT	8b	VT	b6	SC	e1
CE	8c	VA	b7	reserved	e2
OE	8d	VD	b8	reserved	e3
FL	8e	VS	b9	reserved	e4
BL	8f	VR	ba	TM	e5
AC	90	reserved	bb	CN	e6
DC	91	reserved	bc	LZ	e7
SP	92	CM	bd	OP	e8
IT	93	CD	be	OB	e9
FA	94	DT	bf	SB	ea
FV	95	ET	c0	CB	eb
GR	96	EM	c1	II	ec

DP	97	EP	c2	EI	ed
DE	98	EG	c3	AL	ee
OF	99	EB	c4	reserved	ef
GM	9a	EQ	c5	reserved	f0
reserved	9b	EC	c6	reserved	f1
reserved	9c	reserved	c7	reserved	f2
reserved	9d	AM	c8	reserved	f3
reserved	9e	MC	c9	reserved	f4
reserved	9f	TW	ca	reserved	f5
BG	a0	MF	cb	reserved	f6
ST	a1	MR	cc	reserved	f7
AB	a2	AD	cd	reserved	f8
HM	a3	AP	ce	reserved	f9
FE	a4	AR	cf	reserved	fa
FI	a5	AS	d0	reserved	fb
PA	a6	AI	d1	reserved	fc
PR	a7	AT	d2	reserved	fd
JG	a8	WT	d3	reserved	fe
MO	a9	WC	d4	reserved	ff
SH	aa	reserved	d5		

Fast Firmware Operation

The motion controllers can operate in a mode which allows for very fast servo update rates. This mode is known as 'fast mode' and allows the following update rates:

Optima Controllers with 1-2 axes	125 usec
Optima Controllers with 3-4 axes	250 usec
Optima Controllers with 5-6 axes	375 usec
Optima Controllers with 7-8 axes	500 usec

Note: To set the desired update rates use the command, TM.

In order to run the motion controller in fast mode, the fast firmware must be uploaded. This can be done through the Galil terminal software such as DMCTERM and WSDK. Use the menu option, "Update Flash EEPROM" to change the controller firmware. The fast firmware is included with the controller utilities.

When operating in fast mode, there are functions which are disabled and/or altered.

Commands which are not Allowed when Operating in Fast Mode:

Command
Gearing Mode
Ecam Mode
Pole (PL)
Analog Feedback (AF)
Stepper Motor Operation (MT 2, -2, 2.5, -2.5)
Trippoints allowed only in thread 0
DMA channel
Tell Velocity Interrogation Command (TV)

Commands which are Altered when Operating in Fast Mode:

Command	Modification
MT	Command argument 2, 2.5, -2, -2.5 not valid
AD, AI, AM, AP, AR, AS, AT, AV, MC, MF, MR, WC	Commands not allowed in threads 1-7

Trippoints

The Optima series controllers provide several commands that can be used to make logical decisions, or “trippoints,” based on events during a running program. Such events include: the completion of a specific motion, waiting for a certain position to be reached, or simply waiting for a certain amount of time to elapse.

When a program is executing on the controller, each program line is executed sequentially. However, when a trippoint command is executed, the program halts execution of the next line of code until the status of the trippoint is cleared. Note that the trippoint only halts execution of the thread from which it is commanded while all other independent threads are unaffected. Additionally, if the trippoint is commanded from a subroutine, execution of the subroutine, as well as the main thread, is halted.

Since trippoint commands are used as program flow instructions during a running program, they should not be implemented directly from the command line of the terminal. Sending a trippoint command directly from the command line might cause an interruption in communications between the host PC and the controller until the trippoint is cleared.

As a brief introduction, the following table lists the available commands and their basic usages:

AD	after distance
AI	after input
AM	after move
AP	after absolute position
AR	after relative position
AS	at speed
AT	at time relative to a reference time
AV	after vector distance
MC	motion complete and “in position”
MF	after motion reverse
MR	after motion reverse
WC	wait for contour data to complete
WT	wait for time

Instruction Set

Brushless Motor Commands

BA	Brushless axis
BB	Brushless phase
BC	Brushless calibration
BD	Brushless degrees
BI	Brushless inputs
BM	Brushless modulo
BO	Brushless offset
BS	Brushless setup
BZ	Brushless zero

Contour Mode Commands

CD	Contour data
CM	Contour mode
DT	Contour time interval
WC	Wait for contour data

ECAM/Gearing

EA	Ecama master
EB	Enable ECAM
EC	ECAM table index
EG	ECAM go
EM	ECAM cycle
EP	ECAM interval
EQ	Disengage ECAM
ET	ECAM table entry
GA	Master axis for gearing
GM	Gantry mode
GR	Gear ratio for gearing

Error Control Commands

BL	Backward software limit
ER	Error limit
FL	Forward software limit
OE	Off-on-error function
TL	Torque limit
TW	Timeout for in-position

Ethernet Commands (DMC-2100 only)

AO	Analog output voltage of Modbus devices
IA	Set IP address
IH	Internet handle
MB	ModBus

I/O Commands

AL	Arm latch
CB	Clear bit
CI	Communication interrupt
CO	Configure I/O points
EI	Enable interrupts
II	Input interrupt
OB	Define output bit

OC	Output compare function
OP	Output port
SB	Set bit
UI	User interrupts

Independent Motion Commands

AB	Abort motion
AC	Acceleration
BG	Begin motion
DC	Deceleration
FE	Find edge
FI	Find index
HM	Home
HX	Halt execution
IP	Increment position
IT	Smoothing time constant
JG	Jog mode
PA	Position absolute
PR	Position relative
SP	Speed
ST	Stop

Interrogation Commands

LA	List arrays
_LF	Forward limit switch operand
LL	List labels
_LR	Reverse limit switch operand
LS	List program
LV	List variables
MG	Message command
QR	Data record
QZ	Return DMA information
RP	Report command position
RL	Report latch
^R^V	Firmware revision information
SC	Stop code
TB	Tell status
TC	Tell error code
TD	Tell dual encoder
TE	Tell error
TI	Tell input
TIME	Time operand, internal clock
TP	Tell position
TR	Trace program
TS	Tell switches
TT	Tell torque
TV	Tell velocity

Math/Special Functions

@SIN[x]	Sine of x
@COS[x]	Cosine of x
@COM[x]	1's compliment of x
@ASIN[x]	Arc sine of x
@ACOS[x]	Arc cosine of x
@ATAN[x]	Arc tangent of x
@ABS[x]	Absolute value of x

@FRAC[x]	Fraction portion of x
@INT[x]	Integer portion of x
@RND[x]	Round of x
@SQR[x]	Square root of x
@IN[x]	State of digital input x
@OUT[x]	State of digital output x
@AN[x]	Value of analog input x

Programming Commands

DA	Deallocate variables/arrays
DL	Download program
DM	Dimension arrays
ED	Edit program
ELSE	Conditional statement
ENDIF	End of conditional statement
EN	End program
IF	If statement
IN	Input variable
JP	Jump
JS	Jump to subroutine
NO	No-operation—for remarks
RA	Record array, automatic data capture
RC	Record interval for RA
RD	Record data for RA
RE	Return from error routine
REM	Remark program
RI	Return from interrupt routine
UI	User Interrupt
UL	Upload program
XQ	Execute program
ZS	Zero stack

Servo Motor Commands

AF	Analog feedback
FA	Acceleration feedforward
FV	Velocity feedforward
IL	Integrator limit
KD	Derivative constant
KI	Integrator constant
KP	Proportional constant
NB	Notch bandwidth
NF	Notch frequency
NZ	Notch zero
OF	Offset
PL	Pole
SH	Servo here
TL	Torque limit
TM	Sample time
ZR	Zero

Stepper Motor Commands

DE	Define encoder position
DP	Define reference position
KS	Stepper motor smoothing
MT	Motor type
RP	Report commanded position

TD Step counts output
TP Tell position of encoder

System Configuration

BN Burn parameters
BP Burn program
BV Burn variables and arrays
CC Configure auxiliary port
CE Configure encoder type
CF Configure default port
CN Configure switches
CW Data adjustment bit
DE Define dual encoder position
DP Define position
DR DMA/FIFO update rate
DV Dual velocity (dual loop)
EI Enable interrupts
EO Echo off
IT Independent smoothing
LZ Leading zeros format
MO Motor off
MT Motor Type
PF Position format
QD Download array
QU Upload array
RS Reset
^R^S Master reset
^R^V Revision information
VF Variable format

Trippoint Commands

AD After distance
AI After input
AM After motion profiler
AP After absolute position
AR After relative distance
AS At speed
AT At time
AV After vector distance
MC Motion complete
MF After motion—forward
MR After motion—reverse
WC Wait for contour data
WT Wait for time

Vector/Linear Interpolation

CA Define vector plane
CR Circular interpolation move
CS Clear motion sequence
ES Ellipse scaling
LE Linear interpolation end
LI Linear interpolation segment
LM Linear interpolation mode
ST Stop motion
TN Tangent
VA Vector acceleration

VD	Vector deceleration
VE	Vector sequence end
VM	Coordinated motion mode
VP	Vector position
VR	Vector speed ratio
VS	Vector speed
VT	Smoothing time constant—vector

AB (Binary A2)

FUNCTION: Abort

DESCRIPTION:

AB (Abort) stops a motion instantly without a controlled deceleration. If there is a program operating, AB also aborts the program unless a 1 argument is specified. The command, AB, will shut off the motors for any axis in which the off-on-error function is enabled (see command "OE").

AB aborts motion on all axes in motion and cannot stop individual axes.

ARGUMENTS: AB n where

n = 0 The controller aborts motion and program

n = 1 The controller aborts motion only

No argument will cause the controller to abort the motion and program

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	---
In a Program	Yes	Default Format	---
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_AB gives state of Abort Input, 1 inactive and 0 active.

RELATED COMMANDS:

"SH" on page 158	Specifies deceleration rate.
"OE" on page 135	Specifies Off-On-Error

EXAMPLES:

AB	Stops motion
OE 1,1,1,1	Enable off-on-error
AB	Shuts off motor command and stops motion
#A	Label - Start of program
JG 20000	Specify jog speed on X-axis
BGX	Begin jog on X-axis
WT 5000	Wait 5000 msec
AB1	Stop motion without aborting program
WT 5000	Wait 5000 milliseconds
SH	Servo Here
JP #A	Jump to Label A
EN	End of the routine

Hint: Remember to use the parameter 1 following AB if you only want the motion to be aborted. Otherwise, your application program will also be aborted.

AC (Binary 90)

FUNCTION: Acceleration

DESCRIPTION:

The Acceleration (AC) command sets the linear acceleration rate of the motors for independent moves, such as PR, PA and JG moves. The acceleration rate may be changed during motion. The DC command is used to specify the deceleration rate.

ARGUMENTS: AC n,n,n,n,n,n,n,n or ACX=n where

n is an unsigned numbers in the range 1024 to 67107840. The parameters input will be rounded down to the nearest factor of 1024. The units of the parameters are counts per second squared.

n = ? Returns the acceleration value for the specified axes.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value	25600
Default Format	8.0

OPERAND USAGE:

_ACx contains the value of acceleration for the specified axis.

RELATED COMMANDS:

"DC" on page 56	Specifies deceleration rate.
"FA" on page 82	Feedforward Acceleration
"IT" on page 101	Smoothing constant - S-curve

EXAMPLES:

AC 150000,200000,300000,400000	Set X-axis acceleration to 150000, Y-axis to 200000 counts/sec ² , the Z-axis to 300000 counts/sec ² , and the W-axis to 400000 count/sec ² .
AC ?,?,?,?	Request the Acceleration
0149504,0199680,0299008,0399360	Return Acceleration (resolution, 1024)
V=_ACY	Assigns the Y acceleration to the variable V

Hint: Specify realistic acceleration rates based on your physical system such as motor torque rating, loads, and amplifier current rating. Specifying an excessive acceleration will cause large following error during acceleration and the motor will not follow the commanded profile. The acceleration feedforward command FA will help minimize the error.

AD (Binary CD)

FUNCTION: After Distance

DESCRIPTION:

The After Distance (AD) command is a trippoint used to control the timing of events. This command will hold up the execution of the following command until **one** of the following conditions have been met:

1. The commanded motor position crosses the specified relative distance from the start of the move.
2. The motion profiling on the axis is complete.
3. The commanded motion is in the direction which moves away from the specified position.

The units of the command are quadrature counts. Only one axis may be specified at a time. The motion profiler must be on or the trippoint will automatically be satisfied.

Note: AD command will be affected when the motion smoothing time constant, IT, is not 1. See IT command for further information.

ARGUMENTS: AD n,n,n,n,n,n,n,n or ADX=n or ADN=n where n is an unsigned integers in the range 0 to 2147483647 decimal.

ADN= sets trippoint for N axis

Note: The AD command cannot have more than 1 argument.

USAGE:

	Yes	Default Value	-
While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

DEFAULTS:

RELATED COMMANDS:

"AV" on page 26	After distance for vector moves
"AP" on page 21	After position trip point
"AR" on page 23	After relative distance trip point
"MF" on page 124	Motion Forward trip point
"MR" on page 127	Motion Reverse trip point

EXAMPLES:

#A;DP0,0,0,0	Begin Program
PR 10000,20000,30000,40000	Specify positions
BG	Begin motion
AD 5000	After X reaches 5000
MG "Halfway to X";TPX	Send message
AD ,10000	After Y reaches 10000
MG "Halfway to Y";TPY	Send message
AD ,,15000	After Z reaches 15000
MG "Halfway to Z";TPZ	Send message
AD ,,20000	After W reaches 20000
MG "Halfway to W";TPW	Send message
EN	End Program

Hint: The AD command is accurate to the number of counts that occur in 2 msec. Multiply your speed by 2 msec to obtain the maximum position error in counts. Remember AD measures incremental distance from start of move on one axis.

AF (Binary 85)

FUNCTION: Analog Feedback

DESCRIPTION:

The Analog Feedback (AF) command is used to set an axis with analog feedback instead of digital feedback (quadrature/pulse dir). The analog feedback is decoded by a 12-bit A/D converter, therefore an input voltage of 10 volts is decoded as a position of 2047 counts and a voltage of -10 volts corresponds to a position of -2048 counts. An option is available for 16-bits where an input voltage of 10 volts is decoded as a position of 32,768 counts and a voltage of -10 volts corresponds to a position of -32,767 counts.

ARGUMENTS: AF n,n,n,n,n,n,n,n or AFX=n where

n = 1 Enables analog feedback

n = 0 Disables analog feedback and switches to digital feedback

n = ? Returns the state of analog feedback for the specified axes. 0 disabled, 1 enabled

USAGE:

While Moving No
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0,0,0,0
Default Format -

ALL CONTROLLERS

OPERAND USAGE:

_AFx contains a "1" if analog feedback is enabled and "0" if not enabled for the specified axis.

RELATED COMMANDS:

"MT" on page 128 Motor Type
"CE" on page 46 Configure Encoder

EXAMPLES:

AF 1,0,0,1 Analog feedback on X and W axis
V1 = _AFX Assign feedback type to variable
AF ?,?,? Interrogate feedback type

AI (Binary D1)

FUNCTION: After Input

DESCRIPTION:

The AI command is a trippoint used in motion programs to wait until after a specified input has changed state. This command can be configured such that the controller will wait until the input goes high or the input goes low.

ARGUMENTS: AI +/-n where

n is an integer between 1 and 96 and represents the input number. If n is positive, the controller will wait for the input to go high. If n is negative, it waits for n to go low.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

DEFAULTS:

Default Value -
Default Format -

ALL CONTROLLERS

RELATED COMMANDS:

@IN[n] Function to read input 1 through 8
"II" on page 96 Input interrupt
#ININT Label for input interrupt

EXAMPLES:

#A Begin Program
AI 8 Wait until input 8 is high
SP 10000 Speed is 10000 counts/sec
AC 20000 Acceleration is 20000 counts/sec²
PR 400 Specify position
BG X Begin motion
EN End Program

Hint: The AI command actually halts execution until specified input is at desired logic level. Use the conditional Jump command (JP) or input interrupt (II) if you do not want the program sequence to halt.

AL (Binary EE)

FUNCTION: Arm Latch

DESCRIPTION:

The AL command enables the latching function (high speed main or auxiliary position capture) of the controller. When the position latch is armed, the main or auxiliary encoder position will be captured upon a low going signal. Each axis has a position latch and can be activated through the general inputs:

X (A) axis latch	Input 1
Y (B) axis latch	Input 2
Z (C) axis latch	Input 3
W (D)axis latch	Input 4
E axis latch	Input 9
F axis latch	Input 10
G axis latch	Input 11
H axis latch	Input 12

The command RL returns the captured position for the specified axes. When interrogated the AL command will return a 1 if the latch for that axis is armed or a zero after the latch has occurred. The CN command can be used to change the polarity of the latch function.

ARGUMENTS: AL xxxxxxxx or AL x,x,x,x,x,x,x,x where

x can be X,Y,Z,W,A,B,C,D,E,F,G or H. The value of x is used to specify main encoder for the specified axis to be latched

x can be SX,SY,SZ,SW,SA,SB,SC,SD,SE,SF,SG or SH. The value of x is used to specify the auxiliary encoder for the specified axis to be latched

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value	0
Default Format	1.0

OPERAND USAGE:

_ALx contains the state of the specified latch. 0 = not armed, 1 = armed.

RELATED COMMANDS:

"RL" on page 151 Report Latch

EXAMPLES:

#START	Start program
ALY	Arm Y-axis latch
JG,50000	Set up jog at 50000 counts/sec
BGY	Begin the move
#LOOP	Loop until latch has occurred
JP #LOOP,_ALY=1	
RLY	Transmit the latched position
EN	End of program

AM (Binary C8)

FUNCTION: After Move

DESCRIPTION:

The AM command is a trippoint used to control the timing of events. This command will hold up execution of the following commands until the current move on the specified axis or axes is completed. Any combination of axes or a motion sequence may be specified with the AM command. For example, AM XY waits for motion on both the X and Y axis to be complete. AM with no parameter specifies that motion on all axes is complete.

ARGUMENTS: AM xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G,H,S or T or any combination to specify the axis or sequence

x is N for the virtual axis, N

No argument specifies to wait for after motion on all axes and / or sequences

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	0
Default Format	1.0

ALL CONTROLLERS

RELATED COMMANDS:

"BG" on page 31 _BGx contains a 0 if motion complete

EXAMPLES:

#MOVE	Program MOVE
PR 5000,5000,5000,5000	Position relative moves
BG X	Start the X-axis
AM X	After the move is complete on X,
BG Y	Start the Y-axis
AM Y	After the move is complete on Y,
BG Z	Start the Z-axis
AM Z	After the move is complete on Z
BG W	Start the W -axis
AM W	After the move is complete on W
EN	End of Program

Hint: AM is a very important command for controlling the timing between multiple move sequences. For example, if the X-axis is in the middle of a position relative move (PR) you cannot make a position absolute move (PAX, BGX) until the first move is complete. Use AMX to halt the program sequences until the first motion is complete. AM tests for profile completion. The actual motor may still be moving. Another method for testing motion complete is to check for the internal variable _BG, being equal to zero.

AO

FUNCTION: Analog Out

DESCRIPTION:

The AO command sets the analog output voltage of Modbus Devices connected via Ethernet.

ARGUMENTS: AO m, n where

m is the I/O number calculated using the following equations:

$$m = (\text{SlaveAddress} * 1000) + (\text{Handle Num} * 1000) + ((\text{Module} - 1) * 4) + (\text{Bitnum} - 1)$$

Slave Address is used when the ModBus device has slave devices connected to it and specified as Addresses 0 to 255. Please note that the use of slave devices for modbus are very rare and this number will usually be 0.

HandleNum is the handle specifier from A to F.

Module is the position of the module in the rack from 1 to 16.

BitNum is the I/O point in the module from 1 to 4.

n = the voltage which ranges from 9.99 to -9.99

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	---
Default Format	---

DMC-2100 ONLY

RELATED COMMANDS:

"SB" on page 156	Set Bit
"CB" on page 43	Clear Bit

EXAMPLES:

AP (Binary CE)

FUNCTION: After Absolute Position

DESCRIPTION:

The After Position (AP) command is a trippoint used to control the timing of events. This command will hold up the execution of the following command until one of the following conditions have been met:

1. The actual motor position crosses the specified absolute position. When using a stepper motor, this condition is satisfied when the stepper position (as determined by the output buffer) has crossed the specified position. For further information see Chapter 6 of the User Manual “*Stepper Motor Operation*”.
2. The motion profiling on the axis is complete.
3. The commanded motion is in the direction which moves away from the specified position.

The units of the command are quadrature counts. Only one axis may be specified at a time. The motion profiler must be on or the trippoint will automatically be satisfied

ARGUMENTS: AP n,n,n,n,n,n,n,n or APX=n where

n is a signed integer in the range -2147483648 to 2147483647 decimal

USAGE:

While Moving	Yes	Default Value	---
In a Program	Yes	Default Format	---
Command Line	Yes		
Controller Usage		ALL CONTROLLERS	

DEFAULTS:

RELATED COMMANDS:

"AD" on page 15	Trippoint for relative distances
"MF" on page 124	Trippoint for forward motion

EXAMPLES:

#TEST	Program B
DP0	Define zero
JG 1000	Jog mode (speed of 1000 counts/sec)
BG X	Begin move
AP 2000	After passing the position 2000
V1=_TPX	Assign V1 X position
MG "Position is", V1=	Print Message
ST	Stop
EN	End of Program

Hint: The accuracy of the AP command is the number of counts that occur in 2 msec. Multiply the speed by 2 msec to obtain the maximum error. AP tests for absolute position. Use the AD command to measure incremental distances.

AR (Binary CF)

FUNCTION: After Relative Distance

DESCRIPTION:

The After Relative (AR) command is a trippoint used to control the timing of events. This command will hold up the execution of the following command until one of the following conditions have been met:

1. The actual motor position crosses the specified relative distance from either the start of the move or the last AR or AD command. When using a stepper motor, this condition is satisfied when the stepper position (as determined by the output buffer) has crossed the specified Relative Position. For further information see Chapter 6 of the User Manual "*Stepper Motor Operation*".
2. The motion profiling on the axis is complete.
3. The commanded motion is in the direction which moves away from the specified position.

The units of the command are quadrature counts. Only one axis may be specified at a time. The motion profiler must be on or the trippoint will automatically be satisfied.

Note: AR will be affected when the motion smoothing time constant, IT, is not 1. See IT command for further information.

ARGUMENTS: AR n,n,n,n,n,n,n,n or ARX=n where
n is an unsigned integer in the range 0 to 2147483647 decimal.

USAGE:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

DEFAULTS:

RELATED COMMANDS:

"AV" on page 26	Trippoint for after vector position for coordinated moves
"AP" on page 21	Trippoint for after absolute position

EXAMPLES:

#A;DP 0,0,0,0	Begin Program
JG 50000,,7000	Specify speeds
BG XW	Begin motion
#B	Label
AR 25000	After passing 25000 counts of relative distance on X-axis
MG "Passed_X";TPX	Send message on X-axis
JP #B	Jump to Label #B
EN	End Program

Hint: AR is used to specify incremental distance from last AR or AD command. Use AR if multiple position trippoints are needed in a single motion sequence.

AS (Binary DO)

FUNCTION: At Speed

DESCRIPTION:

The AS command is a trippoint that occurs when the generated motion profile has reached the specified speed. This command will hold up execution of the following command until the commanded speed has been reached. The AS command will operate after either accelerating or decelerating. If the speed is not reached, the trippoint will be triggered after the motion is stopped (after deceleration).

ARGUMENTS: AS xxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G,H,S or T or any combination to specify the axis or sequence

x is N for the virtual axis, N

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	-
Default Format	-

ALL CONTROLLERS

EXAMPLES:

#SPEED	Program A
PR 100000	Specify position
SP 10000	Specify speed
BG X	Begin X
ASX	After speed is reached
MG "At Speed"	Print Message
EN	End of Program

WARNING:

The AS command applies to a trapezoidal velocity profile only with linear acceleration.. AS used with Smoothing profiling will be inaccurate.

AT (Binary D2)

FUNCTION: At Time

DESCRIPTION:

The AT command is a trippoint which is used to hold up execution of the next command until after the specified time has elapsed. The time is measured with respect to a defined reference time. AT 0 establishes the initial reference. AT n specifies n msec from the reference. AT -n specifies n msec from the reference and establishes a new reference after the elapsed time period.

ARGUMENTS: AT n where

n is a signed, even integer in the range 0 to 2 Billion

n = 0 defines a reference time at current time

n > 0 specifies a wait time of n msec from the reference time

n < 0 specifies a wait time of n msec from the reference time and re-sets the reference time when the trippoint is satisfied.

(AT -n is equivalent to AT n; AT <old reference +n>

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format -

ALL CONTROLLERS

EXAMPLES:

The following commands are sent sequentially

AT 0 Establishes reference time 0 as current time
AT 50 Waits 50 msec from reference 0
AT 100 Waits 100 msec from reference 0
AT -150 Waits 150 msec from reference 0 and sets new reference at 150
AT 80 Waits 80 msec from new reference (total elapsed time is 230 msec)

AV

FUNCTION: After Vector Distance

DESCRIPTION:

The AV command is a trippoint which is used to hold up execution of the next command during coordinated moves such as VP,CR or LI. This trippoint occurs when the path distance of a sequence reaches the specified value. The distance is measured from the start of a coordinated move sequence or from the last AV command. The units of the command are quadrature counts.

ARGUMENTS: AV s,t where

s and t are unsigned integers in the range 0 to 2147483647 decimal. 's' represents the vector distance to be executed in the S coordinate system and 't' represents the vector distance to be executed in the T coordinate system.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	0
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_AVS contains the vector distance from the start of the sequence in the S coordinate system and _AVT contains the vector distance from the start of the sequence in the T coordinate system.

EXAMPLES:

#MOVE;DP 0,0	Label
CAT	Specify the T coordinate system
LMXY	Linear move for X,Y
LI 1000,2000	Specify distance
LI 2000,3000	Specify distance
LE	
BGT	Begin motion in the T coordinate system
AV ,500	After path distance = 500,
MG "Path>500";TPXY	Print Message
EN	End Program

Hint: Vector Distance is calculated as the square root of the sum of the squared distance for each axis in the linear or vector mode.

BA

FUNCTION: Brushless Axis

DESCRIPTION:

The BA command configures the controller axes for sinusoidal commutation and reconfigures the controller to reflect the actual number of motors that can be controlled. Each sinusoidal commutation axis requires 2 motor command signals. The second motor command signals will always be associated with the highest axes on the controller. For example a 3 axis controller with X and Z configured for sinusoidal commutation will require 5 command outputs (5 axes controller), where the second outputs for X and Z will be the W and E axes respectively.

ARGUMENTS: BA xxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or any combination to specify the axis (axes) for sinusoidal commutation brushless axes.

No argument removes all axes configured for sinusoidal commutation.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

DEFAULTS:

Default Value 0
Default Format 0

ALL CONTROLLERS

OPERAND USAGE:

BAx indicates the axis number of the auxiliary DAC used for the second phase of the selected sinusoidal axis. The axis numbers start with zero for the X axis DAC. If the motor is configured as standard servo or stepper motor, BAx contains 0.

RELATED COMMANDS:

"BB" on page 28	Brushless Phase Begins
"BC" on page 29	Brushless Commutation
"BD" on page 30	Brushless Degrees
"BI" on page 32	Brushless Inputs
"BM" on page 34	Brushless Modul
"BO" on page 36	Brushless Offset
"BS" on page 38	Brushless Setup
"BZ" on page 41	Brushless Zero

BB (Binary 9E)

FUNCTION: Brushless Phase Begins

DESCRIPTION:

The BB function describes the position offset between the Hall transition point and $\theta = 0$, for sinusoidally commutated motor. This command must be saved in non-volatile memory to be effective upon reset.

ARGUMENTS: BB n,n,n,n,n,n,n,n or BAX=n where

n is a signed integer which represent the phase offset of the selected axes, expressed in multiples of 30°.

n = ? returns the hall offset for the specified axis.

USAGE:

DEFAULTS:

While Moving	No	Default Value	0
In a Program	Yes	Default Format	0
Command Line	Yes		
Controller Usage		ALL CONTROLLERS	

EXAMPLES:

BB, 30,,60 The offsets for the Y and W axes are 30° and 60° respectively

OPERAND USAGE:

_BBx contains the position offset between the Hall transition and $\theta = 0$ for the specified axis.

RELATED COMMANDS:

"BA" on page 27	Brushless Axis
"BC" on page 29	Brushless Commutation
"BD" on page 30	Brushless Degrees
"BI" on page 32	Brushless Inputs
"BM" on page 34	Brushless Modulo
"BO" on page 36	Brushless Offset
"BS" on page 38	Brushless Setup
"BZ" on page 41	Brushless Zero

Note: BB is only effective as part of the BC command or upon reset.

BC

FUNCTION: Brushless Calibration

DESCRIPTION:

The function BC monitors the status of the Hall sensors of a sinusoidally commutated motor, and resets the commutation phase upon detecting the first hall sensor. This procedure replaces the estimated commutation phase value with a more precise value determined by the hall sensors.

ARGUMENTS: BC xxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or any combination to specify the axis

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format 0

ALL CONTROLLERS

OPERAND USAGE:

_BCx contains the state of the Hall sensor inputs. This value should be between 1 and 6.

RELATED COMMANDS:

"BA" on page 27 Brushless Axis
"BB" on page 28 Brushless Phase Begins
"BD" on page 30 Brushless Degrees
"BI" on page 32 Brushless Inputs
"BM" on page 34 Brushless Modulo
"BO" on page 36 Brushless Offset
"BS" on page 38 Brushless Setup
"BZ" on page 41 Brushless Zero

BD (Binary 9D)

FUNCTION: Brushless Degrees

DESCRIPTION:

This command sets the commutation phase of a sinusoidally commutated motor. When using hall effect sensors, a more accurate value for this parameter can be set by using the command, BC. This command should not be used except when the user is creating a specialized phase initialization procedure.

ARGUMENTS: BD n,n,n,n,n,n,n,n or BDX=n where

n is an integer between 0 - 360°.

n = ? Returns the current brushless motor angle (between 0-360°)

USAGE:

While Moving	No	Default Value	0
In a Program	Yes	Default Format	0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

DEFAULTS:

OPERAND USAGE:

_BDx contains the commutation phase of the specified axis.

RELATED COMMANDS:

"BA" on page 27	Brushless Axis
"BB" on page 28	Brushless Phase Begins
"BC" on page 29	Brushless Commutation
"BI" on page 32	Brushless Inputs
"BM" on page 34	Brushless Modulo
"BO" on page 36	Brushless Offset
"BS" on page 38	Brushless Setup
"BZ" on page 41	Brushless Zero

BG (Binary AO)

FUNCTION: Begin

DESCRIPTION:

The BG command starts a motion on the specified axis or sequence.

ARGUMENTS: BG xxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G,H,S or T or any combination to specify the axis or sequence

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format -

ALL CONTROLLERS

OPERAND USAGE:

_BGx contains a '0' if motion complete on the specified axis or coordinate system, otherwise contains a '1'.

RELATED COMMANDS:

"AM" on page 20 After motion complete
"ST" on page 160 Stop motion

EXAMPLES:

PR 2000,3000,,5000 Set up for a relative move
BG XYW Start the X,Y and W motors moving
HM Set up for the homing
BGX Start only the X-axis moving
JG 1000,4000 Set up for jog
BGY Start only the Y-axis moving
YSTATE=_BGY Assign a 1 to YSTATE if the Y-axis is performing a move
VP 1000,2000 Specify vector position
VS 20000 Specify vector velocity
BGS Begin coordinated sequence
VMXY Vector Mode
VP 4000,-1000 Specify vector position
VE Vector End
PR ,,8000,5000 Specify Z and W position
BGSZW Begin sequence and Z,W motion
MG_BGS Displays a 1 if motion occurring on coordinated system "S"

Hint: A BG command cannot be executed for any axis in which motion has not completed. Use the AM trippoint to wait for motion complete between moves. Determining when motion is complete can also be accomplished by testing for the value of the operand _BG.

BI

FUNCTION: Brushless Inputs

DESCRIPTION:

The command BI is used to define the inputs which are used when Hall sensors have been wired for sinusoidally commutated motors. These inputs can be the general use inputs (bits 1-8), the auxiliary encoder inputs (bits 81-96), or the extended I/O inputs (bits 17-80). The Hall sensors of each axis must be connected to consecutive input lines, for example: BI 3 indicates that inputs 3,4 and 4 are used for halls sensors.

The brushless setup command, BS, can be used to determine the proper wiring of the hall sensors.

ARGUMENTS: BI n,n,n,n,n,n,n,n or BIX=n where

n is an unsigned integer which represent the first digital input to be used for hall sensor input

n = 0 Clear the hall sensor configuration for the axis.

n = ? Returns the starting input used for Hall sensors for the specified axis.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format 0

ALL CONTROLLERS

OPERAND USAGE:

_BIx contains the starting input used for Hall sensors for the specified axis.

EXAMPLE:

BI, 5 The Hall sensor of the Y axis are on inputs 5, 6 and 7.

RELATED COMMANDS:

"BA" on page 27 Brushless Axis
"BB" on page 28 Brushless Phase Begins
"BC" on page 29 Brushless Commutation
"BD" on page 30 Brushless Degrees
"BM" on page 34 Brushless Modulo
"BO" on page 36 Brushless Offset
"BS" on page 38 Brushless Setup
"BZ" on page 41 Brushless Zero

BL (Binary 8F)

FUNCTION: Reverse Software Limit

DESCRIPTION:

The BL command sets the reverse software limit. If this limit is exceeded during motion, motion on that axis will decelerate to a stop. Reverse motion beyond this limit is not permitted.

When the reverse software limit is activated, the automatic subroutine #LIMSWI will be executed if it is included in the program and a program is executing. See User's Manual, Automatic Subroutine.

ARGUMENTS: BL n,n,n,n,n,n,n,n or BLX=n where

n is a signed integer in the range -2147483648 to 2147483647. The reverse limit is activated at the position n-1. The units are in quadrature counts.

n = -214783648 Turns off the reverse limit.

n = ? Returns the reverse software limit for the specified axes.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value	-214783648
Default Format	Position format

OPERAND USAGE:

_BLx contains the value of the reverse software limit for the specified axis.

RELATED COMMANDS:

"FL" on page 85	Forward Limit
"PF" on page 139	Position Formatting

EXAMPLES:

#TEST	Test Program
AC 1000000	Acceleration Rate
DC 1000000	Deceleration Rate
BL -15000	Set Reverse Limit
JG -5000	Jog Reverse
BGX	Begin Motion
AMX	After Motion (limit occurred)
TPX	Tell Position
EN	End Program

Hint: Galil Controllers also provide hardware limits.

BM (Binary 9B)

FUNCTION: Brushless Modulo

DESCRIPTION:

The BM command defines the length of the magnetic cycle in encoder counts.

ARGUMENTS: BM n,n,n,n,n,n,n,n or BMX=n where

n is a decimal value between 1 and 1000000 with a resolution of 1/10. This value can also be specified as a fraction with a resolution of 1/16.

n = ? Returns the brushless module for the specified axis.

USAGE:

DEFAULTS:

While Moving	No	Default Value	0
In a Program	Yes	Default Format	0
Command Line	Yes		
Controller Usage		ALL CONTROLLERS	

OPERAND USAGE:

_BMx indicates the cycle length in counts for the specified axis.

RELATED COMMANDS:

"BA" on page 27	Brushless Axis
"BB" on page 28	Brushless Phase Begins
"BC" on page 29	Brushless Commutation
"BD" on page 30	Brushless Degrees
"BI" on page 32	Brushless Inputs
"BO" on page 36	Brushless Offset
"BS" on page 38	Brushless Setup
"BZ" on page 41	Brushless Zero

EXAMPLES:

BM ,60000	Set brushless modulo for Y axis to be 60000
BMZ=100000/6	Set brushless modulo for Z axis to be 100000/3 (33333.333)
BM ,,?	Interrogate the Brushless Module for the W axis

Note: Changing the BM parameter causes an instant change in the commutation phase.

BN

FUNCTION: Burn

DESCRIPTION:

The BN command saves controller parameters shown below in Flash EEPROM memory. This command typically takes 1 second to execute and must not be interrupted. The controller returns a : when the Burn is complete.

PARAMETERS SAVED DURING BURN:

AC	CO	GA	LZ	TL
AF	CW	GM	MO	TM
BA	DC	GR	MT	TR
BB	DV	IA	OE	VA
BI	EI	IL	OF	VD
BL	EO	IT	OP	VF
BM	ER	KD	PF	VS
BO	FA	KI	PL	VT
CE	FL	KP	SB	
CN	FV	KS	SP	

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value -
Default Format -

OPERAND USAGE:

_BN contains the serial number of the controller.

RELATED COMMANDS:

"BP" on page 37 Burn Program
"BV" on page 40 Burn Variables

EXAMPLES:

KD 100 Set damping term for X axis
KP 10 Set proportional gain term for X axis
KI 1 Set integral gain term for X axis
AC 200000 Set acceleration
DC 150000 Set deceleration rate
SP 10000 Set speed
MT -1 Set motor type for X axis to be type '-1', reversed polarity servo motor
MO Turn motor off
BN Burn parameters; may take up to 15 seconds

BO (Binary 9F)

FUNCTION: Brushless Offset

DESCRIPTION:

The BO command sets a fixed offset on command signal outputs for sinusoidally commutated motors. This may be used to offset any bias in the amplifier, or can be used for phase initialization.

ARGUMENTS: BO n,n,n,n,n,n,n,n or BOX=n where

n specifies the voltage n is a signed number in the range -9.998 to +9.998 with a resolution of 0.003.

n = ? Return the brushless offset for the specified axis.

USAGE:

DEFAULTS:

While Moving	No	Default Value	0
In a Program	Yes	Default Format	0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_BOx contains the offset voltage on the DAC for the specified axis.

EXAMPLES:

BO -2,,1 Generates the voltages -2 and 1 on the first DAC X, and the second DAC Z of a sinusoidally commutated motor.

RELATED COMMANDS:

"BA" on page 27	Brushless Axis
"BB" on page 28	Brushless Phase Begins
"BC" on page 29	Brushless Commutation
"BD" on page 30	Brushless Degrees
"BI" on page 32	Brushless Inputs
"BM" on page 34	Brushless Modulo
"BS" on page 38	Brushless Setup
"BZ" on page 41	Brushless Zero

HINT: To assure that the output voltage equals the BO parameters, set the PID and of parameters to zero.

BP

FUNCTION: Burn Program

DESCRIPTION::

The BP command saves the application program in non-volatile EEPROM memory. This command typically takes up to 10 seconds to execute and must not be interrupted. The controller returns a : when the Burn is complete.

ARGUMENTS: None

USAGE:

While Moving	No
In a Program	No
Not in a Program	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value ---

RELATED COMMANDS:

"BN" on page 35	Burn Parameters
"BV" on page 40	Burn Variable

Note: This command may cause the Galil software to issue the following warning "A time-out occurred while waiting for a response from the controller". This warning is normal and is designed to warn the user when the controller does not respond to a command within the timeout period. This occurs because this command takes more time than the default timeout of 1 sec. The timeout can be changed in the Galil software but this warning does not affect the operation of the controller or software.

BS

FUNCTION: Brushless Setup

DESCRIPTION:

The command BS tests the wiring of a sinusoidally commutated brushless motor. If Hall sensors are connected, this command also tests the wiring of the Hall sensors. This function can only be performed with one axis at a time.

This command returns status information regarding the setup of brushless motors. The following information will be returned by the controller:

1. Correct wiring of the brushless motor phases.
2. An approximate value of the motor's magnetic cycle.
3. The value of the BB command (If hall sensors are used).
4. The results of the hall sensor wiring test (If hall sensors are used).

This command will turn the motor off when done and may be given when the motor is off.

Once the brushless motor is properly setup and the motor configuration has been saved in non-volatile memory, the BS command does not have to be re-issued. The configuration is saved by using the burn command, BN.

Note: In order to properly conduct the brushless setup, the motor must be allowed to move a minimum of one magnetic cycle in both directions.

ARGUMENTS: BSX= v, n where

v is a real number between 0 and 10. v represents the voltage level to be applied to each phase.

n is a positive integer between 100 or 1000. n represents the duration in milliseconds that voltage should be applied to the motor phases.

USAGE:

DEFAULTS:

While Moving	No	Default Value of V	0
In a Program	Yes	Default Value of n	200
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

EXAMPLES:

BSZ = 2,900 Apply set up test to Z axis with 2 volts for 900 millisecond on each step.

RELATED COMMANDS:

"BA" on page 27	Brushless Axis
"BB" on page 28	Brushless Phase Begins
"BC" on page 29	Brushless Commutation
"BD" on page 30	Brushless Degrees
"BI" on page 32	Brushless Inputs
"BM" on page 34	Brushless Modulo
"BO" on page 36	Brushless Offset
"BZ" on page 41	Brushless Zero

Note: When using Galil Windows software, the timeout must be set to a minimum of 10 seconds (timeout = 10000) when executing the BS command. This allows the software to retrieve all messages returned from the controller.

BV

FUNCTION: Burn Variables

DESCRIPTION: :

The BV command saves the controller variables in non-volatile EEPROM memory. This command typically takes up to 2 seconds to execute and must not be interrupted. The controller returns a : when the Burn is complete.

ARGUMENTS: None

USAGE:

While Moving	Yes
In a Program	Yes
Not in a Program	Yes
Controller Usage	

DEFAULTS:

Default Value	---
---------------	-----

ALL CONTROLLERS

RELATED COMMANDS:

"BP" on page 37 Burn Program

Note: This command may cause the Galil software to issue the following warning "A time-out occurred while waiting for a response from the controller". This warning is normal and is designed to warn the user when the controller does not respond to a command within the timeout period. This occurs because this command takes more time than the default timeout of 1 sec. The timeout can be changed in the Galil software but this warning does not affect the operation of the controller or software.

BZ

FUNCTION: Brushless Zero

DESCRIPTION:

The BZ command is used for axes which are configured for sinusoidal commutation. This command drives the motor to zero magnetic phase and then sets the commutation phase to zero.

This command may be given when the motor is off.

ARGUMENTS: BZ n,n,n,n,n,n,n or BZX =n or BZ <t where

n is a real number between -9.998 and 9.998. The parameter n will set the voltage to be applied to the amplifier during the initialization. In order to be accurate, the BZ command voltage must be large enough to move the motor. If the argument is positive, when the BZ operation is complete, the motor will be left in the off state, MO. A negative value causes the motor to end up in the on state, SH.

<t is an integer between 1 and 32767 and represents the settling time of the BZ function. The controller will wait 't' usec to update sufficient samples (sampling rate = 1000 usec by default) to settle the motor at the zero magnetic phase. The t parameter should be specified prior to issuing the BZ command.

Note: The BZ command causes instantaneous movement of the motor. It is recommended to start with small voltages and increase as needed

Note: Always use the Off-On-Error function (OE command) to avoid motor runaway whenever testing sinusoidal commutation.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value
Default Format

n = 0, t= 1000
0

OPERAND USAGE:

_BZx contains the distance in encoder counts from the motor's current position and the position of commutation zero for the specified axis. This can be useful to command a motor to move to the commutation zero position for phase initialization.

EXAMPLES:

BZ, -3 Drive Z axis to zero phase with 3 volt signal, and end with motor enabled.

RELATED COMMANDS:

"BA" on page 27	Brushless Axis
"BB" on page 28	Brushless Phase Begins
"BC" on page 29	Brushless Commutation
"BD" on page 30	Brushless Degrees
"BI" on page 32	Brushless Inputs
"BM" on page 34	Brushless Modulo
"BO" on page 36	Brushless Offset
"BS" on page 38	Brushless Setup

CA

FUNCTION: Coordinate Axes

DESCRIPTION:

The CA command specifies the coordinate system to apply proceeding vector commands.
The following commands apply to the active coordinate system as set by the CA command:

CR	ES	LE	LI	LM
TN	VE	VM	VP	

ARGUMENTS: CAS or CAT where

CAS specifies that proceeding vector commands shall apply to the S coordinate system

CAT specifies that proceeding vector commands shall apply to the T coordinate system

CA ? returns a 0 if the S coordinate system is active and a 1 if the T coordinate system is active.

OPERAND USAGE:

_CA contains a 0 if the S coordinate system is active and a 1 if the T coordinate system is active.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value CAS
Default Format -

ALL CONTROLLERS

RELATED COMMANDS:

"VP" on page 185 Vector Position
"VS" on page 188 Vector Speed
"VD" on page 180 Vector Deceleration
"VA" on page 179 Vector Acceleration
"VM" on page 183 Vector Mode
"VE" on page 181 End Vector
"BG" on page 31 BGS - Begin Sequence

EXAMPLES:

CAT Specify T coordinate system
VMXY Specify vector motion in the X and Y plane
VS 10000 Specify vector speed
CR 1000,0,360 Generate circle with radius of 1000 counts, start at 0 degrees and complete one circle in counterclockwise direction.
VE End Sequence
BGT Start motion of T coordinate system

CB (Binary EB)

FUNCTION: Clear Bit

DESCRIPTION:

The CB command sets the specified output bit low. CB can be used to clear the outputs of extended I/O which have been configured as outputs.

ARGUMENTS: CB n where

n is an integer corresponding to a specific output on the controller to be cleared (set to 0). The first output on the controller is denoted as output 1.

Note: When using Modbus devices (DMC-2100 ONLY), the I/O points of the modbus devices are calculated using the following formula:

$$n = (\text{SlaveAddress} * 1000) + (\text{HandleNum} * 1000) + ((\text{Module} - 1) * 4) + (\text{Bitnum} - 1)$$

Slave Address is used when the ModBus device has slave devices connected to it and specified as Addresses 0 to 255. Please note that the use of slave devices for modbus are very rare and this number will usually be 0.

HandleNum is the handle specifier from A to F.

Module is the position of the module in the rack from 1 to 16.

BitNum is the I/O point in the module from 1 to 4.

USAGE:

		DEFAULTS:	
While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

RELATED COMMANDS:

"SB" on page 156	Set Bit
"OB" on page 133	Output Bit
"OP" on page 137	Define output port (byte-wise).

EXAMPLES:

CB 7	Clear output bit 7
CB 16	Clear output bit 16 (8 axis controllers only)

CC

FUNCTION: Configure Communications Port 2

DESCRIPTION:

The CC command configures baud rate, handshake, mode, and echo for the AUX SERIAL PORT, referred to as Port 2. This command must be given before using the MG, IN, or CI commands with Port 2.

ARGUMENTS: CC m,n,r,p

m - Baud rate	300,1200,4800,9600,19200, or 38400
n - Handshake	0 for handshake off, 1 for handshake on
r - Mode	0 for daisy chain off, 1 for daisy chain on
p - Echo	0 for echo off, 1 for echo on

Note: echo only active when daisy chain feature is off

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

DEFAULTS:

Default Value 0,0,0
Default Format -

EXCEPT FOR DMC-1200, 1600, 1700

RELATED COMMANDS:

"CI" on page 48 Set Bit

EXAMPLES:

CC 9600,0,0,1 9600 baud, no handshake, daisy chain off, echo on.
Typical setting with TERM -1500.

CC 19200,1,1,0 19,200 baud, handshake on, daisy chain on, echo off.
Typical setting in daisy chain mode.

CD (Binary BE)

FUNCTION: Contour Data

DESCRIPTION:

The CD command specifies the incremental position on X,Y,Z and W axes. The units of the command are in encoder counts. This command is used only in the Contour Mode (CM). The incremental position will be executed over the time period specified by the command DT (ranging from 2 to 256 servo updates)

ARGUMENTS: CD n,n,n,n,n,n,n,n or CDX=n where
n is an integer in the range of +/-32762.

USAGE:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage		ALL CONTROLLERS	

DEFAULTS:

RELATED COMMANDS:

"CM" on page 49	Contour Mode
"WC" on page 190	Wait for Contour
"DT" on page 62	Time Increment
"CS" on page 53	_CS is the Segment Counter

EXAMPLES:

CM XYZW	Specify Contour Mode
DT 4	Specify time increment for contour
CD 200,350,-150,500	Specify incremental positions on X,Y,Z and W axes X-axis moves 200 counts Y-axis moves 350 counts Z-axis moves -150 counts W-axis moves 500 counts
WC	Wait for complete
CD 100,200,300,400	New position data
WC	Wait for complete
DT0	Stop Contour
CD 0,0,0,0	Exit Mode

CE (Binary 8C)

FUNCTION: Configure Encoder

DESCRIPTION:

The CE command configures the encoder to the quadrature type or the pulse and direction type. It also allows inverting the polarity of the encoders which reverses the direction of the feedback. Note: when using a servo motor, the motor will run away. The configuration applies independently to the main axes encoders and the auxiliary encoders.
ARGUMENTS: CE n,n,n,n,n,n,n,n or CEX=n where

n is an integer in the range of 0 to 15. Each integer is the sum of two integers M and N which configure the main and the auxiliary encoders. The values of M and N are

m =	Main encoder type	n =	Auxiliary encoder type
0	Normal quadrature	0	Normal quadrature
1	Normal pulse and direction	4	Normal pulse and direction
2	Reversed quadrature	8	Reversed quadrature
3	Reversed pulse and direction	12	Reversed pulse and direction

For example: x = 6 implies M = 2 and N = 4, both encoders are reversed quadrature.

n = ? Returns the value of the encoder configuration for the specified axes.

USAGE:

While Moving
 In a Program
 Command Line
 Controller Usage

Yes
 Yes
 Yes

DEFAULTS:

Default Value 0
 Default Format 2.0

ALL CONTROLLERS

OPERAND USAGE:

_CEx contains the value of encoder type for the axis specified by 'x'.

RELATED COMMANDS:

"MT" on page 128 Specify motor type

EXAMPLES:

CE 0, 3, 6, 2 Configure encoders
 CE ?,?,? Interrogate configuration
 V = _CEX Assign configuration to a variable

Note: When using pulse and direction encoders, the pulse signal is connected to CHA and the direction signal is connected to CHB.

CF

FUNCTION: Configure

DESCRIPTION:

Sets the default port for unsolicited messages. By default, the DMC-2100 will send unsolicited responses to the Main RS-232 serial port if the ENET dip switch is off, otherwise the DMC-2100 will send these responses to the last Ethernet handle to send a message to the controller. The CF command allows the user to override the ENET dip switch and send unsolicited responses to the Main Serial Port, Auxiliary Serial Port, or Handles A – F.

ARGUMENTS: CF n where

n is A thru F for Ethernet handles 1 thru 6, S for Main serial port, or T for Auxiliary port.

USAGE:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	No		
Controller Usage	DMC-2100 ONLY		

OPERAND USAGE:

RELATED COMMANDS:

EXAMPLES:

CI

FUNCTION: Communication Interrupt

DESCRIPTION:

The CI command configures a program interrupt based on characters received on Port 2, the AUX serial port. An interrupt causes program flow to jump to the #COMINT subroutine label. If multiple program threads are used, the #COMINT subroutine runs in thread 0 and threads 1, 2, and 3 continue to run in the background without interruption. The characters received on the serial port are stored in internal variables such as P2CH. See chapter 7 of the user manual for more detailed information on the communications interrupt.

ARGUMENTS: CI n

PARAMETER	EXPLANATION
n = 0	Do not interrupt Port 2
n = 1	Interrupt on carriage return character on Port 2
n = 2	Interrupt on any character Port 2
n = -1	Clear interrupt data buffer

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
No

DEFAULTS:

Default Value -
Default Format -

DMC-2000 and DMC-2100 ONLY

RELATED COMMANDS:

"CC" on page 44 Configure communications
"IN" on page 99 Communication input
"MG" on page 125 Message output

EXAMPLES:

CI 1 Interrupt when the <enter> key is received on Port 2
CI 2 Interrupt on a single character received on Port 2

CM (Binary BD)

FUNCTION: Contour Mode

DESCRIPTION:

The Contour Mode is initiated by the instruction CM. This mode allows the generation of an arbitrary motion trajectory with any of the axes. The CD command specifies the position increment, and the DT command specifies the time interval.

The command, CM?, can be used to check the status of the Contour Buffer. A value of 1 returned from the command CM? indicates that the Contour Buffer is full. A value of 0 indicates that the Contour Buffer is empty.

ARGUMENTS: CM xxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or any combination to specify the axis (axes) for contour mode
n = ? Returns a 1 if the contour buffer is full and 0 if the contour buffer is empty.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	0
In a Program	Yes	Default Format	2.0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_CM contains a '0' if the contour buffer is empty, otherwise contains a '1'.

RELATED COMMANDS:

"CD" on page 45	Contour Data
"WC" on page 190	Wait for Contour
"DT" on page 62	Time Increment

EXAMPLES:

V=_CM;V=	Return contour buffer status
CM?	Return contour buffer status
CM XZ	Specify X,Z axes for Contour Mode

CN (Binary E6)

FUNCTION: Configure

DESCRIPTION:

The CN command configures the polarity of the limit switches, home switches, latch inputs and the selective abort function.

ARGUMENTS: CN m,n,o,p where

m,n,o are integers with values 1 or -1.

p is an integer, 0 or 1.

m =	1	Limit switches active high
	-1	Limit switches active low
n =	1	Home switch configured to drive motor in forward direction when input is high. See HM and FE commands.
	-1	Home switch configured to drive motor in reverse direction when input is high. See HM and FE commands
o =	1	Latch input is active high
	-1	Latch input is active low
p =	1	Configures inputs 5,6,7,8,13,14,15,16 as selective abort inputs for axes A,B,C,D,E,F,G,and H respectively
	0	Inputs 5,6,7,8,13,14,15,16 are configured as general use inputs

USAGE:

While Moving Yes
 In a Program Yes
 Command Line Yes
 Controller Usage **ALL CONTROLLERS**

DEFAULTS:

Default Value -1,-1,-1,0
 Default Format 2.0

OPERAND USAGE:

_CN0 Contains the limit switch configuration
 _CN1 Contains the home switch configuration
 _CN2 Contains the latch input configuration
 _CN3 Contains the state of the selective abort function (1 enabled, 0 disabled)

RELATED COMMANDS:

"AL" on page 19 Arm latch

EXAMPLES:

CN 1,1 Sets limit and home switches to active high
 CN,,-1 Sets input latch active low

CO

FUNCTION: Configure Outputs

DESCRIPTION:

The CO command configures the extended I/O. For the DMC-1600, 17x8, and DMC-2x00.
Note: for the DMC-1700 series controller, this command only applies to DMC-17x8.

The 64 extended I/O points of the DMC-17x8 series controller can be configured in blocks of 8. The extended I/O is denoted as bits 17-80 and blocks 2-9.

ARGUMENTS: CO n where

n is a decimal value which represents a binary number. Each bit of the binary number represents one block of extended I/O. When set to 1, the corresponding block is configured as an output.

The least significant bit represents block 2 and the most significant bit represents block 9.

The decimal value can be calculated by the following formula. $n = n_2 + 2*n_3 + 4*n_4 + 8*n_5 + 16*n_6 + 32*n_7 + 64*n_8 + 128*n_9$ where n_x represents the block. If the n_x value is a one, then the block of 8 I/O points is to be configured as an output. If the n_x value is a zero, then the block of 8 I/O points will be configured as an input. For example, if block 3 and 4 is to be configured as an output, CO 6 is issued.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value -
Default Format -

FOR DMC-1600, 17x8, 2000, 2100

RELATED COMMANDS:

"CB" on page 43 Clear Output Bit
"SB" on page 156 Set Output Bit
"OP" on page 137 Set Output Port
"TI" on page 166 Tell Inputs

EXAMPLES:

CO 0 Configure all points as inputs
CO 1 Configures block 1 to outputs on extended I/O

Hint: See appendix for more information on the extended I/O boards.

CR (Binary B3)

FUNCTION: Circle

DESCRIPTION:

The CR command specifies a 2-dimensional arc segment of radius, r, starting at angle, θ , and traversing over angle $\Delta\theta$. A positive $\Delta\theta$ denotes counterclockwise traverse, negative $\Delta\theta$ denotes clockwise. The VE command must be used to denote the end of the motion sequence after all CR and VP segments are specified. The BG (Begin Sequence) command is used to start the motion sequence. All parameters, r, θ , $\Delta\theta$, must be specified. Radius units are in quadrature counts. θ and $\Delta\theta$ have units of degrees. The parameter n is optional and describes the vector speed that is attached to the motion segment.

ARGUMENTS: CR r, θ , $\Delta\theta$ < n > o where

r is an unsigned real number in the range 10 to 6000000 decimal (radius)

θ a signed number in the range 0 to +/-32000 decimal (starting angle in degrees)

$\Delta\theta$ is a signed real number in the range 0.0001 to +/-32000 decimal (angle in degrees)

n specifies a vector speed to be taken into effect at the execution of the vector segment. n is an unsigned even integer between 0 and 12,000,000 for servo motor operation and between 0 and 3,000,000 for stepper motors.

o specifies a vector speed to be achieved at the end of the vector segment. o is an unsigned even integer between 0 and 8,000,000.

Note: The product $r * \Delta\theta$ must be limited to +/-4.5 10^8

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value -
Default Format -

ALL CONTROLLERS

RELATED COMMANDS:

"VP" on page 185 Vector Position
"VS" on page 188 Vector Speed
"VD" on page 180 Vector Deceleration
"VA" on page 179 Vector Acceleration
"VM" on page 183 Vector Mode
"VE" on page 181 End Vector
"BG" on page 31 BGS - Begin Sequence

EXAMPLES:

VMXY Specify vector motion in the X and Y plane
VS 10000 Specify vector speed
CR 1000,0,360 Generate circle with radius of 1000 counts, start at 0 degrees and complete
CR 1000,0,360 < 40000 Generate circle with radius of 1000 counts, start at 0 degrees and complete
VE End Sequence
BGS Start motion

CS

FUNCTION: Clear Sequence

DESCRIPTION:

The CS command will remove VP, CR or LI commands stored in a motion sequence for the S or T coordinate systems. After a sequence has been executed, the CS command is not necessary to put in a new sequence. This command is useful when you have incorrectly specified VP, CR or LI commands.

ARGUMENTS: CSS or CST where

S and/or T can be used to clear the sequence buffer for the "S" or "T" coordinate system.

USAGE:

DEFAULTS:

While Moving	No	Default Value	---
In a Program	Yes	Default Format	---
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_CSx contains the segment number in the sequence specified by x, S or T. This operand is valid in the Linear mode, LM, Vector mode, VM

RELATED COMMANDS:

"CR" on page 52	Circular Interpolation Segment
"LI" on page 112	Linear Interpolation Segment
"LM" on page 115	Linear Interpolation Mode
"VM" on page 183	Vector Mode
"VP" on page 185	Vector Position

EXAMPLES:

#CLEAR	Label
CAT	Specify the T coordinate system vector points
VP 1000,2000	Vector position
VP 4000,8000	Vector position
CST	Clear vectors specified in T coordinate system
CAS	Specify the T coordinate system vector points
VP 1000,5000	New vector
VP 8000,9000	New vector
CSS	Clear vectors specified in S coordinate system

CW

FUNCTION: Copyright information / Data Adjustment bit on/off

DESCRIPTION:

The CW command has a dual usage. The CW command will return the copyright information when the argument, n is 0. Otherwise, the CW command is used as a communications enhancement for use by the Servo Design Kit software. When turned on, the communication enhancement sets the MSB of unsolicited, returned ASCII characters to 1. Unsolicited ASCII characters are those characters which are returned from the controller without being directly queried from the terminal. This is the case when a program has a command that requires the controller to return a value or string.

ARGUMENTS: CW n.m where

- n = 0 Causes the controller to return the copyright information
- n = 1 Causes the controller to set the MSB of unsolicited returned characters to 1
- n = 2 Causes the controller to not set the MSB of unsolicited characters.
- n = ? Returns the copyright information for the controller.

m is optional

- m = 0 Causes the controller to pause program execution when output FIFO is full until FIFO no longer full.
- m = 1 Causes the controller to continue program execution when output FIFO is full output characters after FIFO is full will be lost.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	2, 0
Default Format	

ALL CONTROLLERS

OPERAND USAGE:

_CW contains the value of the data adjustment bit. 2 = off, 1 = on

***Note:** The CW command can cause garbled characters to be returned by the controller. The default state of the controller is to disable the CW command, however, the Galil Servo Design Kit software and terminal software may sometimes enable the CW command for internal usage. If the controller is reset while the Galil software is running, the CW command could be reset to the default value which would create difficulty for the software. It may be necessary to re-enable the CW command. The CW command status can be stored in EEPROM*

DA

FUNCTION: Deallocate the Variables & Arrays

DESCRIPTION:

The DA command frees the array and/or variable memory space. In this command, more than one array or variable can be specified for memory de-allocation. Different arrays and variables are separated by comma when specified in one command. The argument * deallocates all the variables, and *[0] deallocates all the arrays.

ARGUMENTS: DA c[0],variable-name where

c[0] = Defined array name

variable-name = Defined variable name

* - Deallocates all the variables

*[0] - Deallocates all the arrays

DA? Returns the number of arrays available on the controller.

USAGE:

While Moving Yes

In a Program Yes

Command Line Yes

Controller Usage

DEFAULTS:

Default Value

Default Format

ALL CONTROLLERS

OPERAND USAGE:

_DA contains the total number of arrays available. For example, before any arrays have been defined, the operand _DA is 30. If one array is defined, the operand _DA will return 29.

RELATED COMMANDS:

"DM" on page 59

Dimension Array

EXAMPLES: 'Cars' and 'Sales' are arrays and 'Total' is a variable.

DM Cars[400],Sales[50]

Dimension 2 arrays

Total=70

Assign 70 to the variable Total

DA Cars[0],Sales[0],Total

Deallocate the 2 arrays & variables

DA*[]

Deallocate all arrays

DA *,*[]

Deallocate all variables and all arrays

Note: Since this command deallocates the spaces and compacts the array spaces in the memory, it is possible that execution of this command may take longer time than 2 ms.

DC (Binary 91)

FUNCTION: Deceleration

DESCRIPTION:

The Deceleration command (DC) sets the linear deceleration rate of the motors for independent moves such as PR, PA and JG moves. The parameters will be rounded down to the nearest factor of 1024 and have units of counts per second squared.

ARGUMENTS: DC n,n,n,n,n,n,n,n or DCX=n where

n is an unsigned numbers in the range 1024 to 67107840

n = ? Returns the deceleration value for the specified axes.

USAGE:

DEFAULTS:

While Moving	Yes *	Default Value	256000
In a Program	Yes	Default Format	8.0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

* When moving, the DC command can only be specified while in the jog mode.

OPERAND USAGE:

_DCx contains the deceleration rate for the specified axis.

RELATED COMMANDS:

"AC" on page 14	Acceleration
"PR" on page 141	Position Relative
"PA" on page 138	Position Absolute
"SP" on page 159	Speed
"JG" on page 102	Jog

EXAMPLES:

PR 10000	Specify position
AC 2000000	Specify acceleration rate
DC 1000000	Specify deceleration rate
SP 5000	Specify slew speed
BG	Begin motion

Note: The DC command may be changed during the move in JG move, but not in PR or PA move.

DE (Binary 98)

FUNCTION: Dual (Auxiliary) Encoder Position

DESCRIPTION:

The DE command defines the position of the auxiliary encoders.

The DE command defines the encoder position when used with stepper motors.

Note: The auxiliary encoders are not available for the stepper axis or for any axis where output compare is active.

ARGUMENTS: DE n,n,n,n,n,n,n,n or DEX=n where

n is a signed integers in the range -2147483647 to 2147483648 decimal

n = ? Returns the position of the auxiliary encoders for the specified axes.

n = ? returns the commanded reference position of the motor (in step pulses) when used with a stepper motor. Example: DE 0 This will define the TP or encoder position to 0. This will not effect the DE ? value. (To set the DE value when in stepper mode use the DP command.)

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0,0,0,0
Default Format Position Format

ALL CONTROLLERS

OPERAND USAGE:

_DEx contains the current position of the specified auxiliary encoder.

RELATED COMMANDS:

"DP" on page 60 Define main encoder position
"TD" on page 164 Tell Dual Encoder position

EXAMPLES:

DE 0,100,200,400 Set the current auxiliary encoder position to 0,100,200,400 on X,Y,Z and W axes
DE?,?,?,? Return auxiliary encoder positions
DUALX=_DEX Assign auxiliary encoder position of X-axis to the variable DUALX

Hint: Dual encoders are useful when you need an encoder on the motor and on the load. The encoder on the load is typically the auxiliary encoder and is used to verify the true load position. Any error in load position is used to correct the motor position.



$\frac{1}{(16 \cdot T_m)}$

DL

FUNCTION: Download

DESCRIPTION:

The DL command transfers a data file from the host computer to the controller. Instructions in the file will be accepted as a datastream without line numbers. The file is terminated using <control> Z, <control> Q, <control> D, or \. DO NOT insert spaces before each command.

If no parameter is specified, downloading a data file will clear all programs in the controllers RAM. The data is entered beginning at line 0. If there are too many lines or too many characters per line, the controller will return a ?. To download a program after a label, specify the label name following DL. The argument # may be used with DL to append a file at the end of the program in RAM.

Using Galil DOS Terminal Software: The ED command puts the controller into the Edit subsystem. In the Edit subsystem, programs can be created, changed, or destroyed. The commands in the Edit subsystem are:

<cntrl>D	Deletes a line
<cntrl>I	Inserts a line before the current one
<cntrl>P	Displays the previous line
<cntrl>Q	Exits the Edit subsystem
<return>	Saves a line

ARGUMENTS: DL n where

n = no argument Downloads program beginning at line 0. Erases programs in RAM.

n = #Label Begins download at line following #Label

n = # Begins download at end of program in RAM.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	---
In a Program	No	Default Format	---
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

When used as an operand, _DL gives the number of available labels.

All optima series controllers have 254 available labels

RELATED COMMANDS:

"UL" on page 178 Upload

EXAMPLES:

DL;	Begin download
#A;PR 4000;BGX	Data
AMX;MG DONE	Data
EN	Data
<control> Z	End download

DM

FUNCTION: Dimension

DESCRIPTION:

The DM command defines a single dimensional array with a name and the number of elements in the array. The first element of the defined array starts with element number 0 and the last element is at n-1.

ARGUMENTS: DM c[n] where

c is a name of up to eight characters, starting with an uppercase alphabetic character. n specifies the size of the array (number of array elements).

n = ? Returns the number of array elements available.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	---
In a Program	Yes	Default Format	---
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_DM contains the available array space. For example, before any arrays have been defined, the operand _DM will return 8000. If an array of 100 elements is defined, the operand _DM will return 7900.

RELATED COMMANDS:

"DA" on page 55 Deallocate Array

EXAMPLES:

DM Pets[5],Dogs[2],Cats[3] Define dimension of arrays, pets with 5 elements; Dogs with 2 elements; Cats with 3 elements

DM Tests[1600] Define dimension of array Tests with 1600 elements

DP (Binary 97)

FUNCTION: Define Position

DESCRIPTION:

The DP command sets the current motor position and current command positions to a user specified value. The units are in quadrature counts. This command will set both the TP and RP values.



The DP command sets the commanded reference position for axes configured as steppers. The units are in steps. Example: DP 0 this will set the registers for TD and RP to zero, but will not effect the TP register value.

ARGUMENTS: DP n,n,n,n,n,n,n,n or DPX=n where
n is a signed integer in the range -2147483648 to 2147483647 decimal.
n = ? Returns the current position of the motor for the specified axes.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

DEFAULTS:

Default Value 0,0,0,0
Default Format Position Format

ALL CONTROLLERS

OPERAND USAGE:

_DPx contains the current position of the specified axis.

RELATED COMMANDS:

"PF" on page 139 Position Formatting

EXAMPLES:

DP 0,100,200,400	Sets the current position of the X-axis to 0, the Y-axis to 100, the Z-axis to 200, and the W-axis to 400
DP ,-50000	Sets the current position of Y-axis to -50000. The Y,Z and W axes remain unchanged.
DP ?,?,?,?	Interrogate the position of X,Y,Z and W axis.
0000000,-0050000,0000200,0000400	Returns all the motor positions
DP ?	Interrogate the position of X axis
0000000	Returns the X-axis motor position

Hint: The DP command is useful to redefine the absolute position. For example, you can manually position the motor by hand using the Motor Off command, MO. Turn the servo motors back on with SH and then use DP0 to redefine the new position as your absolute zero.

DR

FUNCTION: Configures Secondary Communication channel and the data update rate.

DESCRIPTION:

DR +/- specifies the secondary communication channel as DMA if positive and Polling FIFO if negative. n specifies the data update rate as 2^n samples between updates. The controller creates a record and places it in the FIFO or PC DMA location at this rate.

ARGUMENTS: DR + n or DR - n

+ DMA (DMC-1700 only)

- Polling FIFO where

n is an integer in the range 0 to 8. 0 turns off the secondary communication channel. n=1 through 8 specifies data update rate of 2^n sample periods. The sample period is specified by the TM command and has a default value of 1000 (1msec).

Note: If a small sample period and a small update rate is used, the controller's processor may become noticeably slower as a result of maintaining a high update rate.

USAGE:

While Moving Yes
In a Program No
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format --

EXCEPT FOR DMC-1200, 2000, 2100

RELATED COMMANDS:

"QZ" on page 145 Sets format of data

DT (Binary BF)

FUNCTION: Delta Time

DESCRIPTION:

The DT command sets the time interval for Contour Mode. Sending the DT command once will set the time interval for all contour data until a new DT command is sent. 2^n milliseconds is the time interval. (Followed by CD0 command).

ARGUMENTS: DT n where

n is an integer in the range 0 to 8.

n=0 terminates the Contour Mode.

n=1 through 8 specifies the time interval of 2^n samples.

By default the sample period is 1 msec (set by the TM command); with n=1, the time interval would be 2 msec

n = ? Returns the value for the time interval for contour mode.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value	0
Default Format	1.0

OPERAND USAGE:

_DT contains the value for the time interval for Contour Mode

RELATED COMMANDS:

"CM" on page 49	Contour Mode
"CD" on page 45	Contour Data
"WC" on page 190	Wait for next data

EXAMPLES:

DT 4	Specifies time interval to be 16 msec
DT 7	Specifies time interval to be 128 msec
#CONTOUR	Begin
CMXY	Enter Contour Mode
DT 4	Set time interval
CD 1000,2000	Specify data
WC	Wait for contour
CD 2000,4000	New data
WC	Wait
DT0	Stop contour
CD0	Exit Contour Mode
EN	End

DV (Binary 84)

FUNCTION: Dual Velocity (Dual Loop)

DESCRIPTION:

The DV function changes the operation of the filter. It causes the KD (derivative) term to operate on the dual encoder instead of the main encoder. This results in improved stability in the cases where there is a backlash between the motor and the main encoder, and where the dual encoder is mounted on the motor.

ARGUMENTS: DV n,n,n,n,n,n,n,n or DVX=n where

n = 0 Disables the dual loop mode.

n = 1 Enables the dual loop mode.

n = ? Returns a 0 if dual velocity mode is disabled and 1 if enabled for the specified axes.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format 1.0

ALL CONTROLLERS

OPERAND USAGE:

_DVx contains the state of dual velocity mode for specified axis. 0 = disabled, 1 = enabled.

RELATED COMMANDS:

"KD" on page 105 Damping constant
"FV" on page 86 Velocity feedforward

EXAMPLES:

DV 1,1,1,1 Enables dual loop on all axes
DV 0 Disables DV on X axis
DV,,11 Enables dual loop on Z axis and WX axis. Other axes remain unchanged.
DV 1,0,1,0 Enables dual loop on X and Z axis. Disables dual loop on Y and W axis.

Hint: The DV command is useful in backlash and resonance compensation.

EA

FUNCTION: Choose ECAM master

DESCRIPTION:

The EA command selects the master axis for the electronic cam mode. Any axis may be chosen.

ARGUMENTS: EA x where

x is one of the axis specified as X,Y,Z,W,A,B,C,D,E,F,G or H

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

DEFAULTS:

Default Value
Default Format

ALL CONTROLLERS

RELATED COMMANDS:

"EB" on page 65	Enable ECAM
"EC" on page 66	Set ECAM table index
"EG" on page 68	Engage ECAM
"EM" on page 72	Specify ECAM cycle
"EP" on page 77	Specify ECAM table intervals & starting point
"EQ" on page 78	Disengage ECAM
"ET" on page 81	ECAM table

EXAMPLES:

EAY Select Y as a master for ECAM

EB (Binary C4)

FUNCTION: Enable ECAM

DESCRIPTION:

The EB function enables or disables the cam mode. In this mode, the starting position of the master axis is specified within the cycle. When the EB command is given, the master axis is modularized.

ARGUMENTS: EB n where

n = 1 Starts ECAM mode

n = 0 Stops ECAM mode.

n = ? Returns 0 if ECAM is disabled and a 1 if enabled.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value
Default Format

ALL CONTROLLERS

OPERAND USAGE:

_EB contains the state of Ecam mode. 0 = disabled, 1 = enabled

RELATED COMMANDS:

"EA" on page 64	Choose ECAM master
"EC" on page 66	Set ECAM table index
"EG" on page 68	Engage ECAM
"EM" on page 72	Specify ECAM cycle
"EP" on page 77	Specify ECAM table intervals & starting point
"EQ" on page 78	Disengage ECAM
"ET" on page 81	ECAM table

EXAMPLES:

EB1	Starts ECAM mode
EBO	Stops ECAM mode
B = _EB	Return status of cam mode

EC (Binary C6)

FUNCTION: ECAM Counter

DESCRIPTION:

The EC function sets the index into the ECAM table. This command is only useful when entering ECAM table values without index values and is most useful when sending commands in binary. See the command, ET.

ARGUMENTS: EC n where

n is an integer between 0 and 256.

n = ? Returns the current value of the index into the ECAM table.

USAGE:

While Moving

Yes

Default Value

In a Program

Yes

Default Format

Command Line

Yes

Controller Usage

ALL CONTROLLERS

DEFAULTS:

OPERAND USAGE:

_EC contains the current value of the index into the ECAM table.

RELATED COMMANDS:

"EA" on page 64

Choose ECAM master

"EB" on page 65

Enable ECAM

"EG" on page 68

Engage ECAM

"EM" on page 72

Specify ECAM cycle

"EP" on page 77

Specify ECAM table intervals & starting point

"EQ" on page 78

Disengage ECAM

"ET" on page 81

ECAM table

EXAMPLES:

EC0

Set ECAM index to 0

ET 200,400

Set first ECAM table entries to 200,400

ET 400,800

Set second ECAM table entries to 400,800

ED

FUNCTION: Edit

DESCRIPTION:

Using Galil DOS Terminal Software: The ED command puts the controller into the Edit subsystem. In the Edit subsystem, programs can be created, changed, or destroyed. The commands in the Edit subsystem are:

<cntrl>D	Deletes a line
<cntrl>I	Inserts a line before the current one
<cntrl>P	Displays the previous line
<cntrl>Q	Exits the Edit subsystem
<return>	Saves a line

Using Galil Windows Terminal Software: The ED command causes the Windows terminal software to open the terminal editor.

OPERAND USAGE:

_ED contains the line number of the last line to have an error.
_ED1 contains the number of the thread where the error occurred (for multitasking).

EXAMPLES:

```
ED
000 #START
001 PR 2000
002 BGX
003 SLKJ                               Bad line
004 EN
005 #CMDERR                             Routine which occurs upon a command error
006 V=_ED
007 MG "An error has occurred" {n}
008 MG "In line", V{F3.0}
009 ST
010 ZS0
011 EN
XQ_ED2                                 Retry instruction that included error
XQ_ED3                                 Execute next instruction
```

Hint: Remember to quit the Edit Mode prior to executing or listing a program.

EG (Binary C3)

FUNCTION: ECAM go (engage)

DESCRIPTION:

The EG command engages an ECAM slave axis at a specified position of the master. If a value is specified outside of the master's range, the slave will engage immediately. Once a slave motor is engaged, its position is redefined to fit within the cycle.

ARGUMENTS: EG n,n,n,n,n,n,n,n or EGX=n where

n is the ECAM master position at which the ECAM slave axis must be engaged.

n = ? Returns 1 if specified axis is engaged and 0 if disengaged.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value
In a Program	Yes	Default Format
Command Line	Yes	
Controller Usage	ALL CONTROLLERS	

OPERAND USAGE:

_EGx contains ECAM status for specified axis. 0 = axis is not engaged, 1 = axis is engaged.

RELATED COMMANDS:

"EA" on page 64	Choose ECAM master
"EB" on page 65	Enable ECAM
"EC" on page 66	Set ECAM table index
"EM" on page 72	Specify ECAM cycle
"EP" on page 77	Specify ECAM table intervals & starting point
"EQ" on page 78	Disengage ECAM
"ET" on page 81	ECAM table

EXAMPLES:

EG 700,1300	Engages the X and Y axes at the master position 700 and 1300 respectively.
B = _EPY	Return the status of Y axis, 1 if engaged

Note: This command is not a trippoint. This command will not hold the execution of the program flow. If the execution needs to be held until master position is reached, use MF or MR command.

EI (Binary ED)

FUNCTION: Enable Interrupts

DESCRIPTION:

The EI command enables interrupt conditions such as motion complete or excess error. The conditions are selected by the parameter m where m is the bit mask for the selected conditions as shown below. Prior to using interrupts, interrupts must first be configured and an interrupt service routine must first be incorporated in the program on the controller.

ARGUMENTS: EI m,n where

EI 0 clears the interrupt que

m is an integer between 1 and 65535. m is used to select the interrupt(s) to be used.

n is an integer between 1 and 255. n is used to select the specific input if the value for m indicates that inputs are to be used for interrupting.

m and n are integer values which represent binary numbers. These binary numbers are used to logically “AND” with the interrupt registers as described by the following tables. The use of the values m and n to select the desired bits from the interrupt register is known as ‘masking’.

BIT NO	m = (2 ^{BIT NO})	CONDITION	BIT NO	m = (2 ^{BIT NO})	CONDITION
0	1	X motion complete	8	256	All axes motion complete
1	2	Y motion complete	9	512	Excess position error*
2	4	Z motion complete	10	1024	Limit switch
3	8	W motion complete	11	2048	Watchdog timer
4	16	E motion complete	12	4096	Reserved
5	32	F motion complete	13	8192	Application program stopped
6	64	G motion complete	14	16384	Command done
7	128	H motion complete	15	32768	Inputs* (uses n for mask)

The * conditions must be re-enabled after each occurrence.

BIT NO	n= (2 ^{BIT NO})	CONDITION	BIT NO	n= (2 ^{BIT NO})	CONDITION
0	1	Input 1	4	16	Input 5
1	2	Input 2	5	32	Input 6
2	4	Input 3	6	64	Input 7
3	8	Input 4	7	128	Input 8

Note: n is only used if the interrupt function is enabled for bit 15.

USAGE:

While Moving Yes
 In a Program Yes
 Command Line Yes
 Controller Usage

DEFAULTS:

Default Value 0
 Default Format ---

EXCEPT FOR DMC-2000, 2100**RELATED COMMANDS:**

"UI" on page 177 User interrupt

EXAMPLES:

1. Specify interrupts when motion is complete on all axes OR if a limit switch occurs:

From the table, enable bits 8 and 10. $m = 2^8 + 2^{10} = 256 + 1024 = 1280$

EI 1280

2. Specify interrupt on Input 3.

Enable bit 15 on m and bit 2 on n.

$m = 2^{15} = 32768$

$n = 2^2 = 4$

EI 32768,4

ELSE

FUNCTION: Else function for use with IF conditional statement

DESCRIPTION:

The ELSE command is an optional part of an IF conditional statement. The ELSE command must occur after an IF command and it has no arguments. It allows for the execution of a command only when the argument of the IF command evaluates False. If the argument of the IF command evaluates false, the controller will skip commands until the ELSE command. If the argument for the IF command evaluates true, the controller will execute the commands between the IF and ELSE command.

ARGUMENTS: ELSE

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
No

DEFAULTS:

Default Value
Default Format

ALL CONTROLLERS

RELATED COMMANDS:

"ENDIF" on page 75 End of IF conditional Statement

EXAMPLES:

IF (@IN[1]=0)	IF conditional statement based on input 1
IF (@IN[2]=0)	2 nd IF conditional statement executed if 1 st IF conditional true
MG "INPUT 1 AND INPUT 2 ARE ACTIVE"	Message to be executed if 2 nd IF conditional is true
ELSE	ELSE command for 2 nd IF conditional statement
MG "ONLY INPUT 1 IS ACTIVE"	Message to be executed if 2 nd IF conditional is false
ENDIF	End of 2 nd conditional statement
ELSE	ELSE command for 1 st IF conditional statement
MG"ONLY INPUT 2 IS ACTIVE"	Message to be executed if 1 st IF conditional statement
ENDIF	End of 1 st conditional statement

EM (Binary C1)

FUNCTION: Cam cycles

DESCRIPTION:

The EM command is part of the ECAM mode. It is used to define the change in position over one complete cycle of the master. The field for the master axis is the cycle of the master position. For the slaves, the field defines the net change in one cycle. If a slave will return to its original position at the end of the cycle, the change is zero. If the change is negative, specify the absolute value.

ARGUMENTS: EM n,n,n,n,n,n,n,n or EMX=n where

n is a positive integer in the range between 1 and 8,388,607 for the master axis and between 1 and 2,147,483,647 for a slave axis.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value
Default Format

OPERAND USAGE:

_EMx contains the cycle of the specified axis.

RELATED COMMANDS:

"EA" on page 64	Choose ECAM master
"EB" on page 65	Enable ECAM
"EC" on page 66	Set ECAM table index
"EG" on page 68	Engage ECAM
"EP" on page 77	Specify ECAM table intervals & starting point
"EQ" on page 78	Disengage ECAM
"ET" on page 81	ECAM table

EXAMPLES:

EAZ	Select Z axis as master for ECAM.
EM 0,3000,2000	Define the changes in X and Y to be 0 and 3000 respectively. Define master cycle as 2000.
V = _EMX	Return cycle of X

EN

FUNCTION: End

DESCRIPTION:

The EN command is used to designate the end of a program or subroutine. If a subroutine was called by the JS command, the EN command ends the subroutine and returns program flow to the point just after the JS command.

The EN command is used to end the automatic subroutines #MCTIME, #CMDERR, and #COMINT. When the EN command is used to terminate the #COMINT communications interrupt subroutine, there are two arguments; the first determines whether trippoints will be restored upon completion of the subroutine and the second determines whether the communication interrupt will be re-enabled.

ARGUMENTS: EN m, n where

m = 0: Return from #COMINT without restoring trippoint

m = 1: Return from subroutine and restore trippoint

n = 0: Return from #COMINT without restoring interrupt

n = 1: Return from communications interrupt #COMINT and restore interrupt

Note1: The default values for the arguments are 0. For example EN,1 and EN0,1 have the same effect.

Note2: The arguments will specify how the #COMINT routine handles trippoints. Trippoints cause a program to wait for a particular event. The AM command, for example, waits for motion on all axes to complete. If the #COMINT subroutine is executed due to a communication interrupt while the program is waiting for a trippoint, the #COMINT can end and by continue to wait for the trippoint, or clear the trippoint and continue executing the program at the command just after the trippoint. .

Note3: Use the RE command to return from the interrupt handling subroutines #LIMSWI and #POSERR. Use the RI command to return from the #ININT subroutine.

USAGE:

While Moving	Yes	Default Value	m=0, n=0
In a Program	Yes	Default Format	
Command Line	No		
Controller Usage			

DEFAULTS:

ALL CONTROLLERS

RELATED COMMANDS:

“RE” on page 149	Return from error subroutine
“RI” on page 150	Return from interrupt subroutine

EXAMPLES:

#A	Program A
PR 500	Move X axis forward 500 counts
BGX	Pause the program until the X axis completes the motion
AMX	Move X axis forward 1000 counts
PR 1000	Set another Position Relative move
BGX	Begin motion
EN	End of Program

ENDIF

FUNCTION: End of IF conditional statement

DESCRIPTION:

The ENDIF command is used to designate the end of an IF conditional statement. An IF conditional statement is formed by the combination of an IF and ENDIF command. An ENDIF command must always be executed for every IF command that has been executed. It is recommended that the user not include jump commands inside IF conditional statements since this causes re-direction of command execution. In this case, the command interpreter may not execute an ENDIF command.

ARGUMENTS: ENDIF

USAGE:

While Moving
In a Program
Command Line
Controller Usage

DEFAULTS:

Yes Default Value
Yes Default Format

No

ALL CONTROLLERS

RELATED COMMANDS:

" on page 97	Command to begin IF conditional statement
"ELSE' on page 71	Optional command to be used only after IF command
"JP" on page 103	Jump command
"JS" on page 104	Jump to subroutine command

EXAMPLES:

IF (@IN[1]=0)	IF conditional statement based on input 1
MG " INPUT 1 IS ACTIVE	Message to be executed if "IF" conditional is false
ENDIF	End of conditional statement

Note: Instead of EN, use the RE command to end the error subroutine and limit subroutine. Use the RI command to end the input interrupt) subroutine.

EO

FUNCTION: Echo

DESCRIPTION:

The EO command turns the echo on or off. If the echo is off, characters input over the bus will not be echoed back.

ARGUMENTS: EO n where

n = 0 0 turns echo off

n = 1 1 turns echo on.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	0
Default Format	1.0

EXCEPT FOR DMC-2100

EXAMPLES:

EO 0	Turns echo off
EO 1	Turns echo on

EP (Binary C2)

FUNCTION: Cam table intervals and starting point

DESCRIPTION:

The EP command defines the ECAM table intervals and offset. The offset is the master position of the first ECAM table entry. The interval is the difference of the master position between 2 consecutive table entries. This command effectively defines the size of the ECAM table. The parameter m is the interval and n is the starting point. Up to 257 points may be specified.

ARGUMENTS: EP m,n where

m is a positive integer in the range between 1 and 32,767

m = ? Returns the value of the interval, m.

n is an integer between -2,147,483,648 and 2,147,483,647.

USAGE:

While Moving	Yes	Default Value
In a Program	Yes	Default Format
Command Line	Yes	
Controller Usage	ALL CONTROLLERS	

DEFAULTS:

OPERAND USAGE:

_EP contains the value of the interval m.

RELATED COMMANDS:

"EA" on page 64	Choose ECAM master
"EB" on page 65	Enable ECAM
"EC" on page 66	Set ECAM table index
"EG" on page 68	Engage ECAM
"EM" on page 72	Specify ECAM cycle
"EQ" on page 78	Disengage ECAM
"ET" on page 81	ECAM table

EXAMPLES:

EP 20,100	Sets the cam master points to 100,120,140 . . .
D = _EP	Set the variable D equal to the ECAM internal valve

EQ (Binary C5)

FUNCTION: ECAM quit (disengage)

DESCRIPTION:

The EQ command disengages an electronic cam slave axis at the specified master position. Separate points can be specified for each axis. If a value is specified outside of the master's range, the slave will disengage immediately.

ARGUMENTS: EQ n,n,n,n,n,n,n,n or EQX=n where

n is the master positions at which the axes are to be disengaged.

n = ? Returns 1 if engage command issued and axis is waiting to engage, 2 if disengage command issued and axis is waiting to disengage, and 0 if ECAM engaged or disengaged.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value
Default Format

OPERAND USAGE:

_EQx contains 1 if engage command issued and axis is waiting to engage, 2 if disengage command issued and axis is waiting to disengage, and 0 if ECAM engaged or disengaged.

RELATED COMMANDS:

"EA" on page 64	Choose ECAM master
"EB" on page 65	Enable ECAM
"EC" on page 66	Set ECAM table index
"EG" on page 68	Engage ECAM
"EM" on page 72	Specify ECAM cycle
"EP" on page 77	Specify ECAM table intervals & starting point
"ET" on page 81	ECAM table

EXAMPLES:

EQ 300,700 Disengages the X and Y motors at master positions 300 and 700 respectively.

Note: This command is not a trippoint. This command will not hold the execution of the program flow. If the execution needs to be held until master position is reached, use MF or MR command.

ER (Binary 88)

FUNCTION: Error Limit

DESCRIPTION:

The ER command sets the magnitude of the position errors for each axis that will trigger an error condition. When the limit is exceeded, the Error output will go low (true). If the Off On Error (OE1) command is active, the motors will be disabled.

ARGUMENTS: ER n,n,n,n,n,n,n,n or ERX=n where

n is an unsigned numbers in the range 1 to 32767 which represents the error limit in encoder counts. A value of -1 will disable the position error limit for the specified axis.

n = ? Returns the value of the Error limit for the specified axis.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	16384
In a Program	Yes	Default Format	Position Format
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_ERx contains the value of the Error limit for the specified axis.

RELATED COMMANDS:

"OE" on page 134	Off-On Error
#POSERR	Automatic Error Subroutine

EXAMPLES:

ER 200,300,400,600	Set the X-axis error limit to 200, the Y-axis error limit to 300, the Z-axis error limit to 400, and the W-axis error limit to 600.
ER ,1000	Sets the Y-axis error limit to 1000, leave the X-axis error limit unchanged.
ER ?,?,?,?	Return X,Y,Z and W values
00200,00100,00400,00600	
ER ?	Return X value
00200	
V1=_ERX	Assigns V1 value of ERX
V1=	Returns V1
00200	

Hint: The error limit specified by ER should be high enough as not to be reached during normal operation. Examples of exceeding the error limit would be a mechanical jam, or a fault in a system component such as encoder or amplifier.

ES

FUNCTION: Ellipse Scale

DESCRIPTION:

The ES command divides the resolution of one of the axes in a vector mode (VM). This function allows for the generation of circular motion when encoder resolutions differ. It also allows for the generation of an ellipse instead of a circle.

The command has two parameters, m and n. The arguments, m and n apply to the axes designated by the command VM. When $m > n$, the resolution of the first axis, x, will be divided by the ratio m/n . When $m < n$, the resolution of the second axis, y, will be divided by n/m . The resolution change applies for the purpose of generating the VP and CR commands, effectively changing the axis with the higher resolution to match the coarser resolution.

The ES command will apply to the selected coordinate system, S or T. To select the coordinate system, use the command CAS or CAT.

ARGUMENTS: ES m,n where

m and n are positive integers in the range between 1 and 65,535.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 1,1
Default Format

ALL CONTROLLERS

RELATED COMMANDS:

"VM" on page 183 Vector Mode
"CR" on page 52 Circle move
"VP" on page 185 Vector position

EXAMPLES:

VMXY;ES3,4 Divide Y resolution by 4/3
VMZX;ES2,3 Divide X resolution by 3/2
VMXZ; ES3,2 Divide X Resolution by 3/2

ET (Binary CO)

FUNCTION: Electronic cam table

DESCRIPTION:

The ET command sets the ECAM table entries for the slave axes.. The values of the master axes are not required. The slave entry (n) is the position of the slave axes when the master is at the point $(n * i) + o$, where i is the interval and o is the offset as determined by the EP command.

ARGUMENTS: ET[n] = n,n,n,n,n,n,n,n where

n is an integer in the range between -2,147,438,648, and 2,147,438,647.

The value n can be left out of the command if the index count has been set using the command, EC. In this mode, each ET command will automatically increment the index count by 1.

USAGE:

While Moving	Yes	Default Value
In a Program	Yes	Default Format
Command Line	Yes	
Controller Usage	ALL CONTROLLERS	

DEFAULTS:

RELATED COMMANDS:

"EA" on page 64	Choose ECAM master
"EB" on page 65	Enable ECAM
"EC" on page 66	Set ECAM table index
"EG" on page 68	Engage ECAM
"EM" on page 72	Specify ECAM cycle
"EP" on page 77	Specify ECAM table intervals & starting point
"EQ" on page 78	Disengage ECAM

EXAMPLES:

ET[0]=0,,0	Specifies the position of the slave axes X and Z to be synchronized with the starting point of the master.
ET[1]=1200,,400	Specifies the position of the slave axes X and Z to be synchronized with the second point of the master
EC0	Set the table index value to 0, the first element in the table
ET 0,,0	Specifies the position of the slave axes X and Z to be synchronized with the starting point of the master.
ET 1200,,400	Specifies the position of the slave axes X and Z to be synchronized with the second point of the master

FA (Binary 94)

FUNCTION: Acceleration Feedforward

DESCRIPTION:

The FA command sets the acceleration feedforward coefficient. This coefficient, when scaled by the acceleration, adds a torque bias voltage during the acceleration phase and subtracts the bias during the deceleration phase of a motion.

$$\text{Acceleration Feedforward Bias} = \text{FA} \cdot \text{AC} \cdot 1.5 \cdot 10^{-7}$$

$$\text{Deceleration Feedforward Bias} = \text{FA} \cdot \text{DC} \cdot 1.5 \cdot 10^{-7}$$

The Feedforward Bias product is limited to 10 Volts. FA operates when commanding motion with PA, PR and JG.

ARGUMENTS: FA n,n,n,n,n,n,n,n or FAX=n where

n is an unsigned number in the range 0 to 8191 decimal with a resolution of 0.25.

n = ? Returns the value of the feedforward acceleration coefficient for the specified axis.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value	0
Default Format	4.0

OPERAND USAGE:

_FAX contains the value of the feedforward acceleration coefficient for the specified axis.

RELATED COMMANDS:

"FV" on page 86 Velocity feedforward

EXAMPLES:

AC 500000,1000000	Set feedforward coefficient to 10 for the X-axis
FA 10,15	and 15 for the Y-axis. The effective bias will be 0.75V for X and 2.25V for Y.
FA ?,?	Return X and Y values
010,015	

Note: If the feedforward coefficient is changed during a move, then the change will not take effect until the next move.

FE (Binary A4)

FUNCTION: Find Edge

DESCRIPTION:

The FE command moves a motor until a transition is seen on the homing input for that axis. The direction of motion depends on the initial state of the homing input (use the CN command to configure the polarity of the home input). Once the transition is detected, the motor decelerates to a stop.

This command is useful for creating your own homing sequences.

ARGUMENTS: FE xxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

No argument specifies all axes.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

DEFAULTS:

Default Value
Default Format

ALL CONTROLLERS

RELATED COMMANDS:

"FI" on page 84	Find Index
"HM" on page 90	Home
"BG" on page 31	Begin
"AC" on page 14	Acceleration Rate
"DC" on page 56	Deceleration Rate
"SP" on page 159	Speed for search

EXAMPLES:

FE	Set find edge mode
BG	Begin all axes
FEX	Only find edge on X
BGX	
FEY	Only find edge on Y
BGY	
FEZW	Find edge on Z and W
BGZW	

Hint: Find Edge only searches for a change in state on the Home Input. Use FI (Find Index) to search for the encoder index. Use HM (Home) to search for both the Home input and the Index. Remember to specify BG after each of these commands.

FI (Binary A5)

FUNCTION: Find Index

DESCRIPTION:

The FI and BG commands move the motor until an encoder index pulse is detected. The controller looks for a transition from low to high. When the transition is detected, motion stops and the position is defined as zero. To improve accuracy, the speed during the search should be specified as 500 counts/s or less. The FI command is useful in custom homing sequences. The direction of motion is specified by the sign of the JG command.

ARGUMENTS: FI xxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or sequence

No argument specifies all axes.

USAGE:

While Moving	No	Default Value
In a Program	Yes	Default Format
Command Line	Yes	
Controller Usage	ALL CONTROLLERS	

DEFAULTS:

RELATED COMMANDS:

"FE" on page 83	Find Edge
"HM" on page 90	Home
"BG" on page 31	Begin
"AC" on page 14	Acceleration Rate
"DC" on page 56	Deceleration Rate
"SP" on page 159	Search Speed

EXAMPLES:

#HOME	Home Routine
JG 500	Set speed and forward direction
FIX	Find index
BGX	Begin motion
AMX	After motion
MG "FOUND INDEX"	

Hint: Find Index only searches for a change in state on the Index. Use FE to search for the Home. Use HM (Home) to search for both the Home input and the Index. Remember to specify BG after each of these commands.

FL (Binary 8E)

FUNCTION: Forward Software Limit

DESCRIPTION:

The FL command sets the forward software position limit. If this limit is exceeded during motion, motion on that axis will decelerate to a stop. Forward motion beyond this limit is not permitted. The forward limit is activated at X+1, Y+1, Z+1, W+1. The forward limit is disabled at 2147483647. The units are in counts.

When the reverse software limit is activated, the automatic subroutine #LIMSWI will be executed if it is included in the program and a program is executing. See User's Manual, Automatic Subroutine.

ARGUMENTS: FL n,n,n,n,n,n,n,n or FLX=n where

n is a signed integers in the range -2147483648 to 2147483647, n represents the absolute position of axis.

n = 2147483647 turns off the forward limit

n = ? Returns the value of the forward limit switch for the specified axis.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 2147483647
Default Format Position Format

ALL CONTROLLERS

OPERAND USAGE:

_FLx contains the value of the forward software limit for the specified axis.

RELATED COMMANDS:

"BL" on page 33 Reverse Limit
"PF" on page 139 Position Formatting

EXAMPLES:

FL 150000 Set forward limit to 150000 counts on the X-axis
#TEST Test Program
AC 1000000 Acceleration Rate
DC 1000000 Deceleration Rate
FL 15000 Forward Limit
JG 5000 Jog Forward
BGX Begin
AMX After Limit
TPX Tell Position
EN End

Hint: Galil controllers also provide hardware limits.

FV (Binary 95)

FUNCTION: Velocity Feedforward

DESCRIPTION:

The FV command sets the velocity feedforward coefficient, or returns the previously set value. This coefficient generates an output bias signal in proportions to the commanded velocity.

Velocity feedforward bias = $1.22 \cdot 10^{-6} \cdot \text{FV} \cdot \text{Velocity}$ [in cts/s].

FV operates when commanding motion with PA, PR, JG, VM, LM, and CM.

For example, if FV=10 and the velocity is 200,000 count/s, the velocity feedforward bias equals 2.44 volts.

ARGUMENTS: FV n,n,n,n,n,n,n,n or FVX=n where

n is an unsigned numbers in the range 0 to 8191 decimal

n = ? Returns the feedforward velocity for the specified axis.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	0
Default Format	3.0

ALL CONTROLLERS

OPERAND USAGE:

_FVx contains the feedforward velocity for the specified axis.

RELATED COMMANDS:

"FA" on page 82 Acceleration feedforward

EXAMPLES:

FV 10,20	Set feedforward coefficients to 10 and 20 for x
JG 30000,80000	and y respectively. This produces 0.366 volts for x and 1.95 volts for y.
FV ?,?	Return the x and y values.
010,020	

GA

FUNCTION: Master Axis for Gearing

DESCRIPTION:

The GA command specifies the master axes for electronic gearing. Multiple masters for gearing may be specified. The masters may be the main encoder input, auxiliary encoder input, or the commanded position of any axis. The master may also be the commanded vector move in a coordinated motion of LM or VM type. When the master is a simple axis, it may move in any direction and the slave follows. When the master is a commanded vector move, the vector move is considered positive and the slave will move forward if the gear ratio is positive, and backward if the gear ratio is negative. The slave axes and ratios are specified with the GR command and gearing is turned off by the command GR0.

ARGUMENTS: GA x,x,x,x,x,x,x,x, or GAX=x where

x can be X,Y,Z,W,A,B,C,D,E,F,G, H or N. The value of x is used to set the specified main encoder axis as the gearing master and N represents the virtual axis. The slave axis is specified by the position of the argument. The first position of the argument corresponds to the 'X' axis, the second position corresponds to the 'Y' axis, etc. A comma must be used in place of an argument if the corresponding axes will not be a slave.

x can be CX,CY,CZ,CW,CA,CB,CC,CD,CE,CF,CG or CH. The value of x is used to set the commanded position of the specified axis as the gearing master.

x can be S or T. S and T are used to specify the vector motion of the coordinated system, S or T, as the gearing master.

x can be DX,DY,DZ,DW,DA,DB,DC,DD,DE,DF,DG or DH. The value of x is used to set the specified auxiliary encoder axis as the gearing master.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value
Default Format

RELATED COMMANDS:

"GR" on page 11 Gear Ratio
"GM" on page 88 Gantry Mode

EXAMPLES:

#GEAR Gear program
GA ,X,T Specify X axis as master for Y and vector motion on T as master for Z
GR ,.5,-2.5 Specify Y and Z ratios
JG 5000 Specify master jog speed
BGX Begin motion
WT 10000 Wait 10000 msec
STX Stop

Hint: Using the command position, as the master axis is useful for gantry applications. Using the vector motion as master is useful in generating Helical motion.

GM

FUNCTION: Gantry mode

DESCRIPTION:

The GM command specifies the axes in which the gearing function is performed in the Gantry mode. In this mode, the gearing will not stop by the ST command or by limit switches. Only GR0 will stop the gearing in this mode.

ARGUMENTS: GM n,n,n,n,n,n,n,n or GMX=n where

n = 0 Disables gantry mode function

n = 1 Enables the gantry mode

n = ? Returns the state of gantry mode for the specified axis: 0 gantry mode disabled, 1 gantry mode enabled

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format 1.0

ALL CONTROLLERS

OPERAND USAGE:

_GMx contains the state of gantry mode for the specified axis: 0 gantry mode disabled, 1 gantry mode enabled

RELATED COMMANDS:

"GR" on page 89 Gear Ratio
"GA" on page 87 Master Axis for Gearing

EXAMPLES:

GM 1,1,1,1 Enable GM on all axes
GM 0 Disable GM on X-axis other axes remain unchanged
GM ,,1,1 Enable GM on Z-axis and W-axis other axes remain unchanged
GM 1,0,1,0 Enable GM on X and Z-axis Disable GM on Y and W axis

Hint: The GM command is useful for driving heavy load on both sides (Gantry Style).

GR (Binary 96)

FUNCTION: Gear Ratio

DESCRIPTION:

GR specifies the Gear Ratios for the geared axes in the electronic gearing mode. The master axis is defined by the GA command. The gear ratio may be different for each geared axis. The master can go in both directions. A gear ratio of 0 disables gearing for each axis. A limit switch also disables the gearing unless gantry mode has been enabled (see GM command).

ARGUMENTS: GR n,n,n,n,n,n,n,n or GRX=n where

n is a signed numbers in the range +/-127, with a fractional resolution of .0001.

n = 0 Disables gearing

n = ? Returns the value of the gear ratio for the specified axis.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	0
In a Program	Yes	Default Format	3.4
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_GRx contains the value of the gear ratio for the specified axis.

RELATED COMMANDS:

"GA" on page 87	Master Axis
"GM" on page 88	Gantry Mode

EXAMPLES:

#GEAR	
MOY	Turn off servo to Y motor
GAY	Specify master axis as Y
GR .25,-5	Specify X and Z gear ratios
EN	End program

Now when the Y motor is rotated by hand, the X will rotate at 1/4th the speed and Z will rotate 5 times the speed in the opposite direction.

Hint: when the geared motors must be coupled "strongly" to the master, use the gantry mode GM.

HM (Binary A3)

FUNCTION: Home

DESCRIPTION:

The HM command performs a three-stage homing sequence for servo systems and two stage sequence for stepper motor operation.



For servo motor operation: During first stage of the motor moves at the user programmed speed until detecting a transition on the homing input for that axis. The direction for this first stage is determined by the initial state of the Homing Input. Once the homing input changes state, the motor decelerates to a stop. The state of the homing input can be configured using the CN command.

At the second stage, the motor change directions and slowly approach the transition again. When the transition is detected, the motor is stopped instantaneously..

At the third stage, the motor slowly moves forward until it detects an index pulse from the encoder. It stops at this point and defines it as position 0.



For stepper mode operation, the sequence consists of the first two stages. The frequency of the motion in stage 2 is 256 cts/ sec.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

DEFAULTS:

Default Value
Default Format

ALL CONTROLLERS

OPERAND USAGE:

HMx contains the state of the home switch for the specified axis

RELATED COMMANDS:

"CN" on page 50	Configure Home
"FI" on page 84	Find Index Only
"FE" on page 83	Find Home Only

EXAMPLES:

HM	Set Homing Mode for all axes
BG	Home all axes
BGX	Home only the X-axis
BGY	Home only the Y-axis
BGZ	Home only the Z-axis
BGW	Home only the W -axis

Hint: You can create your own custom homing sequence by using the FE (Find Home Sensor only) and FI (Find Index only) commands.

HX

FUNCTION: Halt Execution

DESCRIPTION:

The HX command halts the execution of any program that is running.

ARGUMENTS: HXn where

n is an integer in the range of 0 to 7 and indicates the thread number.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value n = 0
Default Format

ALL CONTROLLERS

OPERAND USAGE:

When used as an operand, _HXn contains the running status of thread n with:

- 0 Thread not running
- 1 Thread is running
- 2 Thread has stopped at trippoint

RELATED COMMANDS:

"XQ" on page 192 Execute program
"ST" on page 160 Stop all threads of motion

EXAMPLES:

XQ #A Execute program #A, thread zero
XQ #B,3 Execute program #B, thread three
HX0 Halt thread zero
HX3 Halt thread three

IA

FUNCTION: IP Address

DESCRIPTION:

The IA command assigns the controller with an IP address.

The IA command may also be used to specify the time out value. This is only applicable when using the TCP/IP protocol.

The IA command can only be used via RS-232. Since it assigns an IP address to the controller, communication with the controller via internet cannot be accomplished until after the address has been assigned.

ARGUMENTS: IA ip0,ip1,ip2, ip3 or IA n or IA<t where

ip0, ip1, ip2, ip3 are 1 byte numbers separated by commas and represent the individual fields of the IP address.

n is the IP address for the controller which is specified as an integer representing the signed 32 bit number (two's complement).

<t specifies the time in update samples between TCP retries.

<u specifies the multicast IP address where u is an integer between 0 and 63.

IA? will return the IP address of the controller

USAGE:

While Moving	No
In a Program	No
Command Line	Yes
Controller Usage	DMC-2100 ONLY

DEFAULTS:

Default Value	n = 0, t=250
Default Format	

OPERAND USAGE:

_IA0 contains the IP address representing a 32 bit signed number (Two's complement)

_IA1 contains the value for t (retry time)

_IA2 contains the number of available handles

_IA3 contains the number of the handle using this operand where the number is 0 to 5. 0 represents handle A, 1 handle B, etc.

RELATED COMMANDS:

IH	Internet Handle
----	-----------------

EXAMPLES:

IA 151, 12, 53, 89	Assigns the controller with the address 151.12.53.89
IA 2534159705	Assigns the controller with the address 151.12.53.89
IA < 500	Sets the timeout value to 500msec

IF

FUNCTION: IF conditional statement

DESCRIPTION:

The IF command is used in conjunction with an ENDIF command to form an IF conditional statement. The arguments are one or more conditional statements. If the conditional statement(s) evaluates true, the command interpreter will continue executing commands which follow the IF command. If the conditional statement evaluates false, the controller will ignore commands until the associated ENDIF command OR an ELSE command occurs in the program.

ARGUMENTS: IF condition where

Conditions are tested with the following logical operators:

< less than or equal to

> greater than

= equal to

<= less than or equal to

>= greater than or equal to

<> not equal

USAGE:

While Moving Yes
 In a Program Yes
 Command Line No
 Controller Usage **ALL CONTROLLERS**

DEFAULTS:

Default Value -
 Default Format -

RELATED COMMANDS:

"ELSE" on page 71 Optional command to be used only after IF command
 "ENDIF" on page 75 End of IF conditional Statement

EXAMPLES:

IF (_TEX<1000)	IF conditional statement based on X motor position
MG "Motor is within 1000 counts of zero"	Message to be executed if "IF" conditional statement
ENDIF	End of IF conditional statement

IH

FUNCTION: Open Internet Handle

DESCRIPTION:

The IH command is used when the DMC-2100 is operated as a master (also known as a client). This command opens a DMC-2100 handle and connects to a slave.

Each controller may have 6 handles open at any given time. They are designated by the letters A through F. To open a handle, the user must specify:

1. The IP address of the slave
2. The type of session: TCP/IP or UDP/IP
3. The port number of the slave. This number is not necessary if the slave device does not require a specific port value. If not specified, the controller will specify the port value as 502.

ARGUMENTS: IHh= ip0,ip1,ip2,ip3 <p >q **or** IHh=n <p >q **or** IHh= >r where

h is the handle, specified as A,B,C,D,E or F

ip0,ip1,ip2,ip3 are integers between 0 and 255 and represent the individual fields of the IP address. These values must be separated by commas.

n is a signed integer between - 2147483648 and 2147483648. This value is the 32 bit IP address and can be used instead of specifying the 4 address fields.

IHS => r closes the handle that sent the command; where r = -1 for UDP/IP, or r = -2 for TCP/IP.

IHT => r closes all handles except for the one sending the command; where r = -1 UDP, or r = -2 TCP.

<p specifies the port number of the slave where p is an integer between 0 and 65535. This value is not required for opening a handle.

>q specifies the connection type where q is 0 for no connection, 1 for UDP and 2 for TCP

>r specifies that the connection be terminated and the handle be freed, where r is -1 for UDP and -2 for TCP/IP

"?" returns the IP address as 4 1-byte numbers

OPERAND USAGE:

_IHh0 contains the IP address as a 32 bit number

_IHh1 contains the slave port number

_IHh2 contains a 0 if the handle is free

contains a 1 if it is for a UDP slave

contains a 2 if it is for a TCP slave

contains a -1 if it is for a UDP master

contains a -2 if it is for a TCP master

_IHh3 contains a 0 if the ARP was successful

contains a 1 if it has failed or is still in progress.

USAGE:

While Moving
 In a Program
 Command Line
 Controller Usage

No
 Yes
 Yes

DMC-2100 ONLY**DEFAULTS:**

Default Value -
 Default Format

RELATED COMMANDS:

"IA" on page 92

Internet Address

EXAMPLES:

IHA=251,29,51,1

Open handle A at IP address 251.29.51.1

IHA= -2095238399

Open handle A at IP address 251.29.51.1

Note: When the IH command is given, the controller initializes an ARP on the slave device before opening a handle. This operation can cause a small time delay before the controller responds.

II (Binary EC)

FUNCTION: Input Interrupt

DESCRIPTION:

The II command enables the interrupt function for the specified inputs. By default, input interrupts are configured for activation with a logic "0" but can be configured for activation with a logic "1" signal.

If any of the specified inputs are activated during program execution, the program will jump to the subroutine with label #ININT. Any trippoints set by the program will be cleared but can be re-enabled by the proper termination of the interrupt subroutine using RI. The RI command is used to return from the #ININT routine.

ARGUMENTS: II m,n,o,p where

m is an integer between 0 and 8 decimal. 0 disables interrupt. The value of m specifies the lowest input to be used for the input interrupt. When the 2nd argument, n, is omitted, only the input specified by m will be enabled.

n is an integer between 2 and 8. This argument is optional and is used with m to specify a range of values for input interrupts. For example, II 2,4 specifies interrupts occurring for Input 2, Input 3 and Input 4.

o is an integer between 1 and 255. Using this argument is an alternative to specifying an input range with m,n. If m and n are specified, o will be ignored. The argument o is an integer value and represents a binary number. For example, if o = 15, the binary equivalent is 00001111 where the bottom 4 bits are 1 (bit 0 through bit 3) and the top 4 bits are 0 (bit 4 through bit 7). Each bit represents an interrupt to be enabled - bit0 for interrupt 1, bit 1 for interrupt 2, etc. If o=15, the inputs 1,2,3 and 4 would be enabled.

p is an integer between 1 and 255. The argument p is used to specify inputs that will be activated with a logic "1". This argument is an integer value and represents a binary number. This binary number is used to logically "AND" with the inputs which have been specified by the parameters m and n or the parameter o. For example, if m=1 and n=4, the inputs 1,2,3 and 4 have been activated. If the value for p is 2 (the binary equivalent of 2 is 00000010), input 2 will be activated by a logic '1' and inputs 1,3, and 4 will be activated with a logic "0".

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	No
Controller Usage	All Controllers

DEFAULTS:

Default Value	
Default Format	3.0 (mask only)

RELATED COMMANDS:

"RI" on page 150	Return from Interrupt
#ININT	Interrupt Subroutine
"AI" on page 18	Trippoint for input

EXAMPLES:

#A	Program A
II 1	Specify interrupt on input 1
JG 5000;BGX	Specify jog and begin motion on X axis
#LOOP;JP #LOOP	Loop

EN	End Program
#ININT	Interrupt subroutine
STX;MG "INTERRUPT";AMX	Stop X, print message, wait for motion to complete
#CLEAR;JP#CLEAR,@IN[1]=0	Check for interrupt clear
BGX	Begin motion
RI0	Return to main program, don't re-enable trippoints

IL (Binary 89)

FUNCTION: Integrator Limit

DESCRIPTION:

The IL command limits the effect of the integrator function in the filter to a certain voltage. For example, IL 2 limits the output of the integrator of the X-axis to the +/-2 Volt range. A negative parameter also freezes the effect of the integrator during the move. For example, IL -3 limits the integrator output to +/-3V. If, at the start of the motion, the integrator output is 1.6 Volts, that level will be maintained through the move. Note, however, that the KD and KP terms remain active in any case.

ARGUMENTS: IL n,n,n,n,n,n,n,n or ILX=n where
n is a number in the range -10 to 10 Volts with a resolution of 0.0003.
n = ? Returns the value of the integrator limit for the specified axis.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	9.9988
In a Program	Yes	Default Format	1.4
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

USAGE:

_ILx contains the value of the integrator limit for the specified axis.

RELATED COMMANDS:

"KI" on page 106 Integrator

EXAMPLES:

KI 2,3,5,8 Integrator constants
IL 3,2,7,2 Integrator limits
IL ? Returns the X-axis limit
3.0000

IN

FUNCTION: Input Variable

DESCRIPTION:

The IN command allows a variable to be input from a keyboard. When the IN command is executed in a program, the prompt message is displayed. The operator then enters the variable value followed by a carriage return. The entered value is assigned to the specified variable name.

The IN command holds up execution of following commands in a program until a carriage return or semicolon is detected. If no value is given prior to a semicolon or carriage return, the previous variable value is kept. Input Interrupts, Error Interrupts and Limit Switch Interrupts will still be active.

The IN command may only be used in thread 0.

Note: When using the DMC-2000 or DMC-2100, the IN command works only with the auxiliary serial port.

ARGUMENTS: IN "m",n where

m is prompt message

n is the variable name

The total number of characters for n and m must be less than 80 characters.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	
In a Program	Yes	Default Format	Position Format
Command Line	No		
Controller Usage	ALL CONTROLLERS		

EXAMPLES: Operator specifies length of material to be cut in inches and speed in inches/sec (2 pitch lead screw, 2000 counts/rev encoder).

#A	Program A
IN "Enter Speed(in/sec)",V1	Prompt operator for speed
IN "Enter Length(in)",V2	Prompt for length
V3=V1*4000	Convert units to counts/sec
V4=V2*4000	Convert units to counts
SP V3	Speed command
PR V4	Position command
BGX	Begin motion
AMX	Wait for motion complete
MG "MOVE DONE"	Print Message
EN	End Program

IP

FUNCTION: Increment Position

DESCRIPTION:

The IP command allows for a change in the command position while the motor is moving. This command does not require a BG. The command has three effects depending on the motion being executed. The units of this are quadrature.

Case 1: Motor is standing still

An IP x,y,z,w command is equivalent to a PR x,y,z,w and BG command. The motor will move to the specified position at the requested slew speed and acceleration.

Case 2: Motor is moving towards a position as specified by PR, PA, or IP.

An IP command will cause the motor to move to a new position target, which is the old target plus the specified increment. The incremental position must be in the same direction as the existing motion.

Case 3: Motor is in the Jog Mode

An IP command will cause the motor to instantly try to servo to a position which is the current instantaneous position plus the specified increment position. The SP and AC parameters have no effect. This command is useful when synchronizing 2 axes in which one of the axis' speed is indeterminate due to a variable diameter pulley.

Warning: When the mode is in jog mode, an IP will create an instantaneous position error. In this mode, the IP should only be used to make small incremental position movements.

ARGUMENTS: IP n,n,n,n,n,n,n,n or IPX=n where

n is a signed numbers in the range -2147483648 to 2147483647 decimal.

n = ? Returns the current position of the specified axis.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	
Default Format	7.0

ALL CONTROLLERS

RELATED COMMANDS:

"PF" on page 139 Position Formatting

EXAMPLES:

IP 50	50 counts with set acceleration and speed
#CORRECT	Label
AC 100000	Set acceleration
JG 10000;BGX	Jog at 10000 counts/sec rate
WT 1000	Wait 1000 msec
IP 10	Move the motor 10 counts instantaneously
STX	Stop Motion

IT (Binary 93)

FUNCTION: Independent Time Constant - Smoothing Function

DESCRIPTION:

The IT command filters the acceleration and deceleration functions of independent moves such as JG, PR, PA to produce a smooth velocity profile. The resulting profile, known as smoothing, has continuous acceleration and results in reduced mechanical vibrations. IT sets the bandwidth of the filter where 1 means no filtering and 0.004 means maximum filtering. Note that the filtering results in longer motion time.

The use of IT will not effect the trippoints AR and AD. The trippoints AR & AD monitor the profile prior to the IT filter and therefore can be satisfied before the actual distance has been reached if IT is NOT 1.

ARGUMENTS: IT n,n,n,n,n,n,n,n or ITX=n where

n is a positive numbers in the range between 0.004 and 1.0 with a resolution of 1/256.

n = ? Returns the value of the independent time constant for the specified axis.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 1
Default Format 7.0

ALL CONTROLLERS

OPERAND USAGE:

_ITx contains the value of the independent time constant for the specified 'x' axis.

RELATED COMMANDS:

"VT" on page 189 Vector Time Constant for smoothing vector moves

EXAMPLES:

IT 0.8, 0.6, 0.9, 0.1 Set independent time constants for x,y,z,w axes
IT ? Return independent time constant for X-axis
0.8

JG (Binary A8)

FUNCTION: Jog

DESCRIPTION:

The JG command sets the jog mode and the jog slew speed of the axes.

ARGUMENTS: JG n,n,n,n,n,n,n,n or JGX=n where

n is a signed numbers in the range 0 to +/-12,000,000 decimal. The units of this are counts/second.

For stepper motor operation, the maximum value is 3,000,000 steps/ second

n = ? Returns the absolute value of the jog speed for the specified axis.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	16385
In a Program	Yes	Default Format	Position Format
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_JGx contains the absolute value of the jog speed for the specified axis.

RELATED COMMANDS:

"BG" on page 31	Begin
"ST" on page 160	Stop
"AC" on page 14	Acceleration
"DC" on page 56	Deceleration
"IP" on page 100	Increment Position
"TV" on page 175	Tell Velocity

EXAMPLES:

JG 100,500,2000,5000	Set for jog mode with a slew speed of 100 counts/sec for the X-axis, 500 counts/sec for the Y-axis, 2000 counts/sec for the Z-axis, and 5000 counts/sec for W-axis.
BG	Begin Motion
JG ,,-2000	Change the Z-axis to slew in the negative direction at -2000 counts/sec.

JP

FUNCTION: Jump to Program Location

DESCRIPTION:

The JP command causes a jump to a program location on a specified condition. The program location may be any program line number or label. The condition is a conditional statement which uses a logical operator such as equal to or less than. A jump is taken if the specified condition is true.

Multiple conditions can be used in a single jump statement. The conditional statements are combined in pairs using the operands "&" and "|". The "&" operand between any two conditions, requires that both statements must be true for the combined statement to be true. The "|" operand between any two conditions, requires that only one statement be true for the combined statement to be true. *Note: Each condition must be placed in parenthesis for proper evaluation by the controller.*

ARGUMENTS: JP location,condition where

location is a program line number or label

condition is a conditional statement using a logical operator

The logical operators are:

< less than

> greater than

= equal to

<= less than or equal to

>= greater than or equal to

<> not equal to

USAGE:

While Moving

Yes

Default Value

In a Program

Yes

Default Format

Command Line

No

Controller Usage

ALL CONTROLLERS

DEFAULTS:

RELATED COMMANDS:

"JS" on page 104

Jump to Subroutine

"IF" on page 93

If conditional statement

"ELSE" on page 71

Else function for use with IF conditional statement

"ENDIF" on page 75

End of IF conditional statement

EXAMPLES:

JP #POS1,V1<5

Jump to label #POS1 if variable V1 is less than 5

JP #A,V7*V8=0

Jump to #A if V7 times V8 equals 0

JP #B

Jump to #B (no condition)

Hint: JP is similar to an IF, THEN command. Text to the right of the comma is the condition that must be met for a jump to occur. The destination is the specified label before the comma.

JS

FUNCTION: Jump to Subroutine

DESCRIPTION:

The JS command will change the sequential order of execution of commands in a program. If the jump is taken, program execution will continue at the line specified by the destination parameter, which can be either a line number or label. The line number of the JS command is saved and after the next EN command is encountered (End of subroutine), program execution will continue with the instruction following the JS command. There can be a JS command within a subroutine.

Multiple conditions can be used in a single jump statement. The conditional statements are combined in pairs using the operands "&" and "|". The "&" operand between any two conditions, requires that both statements must be true for the combined statement to be true. The "|" operand between any two conditions, requires that only one statement be true for the combined statement to be true. *Note: Each condition must be placed in parenthesis for proper evaluation by the controller.*

Note: Subroutines may be nested 16 deep in the controller.

A jump is taken if the specified condition is true. Conditions are tested with logical operators.

The logical operators are:

< less than or equal to	<= less than or equal to
> greater than	>= greater than or equal to
= equal to	<> not equal

ARGUMENTS: JS destination, condition where

destination is a line number or label

condition is a conditional statement using a logical operator

USAGE:

While Moving
In a Program
Command Line
Controller Usage

DEFAULTS:

Yes Default Value
Yes Default Format

No

ALL CONTROLLERS

RELATED COMMANDS:

"EN" on page 73 End

EXAMPLES:

JS #SQUARE,V1<5	Jump to subroutine #SQUARE if V1 is less than 5
JS #LOOP,V1<>0	Jump to #LOOP if V1 is not equal to 0
JS #A	Jump to subroutine #A (no condition)

KD (Binary 83)

FUNCTION: Derivative Constant

DESCRIPTION:

KD designates the derivative constant in the control filter. The filter transfer function is

$$D(z) = 4 \cdot KP + 4 \cdot KD(z-1)/z + KIz/2 (z-1)$$

For further details on the filter see the section Theory of Operation.

ARGUMENTS: KD n,n,n,n,n,n,n,n or KDX=n where

n is an unsigned numbers in the range 0 to 4095.875 with a resolution of 1/8.

n = ? Returns the value of the derivative constant for the specified axis.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	64
In a Program	Yes	Default Format	4.2
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_KDx contains the value of the derivative constant for the specified axis.

RELATED COMMANDS:

"KI" on page 106	Integrator
"KP" on page 107	Proportional

EXAMPLES:

KD 100,200,300,400.25	Specify KD
KD ?,?,?,?	Return KD
0100.00,0200.00,0300.0 0,0400.25	

KI (Binary 82)

FUNCTION: Integrator

DESCRIPTION:

The KI command sets the integral gain of the control loop. It fits in the control equation as follows:

$$D(z) = 4 \cdot KP + 4 \cdot KD(z-1)/z + KI z/2(z-1)$$

The integrator term will reduce the position error at rest to zero.

ARGUMENTS: KI n,n,n,n,n,n,n,n or KIX=n where

n is an unsigned numbers in the range 0 to 2047.875 with a resolution of 1/128.

n = ? Returns the value of the derivative constant for the specified axis.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	0
In a Program	Yes	Default Format	4.0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_KIX contains the value of the derivative constant for the specified axis.

RELATED COMMANDS:

"KP" on page 107	Proportional Constant
"KI" on page 106	Integrator
"IL" on page 98	Integrator Limit

EXAMPLES:

KI 12,14,16,20	Specify x,y,z,w-axis integral
KI 7	Specify x-axis only
KI ,,8	Specify z-axis only
KI ?,?,?/?	Return X,Y,Z,W
0007,0014,0008,0020	KI values

KP (Binary 81)

FUNCTION: Proportional Constant

DESCRIPTION:

KP designates the proportional constant in the controller filter. The filter transfer function is

$$D(z) = 4 \cdot KP + 4 \cdot KD(z-1)/z + KI z/2(z-1)$$

For further details see the section Theory of Operation.

ARGUMENTS: KP n,n,n,n,n,n,n,n or KPX=n where

n is an unsigned numbers in the range 0 to 1023.875 with a resolution of 1/8.

n = ? Returns the value of the proportional constant for the specified axis.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	6
In a Program	Yes	Default Format	4.2
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_KPx contains the value of the proportional constant for the specified axis.

RELATED COMMANDS:

"KP" on page 107	Proportional Constant
"KI" on page 106	Integrator
"IL" on page 98	Integrator Limit

KS

FUNCTION: Step Motor Smoothing

DESCRIPTION:



The KS parameter sets the amount of smoothing of stepper motor pulses. This is most useful when operating in full or half step mode. Larger values of KS provide greater smoothness. This parameter will also increase the motion time by 3KS sampling periods. KS adds a single pole low pass filter onto the output of the motion profiler.

Note: KS will cause a delay in the generation of output steps.

ARGUMENTS: KS n,n,n,n,n,n,n,n or KSX=n where
n is a positive number in the range between .5 and 8 with a resolution of 1/32.
n = ? Returns the value of the derivative constant for the specified axis.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 2
Default Format 4.0

ALL CONTROLLERS

OPERAND USAGE:

_KSx contains the value of the derivative constant for the specified axis.

RELATED COMMANDS:

“MT” on page 128 Motor Type

EXAMPLES:

KS 2, 4 , 8 Specify x,y,z axes
KS 5 Specify x-axis only
KS ,,15 Specify z-axis only

Hint: KS is valid for step motor only.

LA

FUNCTION: List Arrays

DESCRIPTION:

The LA command returns a list of all arrays in memory. The listing will be in alphabetical order. The size of each array will be included next to each array name in square brackets.

ARGUMENTS: None

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value -
Default Format -

ALL CONTROLLERS

RELATED COMMANDS:

"LL" on page 114 List Labels
"LS" on page 118 List Program
"LV" on page 119 List Variable

EXAMPLES:

:LA
CA [10]
LA [5]
NY [25]
VA [17]

LE (Binary B5)

FUNCTION: Linear Interpolation End

DESCRIPTION: LE

Signifies the end of a linear interpolation sequence. It follows the last LI specification in a linear sequence. After the LE specification, the controller issues commands to decelerate the motors to a stop. The VE command is interchangeable with the LE command.

The LE command will apply to the selected coordinate system, S or T. To select the coordinate system, use the command CAS or CAT.

ARGUMENTS:

n = ? Returns the total vector move length in encoder counts for the selected coordinate system, S or T. To select the coordinate system, use the command CAS or CAT.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value -
Default Format -

OPERAND USAGE:

_LEx contains the total vector move length in encoder counts.

RELATED COMMANDS:

"LI" on page 112	Linear Distance
"BG" on page 31	BGS - Begin Sequence
"LM" on page 115	Linear Interpolation Mode
"VS" on page 188	Vector Speed
"VA" on page 179	Vector Acceleration
"VD" on page 180	Vector Deceleration
"PF" on page 139	Position Formatting

EXAMPLES:

CAS	Specify S coordinated motion system
LMZW	Specify linear interpolation mode for Z and W axes
LI ,,100,200	Specify linear distance
LE	End linear move
BGS	Begin motion

_LF*

FUNCTION: Forward Limit Switch Operand (Keyword)

DESCRIPTION:

The `_LF` operand contains the state of the forward limit switch for the specified axis.

The operand is specified as: `_LFx` where x is the specified axis.

Note: This operand is affected by the configuration of the limit switches set by the command CN:

For CN -1:

`_LFx = 1` when the limit switch input is inactive*

`_LFx = 0` when the limit switch input is active*

For CN 1:

`_LFx = 0` when the limit switch input is inactive*

`_LFx = 1` when the limit switch input is active*

* The term “active” refers to the condition when at least 1ma of current is flowing through the input circuitry. The input circuitry can be configured to sink or source current to become active. See Chapter 3 for further details.

EXAMPLES:

`MG _LF X` Display the status of the X axis forward limit switch

*** This is an Operand - Not a command.**

LI (Binary B1)

FUNCTION: Linear Interpolation Distance

DESCRIPTION:

The LI x,y,z,w command specifies the incremental distance of travel for each axis in the Linear Interpolation (LM) mode. LI parameters are relative distances given with respect to the current axis positions. Up to 511 LI specifications may be given ahead of the Begin Sequence (BGS) command. Additional LI commands may be sent during motion when the controller sequence buffer frees additional spaces for new vector segments. The Linear End (LE) command must be given after the last LI specification in a sequence. This command tells the controller to decelerate to a stop at the last LI command. It is the responsibility of the user to keep enough LI segments in the controller's sequence buffer to ensure continuous motion.

LM ? Returns the available spaces for LI segments that can be sent to the buffer. 511 returned means the buffer is empty and 511 LI segments can be sent. A zero means the buffer is full and no additional segments can be sent. It should be noted that the controller computes the vector speed based on the axes specified in the LM mode. For example, LM XYZ designates linear interpolation for the X,Y and Z axes. The speed of these axes will be computed from $VS^2 = XS^2 + YS^2 + ZS^2$ where XS, YS and ZS are the speed of the X, Y and Z axes. If the LI command specifies only X and Y, the speed of Z will still be used in the vector calculations. The controller always uses the axis specifications from LM, not LI, to compute the speed. The parameter n is optional and can be used to define the vector speed that is attached to the motion segment.

The LI command will apply to the selected coordinate system, S or T. To select the coordinate system, use the command CAS or CAT.

ARGUMENTS: LI n,n,n,n,n,n,n,n <o>p or LIX=n where

n is a signed integers in the range -8,388,607 to 8,388,607 and represent incremental move distance

o specifies a vector speed to be taken into effect at the execution of the linear segment. s is an unsigned even integer between 0 and 12,000,000 for servo motor operation and between 0 and 3,000,000 for stepper motors.

p specifies a vector speed to be achieved at the end of the linear segment. o is an unsigned even integer between 0 and 8,000,000.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

(LI cont.)

RELATED COMMANDS:

"LE" on page 110	Linear end
"BG" on page 31	BGS - Begin sequence
"LM" on page 115	Linear Interpolation Mode
"CS" on page 53	Clear Sequence
"VS" on page 188	Vector Speed
"VA" on page 179	Vector Acceleration
"VD" on page 180	Vector Deceleration

EXAMPLES:

LM XYZ	Specify linear interpolation mode
LI 1000,2000,3000	Specify distance
LE	Last segment
BGS	Begin sequence

LL

FUNCTION: List Labels

DESCRIPTION:

The LL command returns a listing of all of the program labels in memory. The listing will be in alphabetical order.

ARGUMENTS: None

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value -
Default Format -

ALL CONTROLLERS

RELATED COMMANDS:

"LA" on page 109 List Arrays
"LS" on page 118 List Program
"LV" on page 119 List Variables

EXAMPLES:

```
:LL  
# FIVE  
# FOUR  
# ONE  
# THREE  
# TWO
```

LM (Binary B 0)

FUNCTION: Linear Interpolation Mode

DESCRIPTION:

The LM command specifies the linear interpolation mode and specifies the axes for linear interpolation. Any set of 1 thru 8 axes may be used for linear interpolation. LI commands are used to specify the travel distances for linear interpolation. The LE command specifies the end of the linear interpolation sequence. Several LI commands may be given as long as the controller sequence buffer has room for additional segments. Once the LM command has been given, it does not need to be given again unless the VM command has been used.

It should be noted that the controller computes the vector speed based on the axes specified in the LM mode. For example, LM XYZ designates linear interpolation for the X,Y and Z axes. The speed of these axes will be computed from $VS^2 = XS^2 + YS^2 + ZS^2$, where XS, YS and ZS are the speed of the X,Y and Z axes. In this example, If the LI command specifies only X and Y, the speed of Z will still be used in the vector calculations. The controller always uses the axis specifications from LM, not LI, to compute the speed.

The LM command will apply to the selected coordinate system, S or T. To select the coordinate system, use the command CAS or CAT.

ARGUMENTS: LM xxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

x = ? Returns the number of spaces available in the sequence buffer for additional LI commands.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	-
Default Format	-
ALL CONTROLLERS	

OPERAND USAGE:

_LMx contains the number of spaces available in the sequence buffer for the 'x' coordinate system, S or T.

RELATED COMMANDS:

"LE" on page 110	Linear end
"LI" on page 112	Linear Distance
"VA" on page 179	Vector acceleration
"VS" on page 188	Vector Speed
"VD" on page 180	Vector deceleration
"A V" on page 26	Vector distance
"CS" on page 53	_CS - Sequence counter

EXAMPLES:

LM XYZW	Specify linear interpolation mode
VS 10000; VA 100000;VD 1000000	Specify vector speed, acceleration and deceleration
LI 100,200,300,400	Specify linear distance
LI 200,300,400,500	Specify linear distance

LE; BGS

Last vector, then begin motion

_LR*

FUNCTION: Reverse Limit Switch Operand (Keyword)

DESCRIPTION:

The `_LR` operand contains the state of the reverse limit switch for the specified axis.

The operand is specified as: `_LRx` where x is the specified axis.

Note: This operand is affected by the configuration of the limit switches set by the command CN:

For CN -1:

`_LRx = 1` when the limit switch input is inactive*

`_LRx = 0` when the limit switch input is active*

For CN 1:

`_LRx = 0` when the limit switch input is inactive*

`_LRx = 1` when the limit switch input is active*

* The term “active” refers to the condition when at least 1ma of current is flowing through the input circuitry. The input circuitry can be configured to sink or source current to become active. See Chapter 3 for further details.

EXAMPLES:

`MG _LR X` Display the status of the X axis reverse limit switch

***Note: This is an Operand - Not a command**

LS

FUNCTION: List Program

DESCRIPTION:

The LS command returns a listing of the programs in memory.

ARGUMENTS: LS n,m where

n and m are valid numbers from 0 to 999, or labels. n is the first line to be listed, m is the last.

n is an integer in the range of 0 to 999 or a label in the program memory. n is used to specify the first line to be listed.

m is an integer in the range of 1 to 999 or a label on the program memory. m is used to specify the last line to be listed.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
No
Yes

DEFAULTS:

Default Value 0, Last Line
Default Format -

ALL CONTROLLERS

RELATED COMMANDS:

"LA" on page 109 List Arrays
"LL" on page 114 List Labels
"LV" on page 119 List Variables

EXAMPLES:

:LS #A,6 List program starting at #A through line 6
002 #A
003 PR 500
004 BGX
005 AM
006 WT 200

Hint: Remember to quit the Edit Mode <cntrl> Q prior to giving the LS command.

LV

FUNCTION: List Variables

DESCRIPTION:

The LV command returns a listing of all of the program variables in memory. The listing will be in alphabetical order.

ARGUMENTS: None

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	-
Default Format	-

ALL CONTROLLERS

RELATED COMMANDS:

"LA" on page 109	List Arrays
"LS" on page 118	List Program
"LL" on page 114	List Labels

EXAMPLES:

```
:LV  
APPLE = 60.0000  
BOY   = 25.0000  
ZEBRA = 37.0000
```

LZ (Binary E7)

FUNCTION: Leading Zeros

DESCRIPTION:

The LZ command is used for formatting the values returned from interrogation commands or interrogation of variables and arrays. By enabling the LZ function, all leading zeros of returned values will be removed.

ARGUMENTS: LZ n where

n = 1 Removes leading zeros

n = 0 Does not remove leading zeros.

n = ? Returns the state of the LZ function. '0' does not remove and '1' removes
 zeros

USAGE:

While Moving	Yes	Default Value	1
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

DEFAULTS:

OPERAND USAGE:

LZ contains the state of the LZ function. '0' is disabled and '1' is enabled.

EXAMPLES:

LZ 0	Disable the LZ function
TPX	Interrogate the controller for current position of X axis
0000021645.0000	Value returned by the controller
VAR1=	Request value of variable "VAR1" (previously set to 10)
0000000010.0000	Value of variable returned by controller
LZ 1	Enable LZ function
TPX	Interrogate the controller for current position of X axis
21645.0000	Value returned by the controller
VAR1=	Request value of variable "VAR1" (previously set to 10)
10.0000	Value of variable returned by controller

MB

FUNCTION: Modbus

DESCRIPTION:

The MB command is used to communicate with I/O devices using the first two levels of the Modbus protocol.

The format of the command varies depending on each function code. The function code, -1, designates that the first level of Modbus is used (creates raw packets and receives raw data). The other codes are the 10 major function codes of the second level that the DMC-2100 supports.

FUNCTION CODE	DEFINITION
01	Read Coil Status (Read Bits)
02	Read Input Status (Read Bits)
03	Read Holding Registers (Read Words)
04	Read Input Registers (Read Words)
05	Force Single Coil (Write One Bit)
06	Preset Single Register (Write One Word)
07	Read Exception Status (Read Error Code)
15	Force Multiple Coils (Write Multiple Bits)
16	Preset Multiple Registers (Write Words)
17	Report Slave ID

Note: For those command formats that have “addr”, this is the slave address. The slave address may be designated or defaulted to the device handle number.

Note: All the formats contain an h parameter. This designates the connection handle number (A thru F).

ARGUMENTS:

MBh = -1, len, array[] where

len is the number of the bytes

Array[] is the name of array containing data

MBh = addr, 1, m, n, array[] where

m is the starting bit number

n is the number of bits

array[] of which the first element will hold result

MBh = addr, 2, m, n, array[] where

m is the starting bit number

n is the number of bits

array[] of which the first element will hold result

MBh = addr, 3, m, n, array[] where
 m is the starting register number
 n is the number of registers
 array[] will hold the response

MBh = addr, 4, m, n, array[] where
 m is the starting register number
 n is the number of registers
 array[] will hold the response

MBh = addr, 5, m, n where
 m is the starting bit number
 n is 0 or 1 and represents the coil set to off or on.

MBh = addr, 6, m, n where
 m is the register number
 n is the 16 bit value

MBh = addr, 7, array[] where
 array[] is where the returned data is stored (one byte per element)

MBh = addr, 15, m, n, array[] where
 m is the starting bit number
 n is the number of bits
 array[] contains the data (one byte per element)

MBh = addr, 16, m, n, array[] where
 m is the starting register number
 n is the number of registers
 array[] contains the data (one 16 bit word per element)

MBh = addr, 17, array[] where
 array[] is where the returned data is stored

USAGE:

While Moving
 In a Program
 Command Line
 Controller Usage

DEFAULTS:

Yes	Default Value	-
Yes	Default Format	-
Yes		
DMC-2100 ONLY		

RELATED COMMANDS:

MC (Binary C9)

FUNCTION: Motion Complete - "In Position"

DESCRIPTION:

The MC command is a trippoint used to control the timing of events. This command will hold up execution of the following commands until the current move on the specified axis or axes is completed and the encoder reaches or passes the specified position. Any combination of axes may be specified with the MC command. For example, MC XY waits for motion on both the X and Y axis to be complete. MC with no parameter specifies that motion on all axes is complete. The command TW sets the timeout to declare an error if the encoder is not in position within the specified time. If a timeout occurs, the trippoint will clear and the stopcode will be set to 99. An application program will jump to the special label.



When used in stepper mode, the controller will hold up execution of the proceeding commands until the controller has generated the same number of steps as specified in the commanded position. The actual number of steps that have been generated can be monitored by using the interrogation command TD. Note: The MC command is recommended when operating with stepper motors since the generation of step pulses can be delayed due to the stepper motor smoothing function, KS. In this case, the MC command would only be satisfied after all steps are generated.

ARGUMENTS: MC xxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

No argument specifies that motion on all axes is complete.

USAGE:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

DEFAULTS:

RELATED COMMANDS:

"BG" on page 31	Begin
"AM" on page 20	After Move
"TW" on page 176	Timeout

EXAMPLES:

#MOVE	Program MOVE
PR2000,4000	Independent Move on X and Y axis
BG XY	Start the Y-axis
MC XY	After the move is complete on T coordinate system,
MG "DONE"; TP	Print message
EN	End of Program

Hint: MC can be used to verify that the actual motion has been completed.

MF (Binary CB)

FUNCTION: Forward Motion to Position

DESCRIPTION:

The MF command is a trippoint used to control the timing of events. This command will hold up the execution of the following command until the specified motor moves forward and crosses the position specified*. The units of the command are in quadrature counts. Only one axis may be specified at a time. The MF command only requires an encoder and does not require that the axis be under servo control.

* When using a stepper motor, this condition is satisfied when the stepper position (as determined by the output buffer) has crossed the specified Forward Motion Position. For further information see Chapter 6 of the User Manual "Stepper Motor Operation".

ARGUMENTS: MF n,n,n,n,n,n,n,n or MFX=n where
n is a signed integer in the range -2147483648 to 2147483647 decimal

USAGE:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage		ALL CONTROLLERS	

DEFAULTS:

RELATED COMMANDS:

"AD" on page 15	Trippoint for after Relative Distances
"AP" on page 21	Trippoint for after Absolute Position

EXAMPLES:

#TEST	Program B
DPO	Define zero
JG 1000	Jog mode (speed of 1000 counts/sec)
BG X	Begin move
MF 2000	After passing the position 2000
V1=_TPX	Assign V1 X position
MG "Position is", V1	Print Message
ST	Stop
EN	End of Program

Hint: The accuracy of the MF command is the number of counts that occur in 2 msec. Multiply the speed by 2 msec to obtain the maximum error. MF tests for absolute position. The MF command can also be used when the specified motor is driven independently by an external device.

MG

FUNCTION: Message

DESCRIPTION:

The MG command sends data out the bus. This can be used to alert an operator, send instructions or return a variable value.

ARGUMENTS: MG "m", {^n}, V {Fm.n or \$m,n} {N} {Pn} where

"m" is a text message including letters, numbers, symbols or <ctrl>G (up to 72 characters).

{^n} is an ASCII character specified by the value n

{U} for USB port

{Ex} for ethernet and 'x' specifies the ethernet handle (A,B,C,D,E,F or H).

V is a variable name or array element where the following formats can be used:

{Fm.n} Display variable in decimal format with m digits to left of decimal, and n to the right.

{\$m.n} Display variable in hexadecimal format with m digits to left of decimal, and n to the right.

{Sn} Display variable as a string of length n where n is 1 through 6

{N} Suppress carriage return line feed.

{Pn} Directs output to main serial port, P1 or auxiliary serial port, P2 where n is a 0 or 1.

Note: Multiple text, variables, and ASCII characters may be used, each must be separated by a comma.

Note: The order of arguments is not important.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	Variable Format
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

EXAMPLES:

Case 1: Message command displays ASCII strings

MG "Good Morning" Displays the string

Case 2: Message command displays variables or arrays

MG "The Answer is", Total {F4.2} Displays the string with the content of variable TOTAL in local format of 4 digits before and 2 digits after the decimal point.

Case 3: Message command sends any ASCII characters to the port.

MG {^13}, {^10}, {^48}, {^055} displays carriage return and the characters 0 and 7.

MO (Binary A9)

FUNCTION: Motor Off

DESCRIPTION:

The MO command shuts off the control algorithm. The controller will continue to monitor the motor position. To turn the motor back on use the Servo Here command (SH).

ARGUMENTS: MO xxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes.

No argument specifies all axes.

USAGE:

While Moving	No
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	0
Default Format	1.0

ALL CONTROLLERS

OPERAND USAGE:

_MOx contains the state of the motor for the specified axis.

RELATED COMMANDS:

"SH" on page 158 Servo Here

EXAMPLES:

MO	Turn off all motors
MOX	Turn off the X motor. Leave the other motors unchanged
MOY	Turn off the Y motor. Leave the other motors unchanged
MOZX	Turn off the Z and X motors. Leave the other motors unchanged
SH	Turn all motors on
Bob=_MOX	Sets Bob equal to the X-axis servo status
Bob=	Return value of Bob. If 1, in motor off mode, If 0, in servo mode

Hint: The MO command is useful for positioning the motors by hand. Turn them back on with the SH command.

MR (Binary CC)

FUNCTION: Reverse Motion to Position

DESCRIPTION:

The MR command is a trippoint used to control the timing of events. This command will hold up the execution of the following command until the specified motor moves backward and crosses the position specified*. The units of the command are in quadrature counts. Only one axis may be specified at a time. The MR command only requires an encoder and does not require that the axis be under servo control.

* When using a stepper motor, this condition is satisfied when the stepper position (as determined by the output buffer) has crossed the specified Reverse Motion Position. For further information see Chapter 6 of the User Manual "Stepper Motor Operation".

ARGUMENTS: MR n,n,n,n,n,n,n,n or MRX=n where
n is a signed integers in the range -2147483648 to 2147483647 decimal

USAGE:

While Moving
In a Program
Command Line
Controller Usage

DEFAULTS:

No Default Value
Yes Default Format
Yes

ALL CONTROLLERS

RELATED COMMANDS:

"AD" on page 15 Trippoint for Relative Distances
"AP" on page 21 Trippoint for after Absolute Position

EXAMPLES:

#TEST	Program B
DP0	Define zero
JG -1000	Jog mode (speed of 1000 counts/sec)
BG X	Begin move
MR -3000	After passing the position -3000
V1=_TPX	Assign V1 X position
MG "Position is", V1= ST	Print Message Stop
EN	End of Program

Hint: The accuracy of the MR command is the number of counts that occur in 2 msec. Multiply the speed by 2 msec to obtain the maximum error. MR tests for absolute position. The MR command can also be used when the specified motor is driven independently by an external device.

MT

FUNCTION: Motor Type

DESCRIPTION:



The MT command selects the type of the motor and the polarity of the drive signal. Motor types include standard servomotors, which require a voltage in the range of +/- 10 Volts, and step motors, which require pulse and direction signals. The polarity reversal inverts the analog signals for servomotors, and inverts logic level of the pulse train, for step motors.

ARGUMENTS: MT n,n,n,n,n,n,n,n or MTX=n where

- n = 1 Specifies Servo motor
- n = -1 Specifies Servo motor with reversed polarity
- n = -2 Specifies Step motor with active high step pulses
- n = 2 Specifies Step motor with active low step pulses
- n = -2.5 Specifies Step motor with reversed direction and active high step pulses
- n = 2.5 Specifies Step motor with reversed direction and active low step pulses
- n = ? Returns the value of the motor type for the specified axis.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

DEFAULTS:

Default Value 1,1,1,1
Default Format 1

ALL CONTROLLERS

OPERAND USAGE:

_MTx contains the value of the motor type for the specified axis.

RELATED COMMANDS:

"CE" on page 46 Configure encoder type

EXAMPLES:

MT 1,-1,2,2 Configure x as servo, y as reverse servo, z and w as steppers
MT ?,? Interrogate motor type
V=_MTX Assign motor type to variable

NB

FUNCTION: Notch Bandwidth

DESCRIPTION:

The NB command sets real part of the notch poles

ARGUMENTS: NB n,n,n,n,n,n,n,n or NBX=n where

n is ranges from 0 Hz to $\frac{1}{(16 \cdot TM)}$

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

DEFAULTS:

Default Value 0.5
Default Format

ALL CONTROLLERS

RELATED COMMANDS:

"NF" on page 130 Notch Filter
"NZ" on page 132 Notch Zeros

EXAMPLES:

_NBX = 10 Sets the real part of the notch pole to 10/2 Hz
NOTCH = _NBX Sets the variable "NOTCH" equal to the notch bandwidth value for the X axis

NF

FUNCTION: Notch Frequency

DESCRIPTION:

The NF command sets the frequency of the notch filter, which is placed in series with the PID compensation.

ARGUMENTS: NF n,n,n,n,n,n,n,n or NFX=n where

n ranges from 1 Hz to $\frac{1}{(4 \cdot TM)}$ where TM is the update rate (default TM is 1 msec).

n = ? Returns the value of the Notch filter for the specified axis.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	0
Default Format	

ALL CONTROLLERS

OPERAND USAGE:

_NFx contains the value of notch filter for the specified axis.

RELATED COMMANDS:

"NB" on page 129 Notch bandwidth

"NZ" on page 132 Notch Zero

EXAMPLES:

NF, 20 Sets the notch frequency of Y axis to 20 Hz

NO (‘ apostrophe also accepted)

FUNCTION: No Operation

DESCRIPTION:

The NO or an apostrophe (‘) command performs no action in a sequence, but can be used as a comment in a program. This helps to document a program.

ARGUMENTS: NO m where

m is any group of letters and numbers

up to 77 characters can follow the NO command

USAGE:

DEFAULTS:

While Moving	Yes	Default Value
In a Program	Yes	Default Format
Command Line	Yes	
Controller Usage	ALL CONTROLLERS	

EXAMPLES:

#A	Program A
NO	No Operation
NO This Program	No Operation
NO Does Absolutely	No Operation
NO Nothing	No Operation
EN	End of Program

NZ

FUNCTION: Notch Zero

DESCRIPTION:

The NZ command sets the real part of the notch zero.

ARGUMENTS: NZ n,n,n,n,n,n,n,n or NZX=n where

n is ranges from 1 Hz to $\frac{1}{(16 \cdot TM)}$

n = ? Returns the value of the Notch filter zero for the specified axis.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0.5
Default Format

ALL CONTROLLERS

OPERAND USAGE:

_NZx contains the value of the Notch filter zero for the specified axis.

RELATED COMMANDS:

"NB" on page 129 Notch Bandwidth
"NF" on page 130 Notch Filter

EXAMPLES:

NZX = 10 Sets the real part of the notch pole to 10/2 Hz

OB (Binary E9)

FUNCTION: Output Bit

DESCRIPTION:

The OB n, logical expression command defines output bit n = 1 through 8 as either 0 or 1 depending on the result from the logical expression. Any non-zero value of the expression results in a one on the output.

ARGUMENTS: OB n, *expression* where

n denotes the output bit

expression is any valid logical expression, variable or array element.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

DEFAULTS:

Yes Default Value
Yes Default Format

Yes

ALL CONTROLLERS

EXAMPLES:

OB 1, POS=1	If POS 1 is non-zero, Bit 1 is high. If POS 1 is zero, Bit 1 is low
OB 2, @IN[1]&@IN[2]	If Input 1 and Input 2 are both high, then Output 2 is set high
OB 3, COUNT[1]	If the element 1 in the array is zero, clear bit 3
OB N, COUNT[1]	If element 1 in the array is zero, clear bit N

OC

FUNCTION: Output Compare

DESCRIPTION:

The OC command allows the generation of output pulses based on one of the main encoder positions. The output is a low-going pulse with a duration of approximately 600 nanoseconds and is available at the output compare signal (labeled CMP on the ICM-1900 and ICM-2900).

This function cannot be used with any axis configured for a step motor and the auxiliary encoder of the corresponding axis can not be used while using this function.

Note: The OC function requires that the main encoder and auxiliary encoders be configured exactly the same (see the command, CE). For example: CE 0, CE 5, CE 10, CE 15.

ARGUMENTS: OCx = m, n where

x = X Y Z W or A,B,C,D,E,F,G H specifies which encoder input to be used.

m = Absolute position for first pulse. Integer between $-2 \cdot 10^9$ and $2 \cdot 10^9$

n = Incremental distance between pulses. Integer between -65535 and 65535.

Notes:

OCx = 0 will disable the Circular Compare function.

The sign of the parameter, n, will designate the expected direction of motion for the output compare function. When moving in the opposite direction, output compare pulses will occur at the incremental distance of $65536 - |n|$ where $|n|$ is the absolute value of n.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_OCx contains the state of the OC function

_OCx = 0 : OC function has been enabled but not generated any pulses.

_OCx = 1: OC function not enables or has generated the first output pulse.

EXAMPLES:

OCX=300,100 Select X encoder as position sensor. First pulse at 300. Following pulses at 400, 500...

OE (Binary 8D)

FUNCTION: Off on Error

DESCRIPTION:

The OE command causes the controller to shut off the motor command if a position error exceeds the limit specified by the ER command occurs or an abort occurs from either the abort input or on AB command.

If a position error is detected on an axis, and the motion was executing an independent move, only that axis will be shut off. If the motion is a part of coordinated mode of the types VM, LM or CM, all participating axes will be stopped.

ARGUMENTS: OE n,n,n,n,n,n,n,n or OEX=n where

n = 0 Disables the Off-On-Error function.

n = 1 Enables the Off-On-Error function.

n = ? Returns the state of the off on error function for the specified axis.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	0
Default Format	1.0

ALL CONTROLLERS

OPERAND USAGE:

_OEx contains the status of the off-on-error function for the specified axis. 0 = off, 1 = on

RELATED COMMANDS:

"AB" on page 13	Abort
"ER" on page 79	Error limit
"SH" on page 158	Servo Here
#POSERR	Error Subroutine

EXAMPLES:

OE 1,1,1,1	Enable OE on all axes
OE 0	Disable OE on X-axis other axes remain unchanged
OE ,,1,1	Enable OE on Z-axis and W -axis other axes remain unchanged
OE 1,0,1,0	Enable OE on X and Z-axis Disable OE on Y and W axis

Hint: The OE command is useful for preventing system damage on excessive error.

OF (Binary 99)

FUNCTION: Offset

DESCRIPTION:

The OF command sets a bias voltage in the motor command output or returns a previously set value. This can be used to counteract gravity or an offset in an amplifier.

ARGUMENTS: OF n,n,n,n,n,n,n,n or OFX=n where

n is a signed number in the range -9.998 to 9.998 volts with resolution of 0.0003.

n = ? Returns the offset for the specified axis.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

DEFAULTS:

Yes	Default Value	0
Yes	Default Format	1.0

Yes

ALL CONTROLLERS

OPERAND USAGE:

_OFx contains the offset for the specified axis.

EXAMPLES:

OF 1,-2,3,5	Set X-axis offset to 1, the Y-axis offset to -2, the Z-axis to 3, and the W-axis to 5
OF -3	Set X-axis offset to -3 Leave other axes unchanged
OF ,0	Set Y-axis offset to 0 Leave other axes unchanged
OF ?,?,?,?	Return offsets
-3.0000,0.0000,3.0000,5.0000	
OF ?	Return X offset
-3.0000	
OF ,?	Return Y offset
0.0000	

OP (Binary E8)

FUNCTION: Output Port

DESCRIPTION:

The OP command sends data to the output ports of the controller. You can use the output port to control external switches and relays.

ARGUMENTS: OP m,a,b,c,d where

m is an integer in the range 0 to 65535 decimal, or \$0000 to \$FFFF hexadecimal. (0 to 255 for 4 axes or less). m is the decimal representation of the general output bits. Output 1 through output 8 for controllers with 4 axes or less. Outputs 1 through output 16 for controller with 5 or more axes.

a,b,c,d represent the extended I/O in consecutive groups of 16 bits, (values from 0 to 65535).

Arguments which are given for I/O points which are configured as inputs will be ignored.

The following table describes the arguments used to set the state of outputs.

Arguments	Blocks	Bits	Description
m	0	1-8	General Outputs (1-4 axes controllers)
	0,1	1-16	General Outputs (5-8 axes controllers)
a	2,3	17-32	Extended I/O
b	4,5	33-48	Extended I/O
c	6,7	49-64	Extended I/O
d	8,9	65-80	Extended I/O

n = ? returns the value of the argument, where n is any of the above arguments.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	0
In a Program	Yes	Default Format	3.0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_OP0 contains the value of the first argument, m

_OP1 contains the value of the first argument, a

_OP2 contains the value of the first argument, b

_OP3 contains the value of the first argument, c

_OP4 contains the value of the first argument, d

RELATED COMMANDS:

"SB" on page 156	Set output bit
"CB" on page 43	Clear output bit
"OB" on page 133	Output Byte

EXAMPLES:

OP 0	Clear Output Port -- all bits
OP \$85	Set outputs 1,3,8; clear the others
MG_OP0	Returns the first parameter "m"
MG_OP1	Returns the second parameter "a"

PA (Binary A6)

FUNCTION: Position Absolute

DESCRIPTION:

The PA command will set the final destination of each axis. The position is referenced to the absolute zero.

ARGUMENTS: PA n,n,n,n,n,n,n,n or PAX=n where

n is a signed integers in the range -2147483647 to 2147483648 decimal. Units are in encoder counts.

n = ? Returns the commanded position at which motion stopped.

USAGE:

DEFAULTS:

While Moving	No	Default Value	-
In a Program	Yes	Default Format	Position Format
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_Pax contains the last commanded position at which motion stopped.

RELATED COMMANDS:

“PR” on page 141	Position relative
“SP” on page 159	Speed
“AC” on page 14	Acceleration
“DC” on page 56	Deceleration
“BG” on page 31	Begin
“PF” on page 139	Position Formatting

EXAMPLES:

:PA 400,-600,500,200	X-axis will go to 400 counts Y-axis will go to -600 counts Z-axis will go to 500 counts W-axis will go to 200 counts
BG;AM	Execute Motion and Wait for Motion Complete
:PA ?,?,?,?	Returns the current commanded position after motion has completed
400, -600, 500, 200	
:BG	Start the move
:PA 700	X-axis will go to 700 on the next move while the
:BG	Y,Z and W -axis will travel the previously set relative distance if the preceding move was a PR move, or will not move if the preceding move was a PA move.

PF

FUNCTION: Position Format

DESCRIPTION:

The PF command allows the user to format the position numbers such as those returned by TP. The number of digits of integers and the number of digits of fractions can be selected with this command. An extra digit for sign and a digit for decimal point will be added to the total number of digits. If PF is minus, the format will be hexadecimal and a dollar sign will precede the characters. Hex numbers are displayed as 2's complement with the first bit used to signify the sign.

If a number exceeds the format, the number will be displayed as the maximum possible positive or negative number (i.e. 999.99, -999, \$8000 or \$7FF).

The PF command can be used to format values returned from the following commands:

BL ?	LE ?
DE ?	PA ?
DP ?	PR ?
EM ?	TN ?
FL ?	VE ?
IP ?	TE
TP	

ARGUMENTS: PF m,n where

m is an integer between -8 and 10 which represents the number of places preceding the decimal point. A negative sign for m specifies hexadecimal representation.

n is an integer between 0 and 4 which represent the number of places after the decimal point.

n = ? Returns the value of m.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	10.0
Default Format	10.0

ALL CONTROLLERS

OPERAND USAGE:

_PF contains the value of 'm' position format parameter.

EXAMPLES:

:TPX	Tell position of X
0000000000	Default format
:PF 5.2	Change format to 5 digits of integers and 2 of fractions
:TPX	Tell Position
00021.00	
PF-5.2	New format Change format to hexadecimal*
:TPX	Tell Position
\$00015.00	Report in hex

PL (Binary 87)

FUNCTION: Pole

DESCRIPTION:

The PL command adds a low-pass filter in series with the PID compensation. The digital transfer function of the filter is $(1 - P) / (Z - P)$ and the equivalent continuous filter is $A/(S+A)$ where A is the filter cutoff frequency: $A=(1/T) \ln (1/p)$ rad/sec and T is the sample time.

ARGUMENTS: PL n,n,n,n,n,n,n,n or PLX=n where

n is a positive number in the range 0 to 0.9999.

n = ? Returns the value of the pole filter for the specified axis.

USAGE:

While Moving

In a Program

Not in a Program

Controller Usage

DEFAULTS:

Yes

Yes

Yes

ALL CONTROLLERS

Default Value

Default Format

0.0

3.0

OPERAND USAGE:

_PLx contains the value of the pole filter for the specified axis.

RELATED COMMANDS:

"KD" on page 105

"KP" on page 107

"KI" on page 106

Derivative

Proportional

Integral Gain

EXAMPLES:

PL .95,.9,.8,.822

PL ?,?,?,?

0.9527,0.8997,0.7994,0.8244

PL?

0.9527

PL?

0.8997

Set X-axis Pole to 0.95, Y-axis to 0.9, Z-axis to 0.8. W -axis pole to 0.822

Return all Poles

Return X Pole only

Return Y Pole only

PR (Binary A7)

FUNCTION: Position Relative

DESCRIPTION:

The PR command sets the incremental distance and direction of the next move. The move is referenced with respect to the current position. .

ARGUMENTS: PR n,n,n,n,n,n,n,n or PRX=n where

n is a signed integer in the range -2147483648 to 2147483647 decimal. Units are in encoder counts

n = ? Returns the current incremental distance for the specified axis.

USAGE:

DEFAULTS:

While Moving	No	Default Value	0
In a Program	Yes	Default Format	Position Format
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_PRx contains the current incremental distance for the specified axis.

RELATED COMMANDS:

"PA" on page 138	Position Absolute
"BG" on page 31	Begin
"AC" on page 14	Acceleration
"DC" on page 56	Deceleration
"SP" on page 159	Speed
"IP" on page 100	Increment Position
"PF" on page 139	Position Formatting

EXAMPLES:

:PR 100,200,300,400	On the next move the X-axis will go 100 counts,
:BG	the Y-axis will go to 200 counts forward, Z -axis will go 300 counts and the W -axis will go 400 counts.
:PR ?,?,?	Return relative distances
0000000100,0000000200,0000000300	
:PR 500	Set the relative distance for the X axis to 500
:BG	The X-axis will go 500 counts on the next move while the Y-axis will go its previously set relative distance.

QD

FUNCTION: Download Array

DESCRIPTION:

The QD command transfers array data from the host computer to the controller. QD array[], start, end requires that the array name be specified along with the first element of the array and last element of the array. The array elements can be separated by a comma (,) or by <CR> <LF>. The downloaded array is terminated by a <control>Z, <control>Q, <control>D or \.

ARGUMENTS: QD array[],start,end where

array[] is valid array name start is first element of array (default=0) end is last element of array (default = last element)

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value 0
Default Format Position Format

RELATED COMMANDS:

"QU" on page 144 Upload array

HINT:

Using Galil terminal software, the command can be used in the following manner:

1. Set the timeout to 0
2. Send the command QD
- 3a. Use the send file command to send the data file.

OR

- 3b. Enter data manually from the terminal. End the data entry with the character '\'

QR

FUNCTION: Data Record

DESCRIPTION:

The QR command causes the controller to return a record of information regarding controller status. This status information includes 4 bytes of header information and specific blocks of information as specified by the command arguments. The details of the status information is described in Chapter 4 of the user's manual.

ARGUMENTS: QR xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G,H,S,T, or I or any combination to specify the axis, axes, sequence, or I/O status

S and T represent the S and T coordinated motion planes

I represents the status of the I/O

Chapter 4 of the users manual provides the definition of the data record information.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value -
Default Format -

ALL CONTROLLERS

RELATED COMMANDS:

"QZ" on page 145 Return DMA / Data Record information

Note: The Galil windows terminal will not display the results of the QR command since the results are in binary format.

QU

FUNCTION: Upload Array

DESCRIPTION:

The QU command transfers array data from the controller to a host computer. The QU requires that the array name be specified along with the first element of the array and last element of the array. The uploaded array will be followed by a <control>Z as an end of text marker.

ARGUMENTS: QU array[],start,end,delim where

“array[]” is a valid array name

“start” is the first element of the array (default=0)

“end” is the last element of the array (default = last element)

“delim” specifies the character used to delimit the array elements. If delim is 1, then the array elements will be separated by a comma. Otherwise, the elements will be separated by a carriage return.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

No
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value 0
Default Format Position Format

RELATED COMMANDS:

"QD" on page 142 Download array

QZ

FUNCTION: Return DMA / Data Record information

DESCRIPTION:

The QZ command is an interrogation command that returns information regarding DMA transfers (DMC-1700), the secondary FIFO (DMC-1600, DMC-1700, DMC-1800) or the Data Record (DMC-1200, -2000, -2100). The controller's response to this command will be the return of 4 integers separated by commas. The four fields represent the following:

First field returns the number of axes.

Second field returns the number of bytes to be transferred for general status

Third field returns the number bytes to be transferred for coordinated move status

Fourth field returns the number of bytes to be transferred for axis specific information

ARGUMENTS: QZ

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	---
Default Format	

ALL CONTROLLERS

RELATED COMMANDS:

"DR" on page 61	DMA update rate
"QR" on page 143	Data Record

RA

FUNCTION: Record Array

DESCRIPTION:

The RA command selects one through eight arrays for automatic data capture. The selected arrays must be dimensioned by the DM command. The data to be captured is specified by the RD command and time interval by the RC command.

ARGUMENTS: RA n [],m [],o [],p [] RA n[],m[],o[],p[],q[],r[],s[],t[] where

n,m,o and p are dimensioned arrays as defined by DM command. The [] contain nothing.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value -
Default Format -

ALL CONTROLLERS

RELATED COMMANDS:

"DM" on page 59 Dimension Array
"RD" on page 148 Record Data
"RC" on page 147 Record Interval

EXAMPLES:

#Record Label
DM POS[100] Define array
RA POS[] Specify Record Mode
RD _TPX Specify data type for record
RC 1 Begin recording at 2 msec intervals
PR 1000;BG Start motion
EN End

***Hint:** The record array mode is useful for recording the real-time motor position during motion. The data is automatically captured in the background and does not interrupt the program sequencer. The record mode can also be used for a teach or learn of a motion path.*

RC

FUNCTION: Record

DESCRIPTION:

The RC command begins recording for the Automatic Record Array Mode (RA). RC 0 stops recording .

ARGUMENTS: RC n,m where

n is an integer 1 thru 8 and specifies 2^n samples between records. RC 0 stops recording.

m is optional and specifies the number of records to be recorded. If m is not specified, the DM number will be used. A negative number for m causes circular recording over array addresses 0 to m-1. The address for the array element for the next recording can be interrogated with _RD.

n = ? Returns status of recording. '1' if recording, '0' if not recording.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_RC contains status of recording. '1' if recording, '0' if not recording.

RELATED COMMANDS:

"DM" on page 59	Dimension Array
"RD" on page 148	Record Data
"QZ" on page 145	Record Array Mode

EXAMPLES:

#RECORD	Record
DM Torque[1000]	Define Array
RA Torque[]	Specify Record Mode
RD _TTX	Specify Data Type
RC 2	Begin recording and set 4 msec between records
JG 1000;BG	Begin motion
#A;JP #A,_RC=1	Loop until done
MG "DONE RECORDING"	Print message
EN	End program

RD

FUNCTION: Record Data

DESCRIPTION:

The RD command specifies the data type to be captured for the Record Array (RA) mode.
The command type includes:

_AFx	Analog Input Value (+32767 to -32768). The analog inputs are limited to those which correspond to an axis on the controller.
_Dex	2nd encoder
_TPx	Position
_Tex	Position error
_SHx	Commanded position
_RLx	Latched position
_TI	Inputs
_OP	Outputs
_TSx	Switches, only 0-4 bits valid
_SCx	Stop code
_TTx	Tell torque (Note: the values recorded for torque are in the range of +/- 32767 where 0 is 0 torque, -32767 is -10 volt command output, and +32767 is +10 volt.

where 'x' is the axis specifier, A...H

ARGUMENTS: RD m₁, m₂, m₃, m₄, m₅, m₆, m₇, m₈ where

the arguments are data types to be captured using the record Array feature. The order is important. Each data type corresponds with the array specified in the RA command.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value -
Default Format -

ALL CONTROLLERS

OPERAND USAGE:

_RD contains the address for the next array element for recording.

RELATED COMMANDS:

"QZ" on page 145 Record Array
"RC" on page 147 Record Interval
"DM" on page 59 Dimension Array

EXAMPLES:

DM ERRORX[50],ERRORY[50] Define array
RA ERRORX[],ERRORY[] Specify record mode
RD _TEX,_TEYS Specify data type
RC1 Begin record
JG 1000;BG Begin motion

RE

FUNCTION: Return from Error Routine

DESCRIPTION:

The RE command is used to end a position error handling subroutine or limit switch handling subroutine. The error handling subroutine begins with the #POSERR label. The limit switch handling subroutine begins with the #LIMSWI. An RE at the end of these routines causes a return to the main program. Care should be taken to be sure the error or limit switch conditions no longer occur to avoid re-entering the subroutines. If the program sequencer was waiting for a trippoint to occur, prior to the error interrupt, the trippoint condition is preserved on the return to the program if RE1 is used. RE0 clears the trippoint. To avoid returning to the main program on an interrupt, use the ZS command to zero the subroutine stack.

ARGUMENTS: RE n where

n = 0 Clears the interrupted trippoint

n = 1 Restores state of trippoint

no argument clears the interrupted trippoint

USAGE:

While Moving	No	Default Value	-
In a Program	Yes	Default Format	-
Command Line	No		
Controller Usage	ALL CONTROLLERS		

DEFAULTS:

RELATED COMMANDS:

#POSERR	Error Subroutine
#LIMSWI	Limit Subroutine

EXAMPLES:

#A;JP #A;EN	Label for main program
#POSERR	Begin Error Handling Subroutine
MG "ERROR"	Print message
SB 1	Set output bit 1
RE	Return to main program and clear trippoint

Hint: An applications program must be executing for the #LIMSWI and #POSERR subroutines to function.

RI

FUNCTION: Return from Interrupt Routine

DESCRIPTION:

The RI command is used to end the interrupt subroutine beginning with the label #ININT. An RI at the end of this routine causes a return to the main program. The RI command also re-enables input interrupts. If the program sequencer was interrupted while waiting for a trippoint, such as WT, RI1 restores the trippoint on the return to the program. RI0 clears the trippoint. To avoid returning to the main program on an interrupt, use the command ZS to zero the subroutine stack. This turns the jump subroutine into a jump only.

ARGUMENTS: RI n where

n = 0 Clears the interrupted trippoint

n = 1 Restores state of trippoint

no argument clears the interrupted trippoint

USAGE:

While Moving

In a Program

Command Line

Controller Usage

DEFAULTS:

No

Yes

No

Default Value

Default Format

-

-

ALL CONTROLLERS

RELATED COMMANDS:

#ININT

"II" on page 96

Input interrupt subroutine

Enable input interrupts

EXAMPLES:

#A;II1;JP #A;EN

#ININT

MG "INPUT INTERRUPT"

SB 1

RI 1

Program label

Begin interrupt subroutine

Print Message

Set output line 1

Return to the main program and restore trippoint

Hint: An applications program must be executing for the #ININT subroutine to function.

RL (Binary DD)

FUNCTION: Report Latched Position

DESCRIPTION:

The RL command will return the last position captured by the latch. The latch must first be armed by the AL command and then a 0 must occur on the appropriate input. Each axis uses a specific general input for the latch input:

X (A)	axis latch	Input	1
Y (B)	axis latch	Input	2
Z (C)	axis latch	Input	3
W (D)	axis latch	Input	4
E	axis latch	Input	9
F	axis latch	Input	10
G	axis latch	Input	11
H	axis latch	Input	12

The armed state of the latch can be configured using the CN command.

Note: The Latch Function works with the main encoder. When working with a stepper motor without an encoder, the latch can be used to capture the stepper position. To do this, place a wire from the controller Step (PWM) output into the main encoder input, channel A+. Connect the Direction (sign) output into the channel B+ input. Configure the main encoder for Step/Direction using the CN command. The latch will now capture the stepper position based on the pulses generated by the controller.

ARGUMENTS: RL xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage **ALL CONTROLLERS**

DEFAULTS:

Default Value 0
Default Format Position Format

OPERAND USAGE:

_RLx contains the latched position of the specified axis.

RELATED COMMAND:

"AL" on page 19 Arm Latch

EXAMPLES:

JG ,5000 Set up to jog the Y-axis
BGY Begin jog
ALY Arm the Y latch; assume that after about 2 seconds, input goes low
RLY Report the latch
10000

RP (Binary D8)

FUNCTION: Reference Position

DESCRIPTION:

This command returns the commanded reference position of the motor(s).

ARGUMENTS: RP xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format Position Format

ALL CONTROLLERS

OPERAND USAGE:

_RPx contains the commanded reference position for the specified axis.

RELATED COMMAND:

"TP" on page 171 Tell Position

Note: The relationship between RP, TP and TE: $TEX = RP - TP$ equals the difference between the reference position, RPX, and the actual position, _TPX.

EXAMPLES: Assume that XYZ and W axes are commanded to be at the positions 200, -10, 0, -110

respectively. The returned units are in quadrature counts.

```
:PF 7 Position format of 7
0:RP
0000200,-0000010,0000000,-0000110 Return X,Y,Z,W reference positions
RPX
0000200 Return the X motor reference position
RPY
-0000010 Return the Y motor reference position
PF-6.0 Change to hex format
RP
$0000C8,$FFFFFF6,$000000,$FFFF93 Return X,Y,Z,W in hex
Position =_RPX Assign the variable, Position, the value of RPX
```



Hint: RP command is useful when operating step motors since it provides the commanded position in steps when operating in stepper mode.

RS

FUNCTION: Reset

DESCRIPTION:

The RS command resets the state of the processor to its power-on condition. The previously saved state of the controller, along with parameter values, and saved sequences are restored.

USAGE:

While Moving	Yes
In a Program	No
Command Line	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value	0
Default Format	-

<control>R<control>S

FUNCTION: Master Reset

DESCRIPTION:

This command resets the controller to factory default settings and erases EEPROM.

A master reset can also be performed by installing a jumper on the controller at the location labeled MRST and resetting the controller (power cycle or pressing the reset button). Remove the jumper after this procedure.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	No	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

Note: A master reset is not supported on the ethernet connection. Any attempt will hang up the host.

<control>R<control>V

FUNCTION: Revision Information

DESCRIPTION:

The Revision Information command causes the controller to return firmware revision information.

USAGE:

While Moving	Yes
In a Program	No
Command Line	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value	-
Default Format	-

SB (Binary EA)

FUNCTION: Set Bit

DESCRIPTION:

The SB command sets one of the output bits.

ARGUMENTS: SB n where

n is an integer which represents a specific controller output bit to be set high (output = 1).

Note: When using Modbus devices (DMC-2100 ONLY), the I/O points of the modbus devices are calculated using the following formula:

$$n = (\text{SlaveAddress} * 1000) + (\text{HandleNum} * 1000) + ((\text{Module} - 1) * 4) + (\text{Bitnum} - 1)$$

Slave Address is used when the ModBus device has slave devices connected to it and specified as Addresses 0 to 255. Please note that the use of slave devices for modbus are very rare and this number will usually be 0.

HandleNum is the handle specifier from A to F.

Module is the position of the module in the rack from 1 to 16.

BitNum is the I/O point in the module from 1 to 4.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value -
Default Format -

ALL CONTROLLERS

RELATED COMMAND

"CB" on page 43 Clear Bit

EXAMPLES:

SB 5 Set output line 5
SB 1 Set output line 1

SC (Binary E1)

FUNCTION: Stop Code

DESCRIPTION:

The SC command allows the user to determine why a motor stops. The controller responds with the stop code as follows:

CODE	MEANING	CODE	MEANING
0	Motors are running, independent mode	9	Stopped after Finding Edge (FE)
1	Motors stopped at commanded independent position	10	Stopped after homing (HM)
2	Decelerating or stopped by FWD limit switches	11	Stopped by Selective Abort Input
3	Decelerating or stopped by REV limit switches	50	Contour running
4	Decelerating or stopped by Stop Command (ST)	51	Contour Stop
6	Stopped by Abort input	99	MC timeout
7	Stopped by Abort command (AB)	100	Motors are running, vector sequence
8	Decelerating or stopped by Off-on-Error (OE1)	101	Motors stopped at commanded vector

ARGUMENTS: SC xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value -
Default Format 3.0

OPERAND USAGE:

_SCx contains the value of the stop code for the specified axis.

EXAMPLES:

Tom =_SCW Assign the Stop Code of W to variable Tom

SH (Binary AA)

FUNCTION: Servo Here

DESCRIPTION:

The SH commands tells the controller to use the current motor position as the command position and to enable servo control here.

This command can be useful when the position of a motor has been manually adjusted following a motor off (MO) command.

ARGUMENTS: SH xxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

USAGE:

While Moving	No
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	-
Default Format	-

ALL CONTROLLERS

RELATED COMMANDS:

“MO” on page 126 Motor-off

EXAMPLES:

SH	Servo X,Y,Z,W motors
SHX	Only servo the X motor, the Y,Z and W motors remain in its previous state.
SHY	Servo the Y motor; leave the X,Z and W motors unchanged
SHZ	Servo the Z motor; leave the X,Y and W motors unchanged
SHW	Servo the W motor; leave the X,Y and Z motors unchanged

Note: The SH command changes the coordinate system. Therefore, all position commands given prior to SH, must be repeated. Otherwise, the controller produces incorrect motion.

SP (Binary 92)

FUNCTION: Speed

DESCRIPTION:

This command sets the slew speed of any or all axes for independent moves.

Note: Negative values will be interpreted as the absolute value.

ARGUMENTS: SP n,n,n,n,n,n,n,n or SPX=n where

n is an unsigned even number in the range 0 to 12,000,000 for servo motors. The units are encoder counts per second.

OR

n is an unsigned number in the range 0 to 3,000,000 for stepper motors

n = ? Returns the speed for the specified axis.



USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value 25000
Default Format Position Format

OPERAND USAGE:

_SPx contains the speed for the specified axis.

RELATED COMMANDS:

"AC" on page 14 Acceleration
"DC" on page 56 Deceleration
"PA" on page 138 Position Absolute
"PR" on page 141 Position Relation
"BG" on page 31 Begin

EXAMPLES:

PR 2000,3000,4000,5000 Specify x,y,z,w parameter
SP 5000,6000,7000,8000 Specify x,y,z,w speeds
BG Begin motion of all axes
AM Z After Z motion is complete

Note: For vector moves, use the vector speed command (VS) to change the speed. SP is not a "mode" of motion like JOG (JG).

ST (Binary A1)

FUNCTION: Stop

DESCRIPTION:

The ST command stops motion on the specified axis. Motors will come to a decelerated stop.

ARGUMENTS: ST xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G,H,S or T or any combination to specify the axis or sequence. If the specific axis or sequence is specified, program execution will not stop.

No argument will stop motion on all axes and stop any programs which are executing.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	-
Default Format	-

ALL CONTROLLERS

RELATED COMMANDS:

"BG" on page 31	Begin Motion
"AB" on page 7	Abort Motion
"DC" one page 56	Deceleration rate

EXAMPLES:

ST X	Stop X-axis motion
ST S	Stop coordinated sequence
ST XYZW	Stop X,Y,Z,W motion
ST	Stop program and XYZW motion
ST SZW	Stop coordinated XY sequence, and Z and W motion

Hint: Use the after motion complete command, AM, to wait for motion to be stopped.

TB

FUNCTION: Tell Status Byte

DESCRIPTION:

The TB command returns status information from the controller as a decimal number. Each bit of the status byte denotes the following condition when the bit is set (high):

BIT	STATUS
Bit 7	Executing application program
Bit 6 (DMC-1200,1600 and 1700)	DMA active
Bit 6 (DMC-2000 only)	Controller is currently being addressed in a daisy chain
Bit 5	Contouring
Bit 4	Executing error or limit switch routine
Bit 3	Input interrupt enabled
Bit 2	Executing input interrupt routine
Bit 1 (DMC-1200,1600 and 1700)	Secondary FIFO Polling active
Bit 1 (DMC-2000 only)	N/A
Bit 0	Echo on

ARGUMENTS:

TB ? returns the status byte

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage **ALL CONTROLLERS**

DEFAULTS:

Default Value -
Default Format 1.0

OPERAND USAGE:

_TB Contains the status byte

EXAMPLES:

"TB" on page 161 Tell status information from the controller
65 Executing program and Echo is on ($2^6 + 2^0 = 64 + 1 = 65$)

TC

FUNCTION: Tell Error Code

DESCRIPTION:

The TC command returns a number between 1 and 255. This number is a code that reflects why a command was not accepted by the controller. This command is useful when the controller halts execution of a program at a command or when the response to a command is a question mark. The TC command will provide the user with a diagnostic tool. After TC has been read, the error code is set to zero.

ARGUMENTS: TC n where

- n = 0 Returns code only
- n = 1 Returns code and message
- n = ? Returns the error code

No argument will provide the error code for all axes

CODE	EXPLANATION	CODE	EXPLANATION
1	Unrecognized command	57	Bad function or array
2	Command only valid from program	58	Not a valid Command Operand (i.e._GNX)
3	Command not valid in program	59	Mismatched parentheses
4	Operand error	60	Download error - line too long or too many lines
5	Input buffer full	61	Duplicate or bad label
6	Number out of range	62	Too many labels
7	Command not valid while running	63	IF statement without ENDIF
8	Command not valid when not running	65	IN command must have a comma
9	Variable error	66	Array space full
10	Empty program line or undefined label	67	Too many arrays or variables
11	Invalid label or line number	68	Not valid from USB Port
12	Subroutine more than 16 deep	71	IN only valid in task #0
13	JG only valid when running in jog mode	80	Record mode already running
14	EEPROM check sum error	81	No array or source specified
15	EEPROM write error	82	Undefined Array
16	IP incorrect sign during position move or IP given during forced deceleration	83	Not a valid number
17	ED, BN and DL not valid while program running	84	Too many elements
18	Command not valid when contouring	90	Only X Y Z W valid operand
19	Application strand already executing	96	SM jumper needs to be installed for stepper motor operation
20	Begin not valid with motor off	97	Bad Binary Command Format
21	Begin not valid while running	98	Binary Commands not valid in application program
22	Begin not possible due to Limit Switch	99	Bad binary command number

24	Begin not valid because no sequence defined	100	Not valid when running ECAM
25	Variable not given in IN command	101	Improper index into ET (must be 0-256)
28	S operand not valid	102	No master axis defined for ECAM
29	Not valid during coordinated move	103	Master axis modulus greater than 256*EP value
30	Sequence segment too short	104	Not valid when axis performing ECAM
31	Total move distance in a sequence > 2 billion	105	EB1 command must be given first
32	More than 511 segments in a sequence	110	No hall effect sensors detected
33	VP or CR commands cannot be mixed with LI commands	111	Must be made brushless by BA command
41	Contouring record range error	112	BZ command timeout
42	Contour data being sent too slowly	113	No movement in BZ command
46	Gear axis both master and follower	114	BZ command runaway
50	Not enough fields	118	Controller has GL1600 not GL1800
51	Question mark not valid	120	Bad Ethernet transmit
52	Missing " or string too long	121	Bad Ethernet packet received
53	Error in { }	122	Ethernet input buffer overrun
54	Question mark part of string	123	TCP lost sync
55	Missing [or []	124	Ethernet handle already in use
56	Array index invalid or out of range	125	No ARP response from IP address

USAGE:

While Moving Yes
 In a Program Yes
 Not in a Program Yes
 Controller Usage **ALL CONTROLLERS**

DEFAULTS :

Default Value ---
 Default Format 3.0

USAGE:

_TC contains the error code

EXAMPLES:

:GF32 Bad command
 ?TC Tell error code
 001 Unrecognized command

TD (Binary DB)

FUNCTION: Tell Dual Encoder

DESCRIPTION:

This command returns the current position of the dual (auxiliary) encoder(s). Auxiliary encoders are not available for stepper axes or for the axis where output compare is used.

When operating with stepper motors, the TD command returns the number of counts that have been output by the controller.



ARGUMENTS: TD xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

No argument will provide the dual encoder position for all axes

USAGE:

While Moving Yes
In a Program Yes
Not in a Program Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format Position Format

ALL CONTROLLERS

OPERAND USAGE:

_TDX contains value of dual encoder register.

RELATED COMMANDS:

"DE" on page 57

Dual Encoder

EXAMPLES:

:PF 7

Position format of 7

:TD

Return X,Y,Z,W Dual encoders

0000200,-0000010,0000000,-0000110

TDX

Return the X motor Dual encoder

0000200

DUAL=_TDX

Assign the variable, DUAL, the value of TDX

TE (Binary DA)

FUNCTION: Tell Error

DESCRIPTION:

This command returns the current position error of the motor(s). The range of possible error is 2147483647. The Tell Error command is not valid for step motors since they operate open-loop.

ARGUMENTS: TE xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

No argument will provide the position error for all axes

USAGE:

While Moving
In a Program
Not in a Program
Controller Usage

DEFAULTS:

Yes	Default Value	0
Yes	Default Format	Position Format

Yes

ALL CONTROLLERS

RELATED COMMANDS:

"OE" on page 135	Off On Error
"ER" on page 79	Error Limit
#POSERR	Error Subroutine
"PF" on page 139	Position Formatting

EXAMPLES:

TE	Return all position errors
00005,-00002,00000,00006	
TEX	Return the X motor position error
00005	
TEY	Return the Y motor position error
-00002	
Error =_TEX	Sets the variable, Error, with the X-axis position error

***Hint:** Under normal operating conditions with servo control, the position error should be small. The position error is typically largest during acceleration.*

TI (Binary E0)

FUNCTION: Tell Inputs

DESCRIPTION:

This command returns the state of the inputs including the extended I/O configured as inputs. The value returned by this command is decimal and represents an 8 bit value (decimal value ranges from 0 to 255). Each bit represents one input where the LSB is the lowest input number and the MSB is the highest input bit.

ARGUMENTS: TIn where

- n = 0 Return Input Status for Inputs 1 through 8
- n = 1 Return Input Status for Inputs 9 through 16^{see note 1}
- n = 2 Return Input Status for Inputs 17 through 24^{see note 2}
- n = 3 through 9^{see note 3}

where n represents the extended inputs ranging from (8*n)+1 through (8*(n+1))

- n = 10 Return Input Status for Inputs 81 through 88 (auxiliary encoder inputs)^{4see}
- n = 11 Return Input Status for Inputs 89 through 96 (auxiliary encoder inputs)⁴

no argument will return the Input Status for Inputs 1 through 8

n = ? returns the Input Status for Inputs 1 through 8

^{note1} Applies only to controllers with more than 4 axes

^{note2} Does not apply to DMC-2x00 controller

^{note3} These arguments only apply when using extended I/O configured as inputs

^{note4} These arguments only apply to the auxiliary encoder inputs available on the controller

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	1.0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_TIn contains the status byte of the input block specified by 'n'. Note that the operand can be masked to return only specified bit information - see section on Bit-wise operations.

EXAMPLES:

TI	
08	Input 4 is high, others low
TI	
00	All inputs low
Input =_TI	Sets the variable, Input, with the TI value
TI	
255	All inputs high

TIME*

FUNCTION: Time Operand (Keyword)

DESCRIPTION:

*The TIME operand returns the value of the internal free running, real time clock. The returned value represents the number of servo loop updates and is based on the TM command. The default value for the TM command is 1000. With this update rate, the operand TIME will increase by 1 count every update of approximately 1000usec. Note that a value of 1000 for the update rate (TM command) will actually set an update rate of 1/1024 seconds. Thus the value returned by the TIME operand will be off by 2.4% of the actual time.

The clock is reset to 0 with a standard reset or a master reset.

The keyword, TIME, does not require an underscore "_" as does the other operands.

EXAMPLES:

MG TIME Display the value of the internal clock

TL (Binary 8a)

FUNCTION: Torque Limit

DESCRIPTION:

The TL command sets the limit on the motor command output. For example, TL of 5 limits the motor command output to 5 volts. Maximum output of the motor command is 9.998 volts.

ARGUMENTS: TL n,n,n,n,n,n,n,n or TLX=n where

n is an unsigned numbers in the range 0 to 9.998 volts with resolution of 0.003 volts

n = ? Returns the value of the torque limit for the specified axis.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	1.0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_TLx contains the value of the torque limit for the specified axis.

EXAMPLES:

TL 1,5,9,7.5	Limit X-axis to 1 volt Limit Y-axis to 5 volts Limit Z-axis to 9 volts Limit W-axis to 7.5 volts
TL ?,?,?,?	Return limits
1.0000,5.0000,9.0000, 7.5000	
TL ?	Return X-axis limit
1.0000	

TM (Binary E5)

FUNCTION: Update Time

DESCRIPTION:

The TM command sets the sampling period of the control loop. Changing the sampling period will uncalibrate the speed and acceleration parameters. A negative number turns off the internal clock allowing for an external source to be used as the time base. The units of this command are μsec .

ARGUMENTS: TM n where

With the fast firmware: n is an integer in the range 125 to 20000 decimal with resolution of 125 microseconds. The minimum sample time for the DMC-1210 & DMC-1710 is possible when using the fast firmware. In the Fast firmware mode the following functions are disabled: Gearing, CAM, PL, Analog Feedback, Steppers, Trippoints in main thread, DMA and TV. Using the fast firmware the minimum sample times are the following:

Optima Controllers with 1-2 axes	125 usec
Optima Controllers with 3-4 axes	250 usec
Optima Controllers with 5-6 axes	375 usec
Optima Controllers with 7-8 axes	500 usec

With the normal firmware: Using the normal firmware the minimum sample times are the following:

Optima Controllers with 1-2 axes	250 usec
Optima Controllers with 3-4 axes	375 usec
Optima Controllers with 5-6 axes	500 usec
Optima Controllers with 7-8 axes	625 usec

n = ? returns the value of the sample time.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	1.0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_TM contains the value of the sample time.

EXAMPLES:

TM -1000	Turn off internal clock
TM 2000	Set sample rate to 2000 [EQN "[mu]"]sec (This will cut all speeds in half and all acceleration in fourths)
TM 1000	Return to default sample rate

TN (Binary B4)

FUNCTION: Tangent

DESCRIPTION:

The TN m,n command describes the tangent axis to the coordinated motion path. m is the scale factor in counts/degree of the tangent axis. n is the absolute position of the tangent axis where the tangent axis is aligned with zero degrees in the coordinated motion plane. The tangent axis is specified with the VM n,m,p command where p is the tangent axis. The tangent function is useful for cutting applications where a cutting tool must remain tangent to the part.

ARGUMENTS: TN m,n where

m is the scale factor in counts/degree, in the range between -127 and 127 with a fractional resolution of 0.004

m = ? Returns the first position value for the tangent axis.



When operating with stepper motors, m is the scale factor in steps / degree

n is the absolute position at which the tangent angle is zero, in the range between $\pm 2 \cdot 10^9$

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	--
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_TN contains the first position value for the tangent axis. This allows the user to correctly position the tangent axis before the motion begins.

RELATED COMMANDS:

"VM" on page 183	Vector mode
"CR" on page 52	Circular Command

EXAMPLES:

VM X,Y,Z	Specify coordinated mode for X and Y-axis; Z-axis is tangent to the motion path
TN 100,50	Specify scale factor as 100 counts/degree and 50 counts at which tangent angle is zero
VP 1000,2000	Specify vector position X,Y
VE	End Vector
BGS	Begin coordinated motion with tangent axis

TP (Binary D9)

FUNCTION: Tell Position

DESCRIPTION:

This command returns the current position of the motor(s).

ARGUMENTS: TP xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage **ALL CONTROLLERS**

DEFAULTS:

Default Value -
Default Format --

OPERAND USAGE:

_TPx contains the current position value for the specified axis.

No argument will provide the encoder position for all axes

RELATED COMMANDS:

"PF" on page 139 Position Formatting

EXAMPLES:

Assume the X-axis is at the position 200 (decimal), the Y-axis is at the position -10 (decimal), the Z-axis is at position 0, and the W-axis is at -110 (decimal). The returned parameter units are in quadrature counts.

:PF 7	Position format of 7
:TP	Return X,Y,Z,W positions
0000200,-0000010,0000000,-0000110	
TPX	Return the X motor position
0000200	
TPY	Return the Y motor position
-0000010	
PF-6.0	Change to hex format
TP	Return X,Y,Z,W in hex
\$0000C8,\$FFFFFF6,\$000000,\$FFFF93	
Position =_TPX	Assign the variable, Position, the value of TPX

TR

FUNCTION: Trace

DESCRIPTION:

The TR command causes each instruction in a program to be sent out the communications port prior to execution. TR1 enables this function and TR0 disables it. The trace command is useful in debugging programs.

ARGUMENTS: TR n where

n = 0 Disables the trace function

n = 1 Enables the trace function

No argument disables the trace function

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value TR0
Default Format --

ALL CONTROLLERS

TS (Binary DF)

FUNCTION: Tell Switches

DESCRIPTION:

TS returns status information of the Home switch, Forward Limit switch Reverse Limit switch, error conditions, motion condition and motor state. The value returned by this command is decimal and represents an 8 bit value (decimal value ranges from 0 to 255). Each bit represents the following status information:

Bit	Status
Bit 7	Axis in motion if high
Bit 6	Axis error exceeds error limit if high
Bit 5	X motor off if high
Bit 4	Undefined
Bit 3	Forward Limit Switch Status inactive if high
Bit 2	Reverse Limit Switch Status inactive if high
Bit 1	Home X Switch Status
Bit 0	Latched

Note: For active high or active low configuration (CN command), these bits are '1' when the switch is inactive and '0' when active.

ARGUMENTS: TS xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

No argument will provide the status for all axes

USAGE:

While Moving

Yes

In a Program

Yes

Command Line

Yes

Controller Usage

DEFAULTS:

Default Value

-

Default Format

3.0

ALL CONTROLLERS

OPERAND USAGE:

_TS contains the current status of the switches.

EXAMPLES:

V1=_TSY

Assigns value of TSY to the variable V1

V1=

Interrogate value of variable V1

015 (returned value)

Decimal value corresponding to bit pattern 00001111

Y axis not in motion (bit 7 - has a value of 0)

Y axis error limit not exceeded (bit 6 has a value of 0)

Y axis motor is on (bit 5 has a value of 0)

Y axis forward limit is inactive (bit 3 has a value of 1)

Y axis reverse limit is inactive (bit 2 has a value of 1)

Y axis home switch is high (bit 1 has a value of 1)

Y axis latch is not armed (bit 0 has a value of 1)

TT (Binary DE)

FUNCTION: Tell Torque

DESCRIPTION:

The TT command reports the value of the analog output signal, which is a number between -9.998 and 9.998 volts.

ARGUMENTS: TT xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

No argument will provide the torque for all axes

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	1.4
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_TTx contains the value of the torque for the specified axis.

RELATED COMMANDS:

"TL" on page 168 Torque Limit

EXAMPLES:

V1=_TTX	Assigns value of TTX to variable, V1
TTX	Report torque on X
-0.2843	Torque is -.2843 volts

TV (Binary DC)

FUNCTION: Tell Velocity

DESCRIPTION:

The TV command returns the actual velocity of the axes in units of encoder count/s. The value returned includes the sign.

ARGUMENTS: TV xxxxxxxxxxxx where

x is X,Y,Z,W,A,B,C,D,E,F,G or H or any combination to specify the axis or axes

No argument will provide the dual encoder position for all axes

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	7.0
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_TVx contains the value of the velocity for the specified axis.

EXAMPLES:

VELX=_TVX	Assigns value of X-axis velocity to the variable VELX
TVX	Returns the X-axis velocity
0003420	

Note: The TV command is computed using a special averaging filter (over approximately .25 sec). Therefore, TV will return average velocity, not instantaneous velocity.

TW (Binary CA)

FUNCTION: Timeout for IN-Position (MC)

DESCRIPTION:

The TW command sets the timeout in msec to declare an error if the MC command is active and the motor is not at or beyond the actual position within n msec after the completion of the motion profile. If a timeout occurs, then the MC trippoint will clear and the stopcode will be set to 99. An application program will jump to the special label #MCTIME. The RE command should be used to return from the #MCTIME subroutine.

ARGUMENTS: TW n,n,n,n,n,n,n,n or TWX=n where

n specifies the timeout in msec. n ranges from 0 to 32767 msec

n = -1 Disables the timeout.

n = ? Returns the timeout in msec for the MC command for the specified axis.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 32766
Default Format

ALL CONTROLLERS

OPERAND USAGE:

_TWx contains the timeout in msec for the MC command for the specified axis.

RELATED COMMANDS:

"MC" on page 121 Motion Complete trippoint

UI

FUNCTION: User Interrupt

DESCRIPTION:

The UI command causes an interrupt on the selected IRQ line. There are 16 user interrupts where UI n, n = 0 through 15. Prior to using the UI command, one IRQ line must be enabled on the controller and the data 2 and 4 written to the control register at address N + 1. Interrupts may be enabled through the Plug and Play feature. An interrupt service routine must also be incorporated in your host program. The interrupt condition can be read by writing a 6 to address N + 1 and then reading address N + 1. Refer to the user manual for additional information.

ARGUMENTS: UI n where

n is an integer between 0 and 15.

USAGE:

While Moving Yes
In a Program Yes
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format -

EXCEPT FOR DMC-2000

EXAMPLES:

#I	Label
PR 10000	Position relative
SP 5000	Speed
BGX	Begin motion
AS	Wait for at speed
UI 1	Send interrupt 1
EN	End program

This program sends an interrupt to the selected IRQ line. The host writes a 6 to address N + 1 and then reads address N + 1 to receive data E1 which corresponds to UI1.

UL

FUNCTION: Upload

DESCRIPTION:

The UL command transfers data from the controller to a host computer through port 1. Programs are sent without line numbers. The Uploaded program will be followed by a <control>Z or a \ as an end of text marker.

ARGUMENTS: None

USAGE:

While Moving Yes
In a Program No
Command Line Yes
Controller Usage

DEFAULTS:

Default Value 0
Default Format -

ALL CONTROLLERS

OPERAND USAGE:

When used as an operand, _UL gives the number of available variables. The number of available variables is 254.

RELATED COMMAND:

"DL" on page 58 Download

EXAMPLES:

UL; Begin upload
#A Line 0
NO This is an Example Line 1
NO Program Line 2
EN Line 3
<cntrl>Z Terminator

VA (Binary B7)

FUNCTION: Vector Acceleration

DESCRIPTION:

This command sets the acceleration rate of the vector in a coordinated motion sequence.

ARGUMENTS: VA s,t where

s and t are unsigned integers in the range 1024 to 68,431,360. s represents the vector acceleration for the S coordinate system and t represents the vector acceleration for the T coordinate system. The parameter input will be rounded down to the nearest factor of 1024. The units of the parameter is counts per second squared.

s = ? Returns the value of the vector acceleration for the S coordinate plane.

t = ? Returns the value of the vector acceleration for the T coordinate plane.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	262144
In a Program	Yes	Default Format	Position Format
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_VAx contains the value of the vector acceleration for the specified axis.

RELATED COMMANDS:

"VS" on page 188	Vector Speed
"VP" on page 185	Vector Position
"VE" on page 181	End Vector
"CR" on page 52	Circle
"VM" on page 183	Vector Mode
"BG" on page 31	Begin Sequence
"VD" on page 180	Vector Deceleration
"VT" on page 189	Vector smoothing constant - S-curve

EXAMPLES:

VA 1024	Set vector acceleration to 1024 counts/sec ²
VA ?	Return vector acceleration
00001024	
VA 20000	Set vector acceleration
VA ?	
0019456	Return vector acceleration
ACCEL=_VA	Assign variable, ACCEL, the value of VA

VD (Binary B8)

FUNCTION: Vector Deceleration

DESCRIPTION:

This command sets the deceleration rate of the vector in a coordinated motion sequence.

ARGUMENTS: VD s,t where

s and t are unsigned integers in the range 1024 to 68431360. s represents the vector deceleration for the S coordinate system and t represents the vector acceleration for the T coordinate system. The parameter input will be rounded down to the nearest factor of 1024. The units of the parameter is counts per second squared.

s = ? Returns the value of the vector deceleration for the S coordinate plane.

t = ? Returns the value of the vector deceleration for the T coordinate plane.

USAGE:

DEFAULTS:

While Moving	No	Default Value	262144
In a Program	Yes	Default Format	Position Format
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_VDx contains the value of the vector deceleration for the specified coordinate system, S or T.

RELATED COMMANDS:

"VA" on page 179	Vector Acceleration
"VS" on page 188	Vector Speed
"VP" on page 185	Vector Position
"CR" on page 52	Circle
"VE" on page 181	Vector End
"VM" on page 183	Vector Mode
"BG" on page 31	Begin Sequence
"VT" on page 189	Smoothing constant - S-curve

EXAMPLES:

#VECTOR	Vector Program Label
VMXY	Specify plane of motion
VA1000000	Vector Acceleration
VD 5000000	Vector Deceleration
VS 2000	Vector Speed
VP 10000, 20000	Vector Position
VE	End Vector
BGS	Begin Sequence

VE

FUNCTION: Vector Sequence End

DESCRIPTION:

VE is required to specify the end segment of a coordinated move sequence. VE would follow the final VP or CR command in a sequence. VE is equivalent to the LE command.

The VE command will apply to the selected coordinate system, S or T. To select the coordinate system, use the command CAS or CAT.

ARGUMENTS: VE n

No argument specifies the end of a vector sequence

n = ? Returns the length of the vector in counts.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	-
Default Format	-

ALL CONTROLLERS

OPERAND USAGE:

_VEx contains the length of the vector in counts for the specified coordinate system, S or T.

RELATED COMMANDS:

"VM" on page 183	Vector Mode
"VS" on page 188	Vector Speed
"VA" on page 179	Vector Acceleration
"VD" on page 180	Vector Deceleration
"CR" on page 52	Circle
"VP" on page 185	Vector Position
"BG" on page 31	Begin Sequence
"CS" on page 53	Clear Sequence

EXAMPLES:

VM XY	Vector move in XY
VP 1000,2000	Linear segment
CR 0,90,180	Arc segment
VP 0,0	Linear segment
VE	End sequence
BGS	Begin motion

VF

FUNCTION: Variable Format

DESCRIPTION:

The VF command formats the number of digits to be displayed when interrogating the controller.

If a number exceeds the format, the number will be displayed as the maximum possible positive or negative number (i.e. 999.99, -999, \$8000 or \$7FF).

ARGUMENTS: VF m.n where

m and n are unsigned numbers in the range $0 < m < 10$ and $0 < n < 4$.

m represents the number of digits before the decimal point. A negative m specifies hexadecimal format. When in hexadecimal, the string will be preceded by a \$ and Hex numbers are displayed as 2's complement with the first bit used to signify the sign.

n represents the number of digits after the decimal point.

m = ? Returns the value of the format for variables and arrays.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	10.4
Default Format	2.1

ALL CONTROLLERS

OPERAND USAGE:

_VF contains the value of the format for variables and arrays.

RELATED COMMANDS:

"PF" on page 139 Vector Position

EXAMPLES:

VF 5.3	Sets 5 digits of integers and 3 digits after the decimal point
VF 8.0	Sets 8 digits of integers and no fractions
VF -4.0	Specify hexadecimal format with 4 bytes to the left of the decimal

VM

FUNCTION: Coordinated Motion Mode

DESCRIPTION:

The VM command specifies the coordinated motion mode and the plane of motion. This mode may be specified for motion on any set of two axes.

The motion is specified by the instructions VP and CR, which specify linear and circular segments. Up to 511 segments may be given before the Begin Sequence (BGS or BGT) command. Additional segments may be given during the motion when the buffer frees additional spaces for new segments. It is the responsibility of the user to keep enough motion segments in the buffer to ensure continuous motion.

The Vector End (VE) command must be given after the last segment. This allows the controller to properly decelerate.

The VM command will apply to the selected coordinate system, S or T. To select the coordinate system, use the command CAS or CAT.

ARGUMENTS: VM n,m,p where

n and m specify plane of vector motion and can be any two axes. Vector Motion can be specified for one axis by specifying 2nd parameter, m, as N. Specifying one axis is useful for obtaining sinusoidal motion on 1 axis.

p is the tangent axis and can be specified as any axis. A value of N for the parameter, p, turns off tangent function.

n = ? Returns the available spaces for motion segments that can be sent to the buffer. A value of zero means that the buffer is full and no additional segments may be sent.

USAGE:

DEFAULTS:

While Moving	No	Default Value	X,Y
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_VMx contains instantaneous commanded vector velocity for the specified coordinate system, S or T.

RELATED COMMANDS:

"VP" on page 185	Vector Position
"VS" on page 188	Vector Speed
"VA" on page 179	Vector Acceleration
"VD" on page 180	Vector Deceleration
"CR" on page 52	Circle
"VE" on page 181	End Vector Sequence
"CS" on page 53	Clear Sequence
"VT" on page 189	Vector smoothing constant -- S-curve
"AV" on page 26	Trippoint for Vector distance

EXAMPLES:

CAS	Specify S coordinate system
VM X,Y	Specify coordinated mode for X,Y
CR 500,0,180	Specify arc segment
VP 100,200	Specify linear segment
VE	End vector
BGS	Begin sequence

VP (Binary B2)

FUNCTION Vector Position

DESCRIPTION:

The VP command defines the target coordinates of a straight line segment in a 2 axis motion sequence which have been selected by the VM command. The units are in quadrature counts, and are a function of the vector scale factor set using the command VS.

For three or more axes linear interpolation, use the LI command.

The VP command will apply to the selected coordinate system, S or T. To select the coordinate system, use the command CAS or CAT.

ARGUMENTS: VP n,m < o > p where

n and m are signed integers in the range -2147483648 to 2147483647. The length of each segment must be limited to $8 \cdot 10^6$. The values for n and m will specify a coordinate system from the beginning of the sequence.

o specifies a vector speed to be taken into effect at the execution of the vector segment. n is an unsigned even integer between 0 and 12,000,000 for servo motor operation and between 0 and 3,000,000 for stepper motors.

p specifies a vector speed to be achieved at the end of the vector segment. p is an unsigned even integer between 0 and 8,000,000.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	ALL CONTROLLERS

DEFAULTS:

Default Value	-
Default Format	-

OPERAND USAGE:

_VPx contains the absolute coordinate of the axes at the last intersection along the sequence. For example, during the first motion segment, this instruction returns the coordinate at the start of the sequence. The use as an operand is valid in the linear mode, LM, and in the Vector mode, VM.

RELATED COMMANDS:

"CR" on page 52	Circle
"VM" on page 183	Vector Mode
"VA" on page 179	Vector Acceleration
"VD" on page 180	Vector Deceleration
"VE" on page 181	Vector End
"VS" on page 188	Vector Speed
"BG" on page 31	Begin Sequence
"VT" on page 189	Vector smoothing

EXAMPLES:

#A	Program A
VM X,Y	Specify motion plane
VP 1000,2000	Specify vector position X,Y
CR 1000,0,360	Specify arc

VE	Vector end
VS 2000	Specify vector speed
VA 400000	Specify vector acceleration
BGS	Begin motion sequence
EN	End Program

Hint: The first vector in a coordinated motion sequence defines the origin for that sequence. All other vectors in the sequence are defined by their endpoints with respect to the start of the move sequence.

VR (Binary BA)

FUNCTION: Vector Speed Ratio

DESCRIPTION:

The VR sets a ratio to be used as a multiplier of the current vector speed. The vector speed can be set by the command VS or the operators < and > used with CR, VP and LI commands. VR takes effect immediately and will ratio all the following vector speed commands. VR doesn't ratio acceleration or deceleration, but the change in speed is accomplished by accelerating or decelerating at the rate specified by VA and VD.

ARGUMENTS: VR s,t where

s and t are between 0 and 10 with a resolution of .0001. The value specified by s is the vector ratio to apply to the S coordinate system and t is the value to apply to the T coordinate system.

s = ? Returns the value of the vector speed ratio for the S coordinate plane.

t = ? Returns the value of the vector speed ratio for the T coordinate plane.

USAGE:

While Moving
In a Program
Command Line
Controller Usage

Yes
Yes
Yes

ALL CONTROLLERS

DEFAULTS:

Default Value 1
Default Format -

OPERAND USAGE:

_VRx contains the vector speed ratio of the specified coordinate system, S or T.

RELATED COMMANDS:

"VS" on page 188 Vector Speed

EXAMPLES:

#A	Vector Program
VMXY	Vector Mode
VP 1000,2000	Vector Position
CR 1000,0,360	Specify Arc
VE	End Sequence
VS 2000	Vector Speed
BGS	Begin Sequence
AMS	After Motion
JP#A	Repeat Move
#SPEED	Speed Override
VR@AN[1]*.1	Read analog input compute ratio
JP#SPEED	Loop
XQ#A,0; XQ#SPEED,1	Execute task 0 and 1 simultaneously

Note: VR is useful for feedrate override, particularly when specifying the speed of individual segments using the operator '<' and '>'.

VS (Binary B9)

FUNCTION: Vector Speed

DESCRIPTION:

The VS command specifies the speed of the vector in a coordinated motion sequence in either the LM or VM modes. VS may be changed during motion.

Vector Speed can be calculated by taking the square root of the sum of the squared values of speed for each axis specified for vector or linear interpolated motion.

ARGUMENTS: VS s,t where

s and t are unsigned even numbers in the range 2 to 12,000,000 for servo motors and 2 to 3,000,000 for stepper motors. s is the speed to apply to the S coordinate system and t is the speed to apply to the T coordinate system. The units are counts per second.

s = ? Returns the value of the vector speed for the S coordinate plane.

t = ? Returns the value of the vector speed for the T coordinate plane.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	8192
Default Format	-

ALL CONTROLLERS

OPERAND USAGE:

_VSx contains the vector speed of the specified coordinate system, S or T

RELATED COMMANDS:

"VA" on page 179	Vector Acceleration
"VP" on page 185	Vector Position
"CR" on page 52	Circle
"LM" on page 115	Linear Interpolation
"VM" on page 183	Vector Mode
"BG" on page 31	Begin Sequence
"VE" on page 181	Vector End

EXAMPLES:

VS 2000	Define vector speed of S coordinate system
VS ?	Return vector speed of S coordinate system
002000	

Hint: Vector speed can be attached to individual vector segments. For more information, see description of VP, CR, and LI commands.

VT (Binary B6)

FUNCTION: Vector Time Constant - S curve

DESCRIPTION:

The VT command filters the acceleration and deceleration functions in vector moves of VM, LM type to produce a smooth velocity profile. The resulting profile, known as Smoothing, has continuous acceleration and results in reduced mechanical vibrations. VT sets the bandwidth of the filter, where 1 means no filtering and 0.004 means maximum filtering. Note that the filtering results in longer motion time.

ARGUMENTS: VT s,t where

s and t are unsigned numbers in the range between 0.004 and 1.0, with a resolution of 1/256. The value s applies to the S coordinate system and t applies to the T coordinate system.

s = ? Returns the value of the vector time constant for the S coordinate plane.

t = ? Returns the value of the vector time constant for the T coordinate plane.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	1.0
In a Program	Yes	Default Format	1.4
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_VT contains the vector time constant.

RELATED COMMANDS:

"IT" on page 101 Independent Time Constant for smoothing independent moves

EXAMPLES:

VT 0.8 Set vector time constant for S coordinate system
VT ? Return vector time constant for S coordinate system
0.8

WC (Binary D4)

FUNCTION: Wait for Contour Data

DESCRIPTION:

The WC command acts as a flag in the Contour Mode. After this command is executed, the controller does not receive any new data until the internal contour data buffer is ready to accept new commands. This command prevents the contour data from overwriting on itself in the contour data buffer.

USAGE:

While Moving	Yes
In a Program	Yes
Command Line	Yes
Controller Usage	

DEFAULTS:

Default Value	1.0
Default Format	1.4

ALL CONTROLLERS

RELATED COMMANDS:

"CM" on page 49	Contour Mode
"CD" on page 45	Contour Data
"DT" on page 62	Contour Time

EXAMPLES:

CM XYZW	Specify contour mode
DT 4	Specify time increment for contour
CD 200,350,-150,500	Specify incremental position on X,Y,Z and W X-axis moves 200 counts Y-axis moves 300 counts Z-axis moves -150 counts W-axis moves 500 counts
WC	Wait for contour data to complete
CD 100,200,300,400	
WC	Wait for contour data to complete
DT 0	Stop contour
CD 0,0,0,0	Exit mode

WT (Binary D3)

FUNCTION: Wait

DESCRIPTION:

The WT command is a trippoint used to time events. After this command is executed, the controller will wait for the number of samples specified before executing the next command. If the TM command has not been used to change the sample rate from 1 msec, then the units of the Wait command are milliseconds.

ARGUMENTS: WT n where

n is an integer in the range 0 to 2 Billion decimal

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	-
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

EXAMPLES: Assume that 10 seconds after a move is over a relay must be closed.

#A	Program A
PR 50000	Position relative move
BGX	Begin the move
AMX	After the move is over
WT 10000	Wait 10 seconds
SB 0	Turn on relay
EN	End Program

Hint: To achieve longer wait intervals, just stack multiple WT commands.

XQ

FUNCTION: Execute Program

DESCRIPTION:

The XQ command begins execution of a program residing in the program memory of the controller. Execution will start at the label or line number specified. Up to 8 programs may be executed with the controller.

ARGUMENTS: XQ #A,n XQm,n where

A is a program name of up to seven characters.

m is a line number

n is an integer representing the thread number for multitasking

n is an integer in the range of 0 to 7.

NOTE: The arguments for the command, XQ, are optional. If no arguments are given, the first program in memory will be executed as thread 0.

USAGE:

DEFAULTS:

While Moving	Yes	Default Value of n:	0
In a Program	Yes	Default Format	-
Command Line	Yes		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

_XQn contains the current line number of execution for thread n, and -1 if thread n is not running.

RELATED COMMANDS:

"HX" on page 91 Halt execution

EXAMPLES:

XQ #Apple,0	Start execution at label Apple, thread zero
XQ #data,2	Start execution at label data, thread two
XQ 0	Start execution at line 0

Hint: Don't forget to quit the edit mode first before executing a program!

ZS

FUNCTION: Zero Subroutine Stack

DESCRIPTION:

The ZS command is only valid in an application program and is used to avoid returning from an interrupt (either input or error). ZS alone returns the stack to its original condition. ZS1 adjusts the stack to eliminate one return. This turns the jump to subroutine into a jump. Do not use RI (Return from Interrupt) when using ZS. To re-enable interrupts, you must use II command again.

The status of the stack can be interrogated with the operand `_ZSx` - see operand usage below.

ARGUMENTS: ZS n where

n = 0 Returns stack to original condition

n = 1 Eliminates one return on stack

USAGE:

DEFAULTS:

While Moving	Yes	Default Value	0
In a Program	Yes	Default Format	3.0
Command Line	No		
Controller Usage	ALL CONTROLLERS		

OPERAND USAGE:

`_ZSn` contains the stack level for the specified thread where n = 0,1,2 or 3. Note: n can also be specified using X (thread 0), Y(thread1), Z(thread2) or W(thread3) .

EXAMPLES:

II1	Input Interrupt on 1
#A;JP #A;EN	Main program
#ININT	Input Interrupt
MG "INTERRUPT"	Print message
S=_ZS	Interrogate stack
S=	Print stack
ZS	Zero stack
S=_ZS	Interrogate stack
S=	Print stack
EN	End

NOTES

NOTES

NOTES

Index

A

- Abort 13
 - Off On Error 13
 - Off-On-Error 135
 - Stop Motion 160
- Absolute Position 22–23, 60
- Acceleration 14
- Analog Feedback 17
- Analog Output 21
- Arm Latch 19
- Array 142
 - Dimension 59
 - Record Data 148
- Arrays
 - Deallocating 55
- Automatic Subroutine
 - MCTIME 73, 176
 - POSERR 79
- Auxiliary Encoder 48, 164
 - Define Position 57
 - Using Dual Loop 63

B

- Backlash Compensation
 - Dual Loop 63
- Binary Commands 4, 5
- Burn
 - Save Parameters 35
 - Save Program 37
 - Save Variables and Arrays 40

C

- Capture Data
 - Record 146
- Circle 52
- Circular Interpolation 183
- Clear Bit 43
- Clear Sequence 53

- Clock 167, 169
 - Sample Time 169
 - Update Rate 167
- Code 1
- Command
 - Syntax 2–3
- Communication Problems
 - CW Command 54
- Compare Function 57, 164
- Conditional jump 103
- Configure
 - Communication 54
 - DMA 61
 - Master Reset 154
 - Motor Type 128
 - Secondary FIFO 61
- Configure Encoders
 - CE Command 46
- Configure System
 - CN Command 50
- Contour Mode 45, 49, 190
 - Time Interval 62
- Coordinate Axes 42
- Coordinated Motion 179–80, 186, 188
 - Circular 183
 - Contour Mode 45, 49
 - Ecam 71, 72
 - Electronic Cam 64
 - Linear Interpolation 112–15
 - Vector Mode 42, 185
- Copyright Information 54
- Cycle Time
 - Clock 167, 169

D

- Data Adjustment Bit 54
- Data Capture 146
- Data Output
 - Set Bit 156
- Debugging
 - Trace Function 172
- Deceleration 56, 82
- Default Setting
 - Master Reset 4, 154
- Delta Time 62
- Digital Output
 - Clear Bit 43
- Dimension Array 59
- DMA 143, 145
 - Configure 61
- Download 58, 142
- Dual Encoder
 - Define Position 57
 - Dual Loop 63
- Dual Loop 63

E

- Ecram 71
 - ECAM Quit 78
 - Specify Table 77
- ECAM 72
 - Choose Master 64
 - Counter 66
 - Enable 65
 - Engage 68
 - Specify Cycles 72
 - Specify Table 81
- Echo 76, 161
- Edit
 - Use On Board Editor 67
- Edit Mode 67
- EEPROM
 - Erasing 154
- Ellipse Scale 80
- ELSE Function 71
- Encoder
 - Auxiliary Encoder 48, 164
 - Define Position 60
 - Quadrature 152, 171, 175
 - Set Auxiliary Encoder Position 57
- Error
 - Codes 162, 163
- Error Code 1
- Error Limit 79, 173
 - Off On Error 13
 - Off-On-Error 135
- Error Subroutine End 149
- Execute Program 192

F

- Feedforward Acceleration 82
- Filter Parameter
 - Integrator Limit 98
- Find Edge 83
- Find Index 84
- Formatting 120
 - Variables 182
- Frequency
 - Sample Time 169

G

- Gearing
 - Set Gear Master 87
 - Set Gear Ratio 89

H

- Halt 91
 - Abort 13

- Off On Error 13
- Off-On-Error 135
- Stop Motion 160, 175
- Hardware 33
 - Set Bit 156
 - Torque Limit 168
- Home Input 83
- Home Switch
 - Configure 50
- Homing
 - Find Edge 83
 - Find Index 84

I

- I/O
 - Clear Bit 43
 - Set Bit 156
- IF conditional 93
- IF Conditional Statements
 - ELSE 71
- IF Statement
 - ENDIF 75
- Independent Motion
 - Deceleration 56
 - Jog 100, 102
- Independent Time Constant 101
- ININT 18, 96
- Input Interrupt 96, 161
 - ININT 18, 96
- Integral Gain 106
- Integrator 98
- Interrogation
 - Tell Position 171
 - Tell Switches 173
 - Tell Torque 174
 - Tell Velocity 175
- Interrupt 96, 161, 177
 - Enable 69
- Invert Encoders 46

J

- Jog 100, 102

K

- Keyword 117
 - TIME 167
- KS 108

L

- Label 58, 96
- Latch 19
 - Arm Latch 19

- Configure 50
- Report Position 151
- Limit Switch 85, 117, 157, 161
 - Configure 50
 - Forward 111
- Linear Interpolation 112–15
 - Clear Sequence 53
 - End of Motion 110

M

- Master Reset 4, 154
- MCTIME 73, 176
- Memory 35, 118
 - Array 142
 - Deallocating Arrays and Variables 55
 - Download 142
- Modbus 21
- Motion Complete
 - MCTIME 73, 176
- Motion Smoothing 24
 - S-Curve 101
 - VT 189
- Motor Type 128
- Moving
 - Circular 183
- Multitasking
 - Execute Program 192
 - Halt Thread 91

N

- Non-volatile memory
 - Burn 35, 37, 40

O

- OE
 - Off On Error 13
 - Off-On-Error 135
- Off On Error 13
- Off On Error Error 135
- Off-On-Error 135
- Output of Data
 - Set Bit 156

P

- PID
 - Integral Gain 106
- Plug and Play 69
- POSERR 79
 - Position Error 135
- Position Capture 19
 - Latch 19
- Position Error 135

- POSERR 79
- Position Limit 85
- Program
 - Download 58
 - Upload 178
- Program Flow
 - Interrupt 96, 161
 - Stack 96, 193
- Programming
 - Halt 91
- Protection
 - Error Limit 79, 173
 - Torque Limit 168

Q

- Quadrature 152, 171, 175
- Quit
 - Abort 13
 - Stop Motion 160, 175

R

- Record 146, 147
- Reset 4, 153
 - Master Reset 4, 154
- Return from Interrupt Routine 150
- Revision Information 155

S

- Sample Time 169
 - Update Rate 167
- Save
 - Parameters 35
 - Program 37
 - Variables and Arrays 40
- SB
 - Set Bit 156
- Scaling
 - Ellipse Scale 80
- S-Curve 101
- Secondary FIFO
 - Configure 61
- Selective Abort
 - Configure 50
- Set Bit 156
- slew 159
- Slew 100, 102
- Smoothing 24, 101
 - KS 108
- speed 159
- Stack 96
 - Zeroing 193
- Status 55, 91, 135, 161
 - Stop Code 157

- Tell Inputs 166
- Tell Status 173
- Step Motor
 - Smoothing 108
- Stepper Smoothing 108
- Stop
 - Abort 13
- Stop Code 1, 157
- Stop Motion 160, 175
- Subroutine 96, 104, 176
- Syntax 2–3

T

- Tangent 170, 183
- Teach
 - Data Capture 146
 - Record 146
- Theory 105
- Time
 - Clock 167, 169
 - Sample Time 169
 - Update Rate 167
- Timeout 123, 176
 - MCTIME 176
- Torque Limit 168
- Trippoint 15, 18, 20, 22, 23, 24, 25, 26, 91–96, 91–96, 191
 - After Absolute Position 22
 - After Distance 15
 - After Input 18
 - After Motion 20
 - After Relative Distance 23
 - After Vector Distance 26
 - At Speed 24
 - At Time 25
 - Contour Mode 190
 - In Position Time Out 176
 - Motion Complete 123
 - Motion Forward 124
 - Motion Reverse 127
- Troubleshooting 162

U

- Update Rate 167
 - Sample Time 169
- Upload 178
- User Interrupt 177

V

- Variables
 - Deallocating 55
- Vector Acceleration 179–81
- Vector Mode 185

- Circular Interpolation 183
- Clear Sequence 53
- Ellipse Scale 80
- Specify Coordinate Axes 42
- Tangent 170, 183
- Vector Motion 183
 - Circle 52
- Vector Position 185
- Vector Speed 188
- Vector Speed Ratio 187

X

- XQ
 - Execute Program 192

Z

- Zero Stack 193